

intervals may be used unless the actions and intervals are approved as an alternative method of compliance (AMOC) in accordance with the procedures specified in paragraph (j)(1) of this AD.

(i) Terminating Actions

(1) Accomplishing the actions required by this AD terminates all requirements of AD 2019-01-05.

(2) Accomplishing the action required by task number 274400-00004-1-E of Airbus A330 Airworthiness Limitations Section (ALS) Part 4, System Equipment Maintenance Requirements (SEMR), Revision 07, dated October 15, 2018, within the compliance time specified for that task in Airbus A330 Airworthiness Limitations Section (ALS) Part 4, System Equipment Maintenance Requirements (SEMR), Revision 07, dated October 15, 2018, terminates all requirements of AD 2017-25-13 for Airbus SAS Model A330-200, A330-200 Freighter, and A330-300 series airplanes only.

(3) Accomplishing the action required by task number 213100-00001-1-E of Airbus A330 Airworthiness Limitations Section (ALS) Part 4, System Equipment Maintenance Requirements (SEMR), Revision 07, dated October 15, 2018, within the compliance time specified for that task in Airbus A330 Airworthiness Limitations Section (ALS) Part 4, System Equipment Maintenance Requirements (SEMR), Revision 07, dated October 15, 2018, terminates all requirements of AD 2014-16-22 for Airbus SAS Model A330-200, A330-200 Freighter, and A330-300 series airplanes only.

(j) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Section, Transport Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (k)(2) of this AD. Information may be emailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Section, Transport Standards Branch, FAA; or the European Aviation Safety Agency (EASA); or Airbus SAS's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC)*: If any service information contains procedures or tests that are identified as RC, those procedures and tests must be done to comply

with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

(k) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA AD 2019-0047, dated March 11, 2019, for related information. This MCAI may be found in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0492.

(2) For more information about this AD, contact Vladimir Ulyanov, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3229.

(3) For service information identified in this AD, contact Airbus SAS, Airworthiness Office—EAL, Rond-Point Emile Dewoitine No: 2, 31700 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 45 80; email airworthiness.A330-A340@airbus.com; internet <http://www.airbus.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued in Des Moines, Washington, on June 25, 2019.

Dionne Palermo,

Acting Director, System Oversight Division, Aircraft Certification Service.

[FR Doc. 2019-14047 Filed 7-2-19; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2019-0498; Product Identifier 2019-NM-073-AD]

RIN 2120-AA64

Airworthiness Directives; Airbus SAS Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain Airbus SAS Model A330-202, -243, -243F, -302, -323, and -343 airplanes. This proposed AD was prompted by a report that cracks have been found within the ring gears of the

slat geared rotary actuators (SGRAs) due to a change in the manufacturing process and inadequate post-production non-destructive testing for potential cracking. This proposed AD would require an inspection to determine the part number and serial number of the SGRAs, and replacement of each affected SGRA with a serviceable part, as specified in an European Aviation Safety Agency (EASA) AD, which will be incorporated by reference. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by August 19, 2019.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal*: Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax*: 202-493-2251.

- *Mail*: U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery*: Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For the material identified in this proposed AD that will be incorporated by reference (IBR), contact the EASA, at Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 89990 1000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find this IBR material on the EASA website at <https://ad.easa.europa.eu>. You may view this IBR material at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0498.

Examining the AD Docket

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0498; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for Docket Operations is listed above. Comments will be

available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT:
Vladimir Ulyanov, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax: 206-231-3229.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2019-0498; Product Identifier 2019-NM-073-AD” at the beginning of your comments. The FAA specifically invites comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. The FAA will consider all comments received by the closing date and may amend this NPRM based on those comments.

The FAA will post all comments the agency receives, without change, to <http://www.regulations.gov>, including any personal information you provide. The FAA will also post a report summarizing each substantive verbal contact received about this NPRM.

Discussion

The EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2019-0093, dated April 26, 2019 (“EASA AD 2019-0093”) (also referred to as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for certain Airbus SAS Model A330-202, -243, -243F, -302, -323, and -343 airplanes. The MCAI states:

Cracks have been found within the ring gears of an SGRA. Investigation identified that this is due to a change in the manufacturing process of the 300M steel raw material in conjunction with inadequate post-production non-destructive testing for potential cracks. A batch of SGRA has been identified as having been subject to this manufacturing process.

This condition, if not detected and corrected, could, in combination with an

independent failure on the second SGRA of the same slat surface, lead to an uncontrolled movement of the affected slat surface in flight, or detachment of the slat surface, possibly resulting in damage to the stabilizers, or reduced control of the aeroplane.

To address this potential unsafe condition, Airbus issued the SB [service bulletin] to provide instructions to replace the affected parts, referencing the Liebherr SB for in-shop correction.

For the reasons described above, this [EASA] AD requires [an inspection to determine the part number and serial number of an SGRA and] replacement of each affected part with a serviceable part [if necessary].

Related IBR Material Under 1 CFR Part 51

EASA AD 2019-0093 describes procedures for an inspection to determine the part number and serial number of the SGRAs, and replacement of each affected part with a serviceable part.

This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

FAA’s Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to a bilateral agreement with the State of Design Authority, the FAA has been notified of the unsafe condition described in the MCAI referenced above. The FAA is proposing this AD because the agency evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

Proposed AD Requirements

This proposed AD would require accomplishing the actions specified in EASA AD 2019-0093 described previously, as incorporated by reference, except for any differences identified as exceptions in the

regulatory text of this AD and except as discussed under “Differences Between this Proposed AD and the MCAI.”

Explanation of Required Compliance Information

In the FAA’s ongoing efforts to improve the efficiency of the AD process, the FAA worked with Airbus and EASA to develop a process to use certain EASA ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. As a result, EASA AD 2019-0093 will be incorporated by reference in the FAA final rule. This proposed AD would, therefore, require compliance with the provisions specified in EASA AD 2019-0093, through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Service information specified in EASA AD 2019-0093 that is required for compliance with EASA AD 2019-0093 will be available on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0498 after the FAA final rule is published.

Difference Between This Proposed AD and the MCAI

EASA AD 2019-0093 requires that operators report to Airbus when all affected parts have been replaced. This AD, however, does not include that requirement. The FAA has determined that reporting may be done at the discretion of the operators, but reporting is not necessary. Only two U.S.-registered airplanes are affected. Reporting would not provide useful statistical information to Airbus. Further, any affected part must be sent to the parts manufacturer for repair, which will provide the visibility of a discrepant part that was initially installed.

Costs of Compliance

The FAA estimates that this proposed AD affects 2 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

| Labor cost | Parts cost | Cost per product | Cost on U.S. operators |
|--|------------|-------------------|------------------------|
| Up to 2 work-hours × \$85 per hour = \$170 | \$0 | Up to \$170 | Up to \$340. |

The FAA estimates the following costs to do any necessary on-condition action that would be required based on

the results of any required actions. The FAA has no way of determining the

number of aircraft that might need this on-condition action:

ESTIMATED COSTS OF ON-CONDITION ACTIONS

| Labor cost | Parts cost | Cost per product |
|---|------------|------------------|
| Up to 15 work-hours × \$85 per hour = \$1,275 | * | Up to \$1,275.* |

* According to the manufacturer, some or all of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we have included all known costs in our cost estimate.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This proposed AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes and associated appliances to the Director of the System Oversight Division.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation: Is not a “significant regulatory action” under Executive Order 12866; Will not affect intrastate aviation in Alaska; and Will not have a significant economic impact, positive or negative, on a substantial

number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

Airbus SAS: Docket No. FAA–2019–0498; Product Identifier 2019–NM–073–AD.

(a) Comments Due Date

We must receive comments by August 19, 2019.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Airbus SAS Model A330–202, –243, –243F, –302, –323, and –343 airplanes, certificated in any category, as identified in European Aviation Safety Agency (EASA) AD 2019–0093, dated April 26, 2019 (“EASA AD 2019–0093”).

(d) Subject

Air Transport Association (ATA) of America Code 27, Flight control.

(e) Reason

This AD was prompted by a report that cracks have been found within the ring gears of the slat geared rotary actuators (SGRAs) due to a change in the manufacturing process and inadequate post-production non-destructive testing for potential cracking. The FAA is issuing this AD to address cracking of an SGRA, which, in combination with an independent failure on the second SGRA of the same slat surface, could lead to an uncontrolled movement of the affected slat surface in flight, or detachment of the slat surface, and could possibly result in damage to the stabilizers and reduced controllability of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2019–0093.

(h) Exceptions to EASA AD 2019–0093

(1) For purposes of determining compliance with the requirements of this AD: Where EASA AD 2019–0093 refers to its effective date, this AD requires using the effective date of this AD.

(2) The “Remarks” section of EASA AD 2019–0093 does not apply to this AD.

(i) No Reporting Requirement

Although EASA AD 2019–0093 specifies to submit certain information to the manufacturer, this AD does not include that requirement.

(j) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Section, Transport Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (k)(2) of this AD. Information may be emailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Section, Transport Standards Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC):* For any service information referenced in EASA AD 2019–0093 that contains RC procedures and tests: Except as required by paragraph (j)(2) of this AD, RC procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are

recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

(k) Related Information

(1) For information about EASA AD 2019-0093, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 89990 6017; email ADs@easa.europa.eu; Internet www.easa.europa.eu. You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>. You may view this EASA AD at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. EASA AD 2019-0093 may be found in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0498.

(2) For more information about this AD, contact Vladimir Ulyanov, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax: 206-231-3229.

Issued in Des Moines, Washington, on June 25, 2019.

Dionne Palermo,

Acting Director, System Oversight Division, Aircraft Certification Service.

[FR Doc. 2019-14046 Filed 7-2-19; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2019-0521; Product Identifier 2019-NM-047-AD]

RIN 2120-AA64

Airworthiness Directives; Saab AB, Saab Aeronautics (Formerly Known as Saab AB, Saab Aerosystems) Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for all Saab AB, Saab Aeronautics Model SAAB 2000 airplanes. This proposed AD was prompted by reports of cracks in the o-ring groove of magnetic fuel level indicators. This proposed AD would require a one-time detailed inspection of the magnetic fuel level

indicator for cracks and replacement of cracked magnetic fuel level indicators. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: We must receive comments on this proposed AD by August 19, 2019.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Saab AB, Saab Aeronautics, SE-581 88, Linköping, Sweden; telephone +46 13 18 5591; fax +46 13 18 4874; email saab2000.techsupport@saabgroup.com; internet <http://www.saabgroup.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Examining the AD Docket

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0521; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for Docket Operations is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT:

Shahram Daneshmandi, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3220.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2019-0521; Product

Identifier 2019-NM-047-AD" at the beginning of your comments. The agency specifically invites comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. The agency will consider all comments received by the closing date and may amend this NPRM because of those comments.

The FAA will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA Airworthiness Directive 2019-0053, dated March 14, 2019 (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for all Saab AB, Saab Aeronautics Model SAAB 2000 airplanes. The MCAI states:

Occurrences have been reported where, during maintenance, magnetic fuel level indicators were found with cracks in the O-ring groove. Investigation results indicate that these cracks may be due to over-torque during installation of the unit, although the applicable Aircraft Maintenance Manual instructs that the proper nut torque is between 2.8 and 3.4 Nm.

This condition, if not detected and corrected, could lead to failure of an indicator, possibly resulting in a puncture of the fuel tank bottom, with consequent fuel leakage and risk of fuel starvation.

To address this potential unsafe condition, SAAB issued the SB [service bulletin] to provide inspection instructions.

For the reason described above, this [EASA] AD requires a one-time inspection of affected parts and, depending on findings, accomplishment of applicable corrective action(s).

You may examine the MCAI in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0521.

Related Service Information Under 14 CFR Part 51

Saab AB, Saab Aeronautics (Formerly Known as Saab AB, Saab Aerosystems) has issued Service Bulletin 2000-28-027, dated January 15, 2019. This service information describes procedures for a one-time detailed inspection of the magnetic fuel level indicator for cracks and replacement of cracked magnetic fuel level indicators. This service information is reasonably available because the interested parties