

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

2019–21–05 Airbus SAS: Amendment 39–19771; Docket No. FAA–2019–0718; Product Identifier 2019–NM–128–AD.

(a) Effective Date

This AD becomes effective November 21, 2019.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Airbus SAS Model A330–200, A330–200 Freighter, A330–300, A340–200, A340–300, A340–500, and A340–600 series airplanes, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2019–0176, dated July 19, 2019 (“EASA AD 2019–0176”).

(d) Subject

Air Transport Association (ATA) of America Code 35, Oxygen.

(e) Reason

This AD was prompted by reports that non-approved passenger oxygen containers (POCs) may have been installed on the affected airplanes. The FAA is issuing this AD to address possible non-approved POC installation, which could lead to reduced available oxygen capacity, possibly resulting in injury to airplane occupants following a depressurization event.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2019–0176.

(h) Exceptions to EASA AD 2019–0176

(1) Where EASA AD 2019–0176 refers to its effective date, this AD requires using the effective date of this AD.

(2) The “Remarks” section of EASA AD 2019–0176 does not apply to this AD.

(i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Section, Transport Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Section, Transport Standards Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC):* For any service information referenced in EASA AD 2019–0176 that contains RC procedures and tests: Except as required by paragraph (i)(2) of this AD, RC procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

(j) Related Information

For more information about this AD, contact Vladimir Ulyanov, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206–231–3229.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2019–0176, dated July 19, 2019.

(ii) [Reserved]

(3) For information about EASA AD 2019–0176, contact the EASA, at Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 89990 6017; email ADs@easa.europa.eu; Internet www.easa.europa.eu. You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>.

(4) You may view this material at the FAA, Transport Standards Branch, 2200 South

216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. EASA AD 2019–0176 may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2019–0718.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fedreg.legal@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Des Moines, Washington, on October 18, 2019.

Dionne Palermo,

Acting Director, System Oversight Division, Aircraft Certification Service.

[FR Doc. 2019–24160 Filed 11–5–19; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2019–0724; Product Identifier 2019–NM–134–AD; Amendment 39–19773; AD 2019–21–07]

RIN 2120–AA64

Airworthiness Directives; Airbus SAS Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule; request for comments.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for certain Airbus SAS Model A350–941 airplanes. This AD was prompted by a report of cracked external lugs of the aluminum cargo door latch fittings in the lower part of the forward and aft cargo doors. This AD requires repetitive detailed inspections of the external lugs of the aluminum cargo door latch fittings for cracks, and corrective actions if necessary, as specified in a European Union Aviation Safety Agency (EASA) AD, which is incorporated by reference. Accomplishing the installation of new aluminum cargo door latch fittings constitutes terminating action for the repetitive detailed inspections. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD becomes effective November 21, 2019.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of November 21, 2019.

The FAA must receive comments on this AD by December 23, 2019.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202–493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For the material incorporated by reference (IBR) in this AD, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 89990 1000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find this IBR material on the EASA website at <https://ad.easa.europa.eu>. You may view this IBR material at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. It is also available in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2019–0724.

Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2019–0724; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for Docket Operations is listed above. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT: Kathleen Arrigotti, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206–231–3218.

SUPPLEMENTARY INFORMATION:

Discussion

The EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2019–0181, dated July 26, 2019 (“EASA AD 2019–0181”) (also referred to as the

Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for certain Airbus SAS Model A350–941 airplanes.

This AD was prompted by a report of cracked external lugs of the aluminum cargo door latch fittings in the lower part of the forward and aft cargo doors. The FAA is issuing this AD to address this condition, which, if not detected and corrected, could result in rapid decompression or loss of structural integrity of the airplane. See the MCAI for additional background information.

Related IBR Material Under 1 CFR Part 51

EASA AD 2019–0181 describes procedures for repetitive detailed inspections of the external lugs of the aluminum cargo door latch fittings for cracks and corrective actions if necessary. Corrective actions include installation of new aluminum cargo door latch fittings. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

FAA’s Determination

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to a bilateral agreement with the State of Design Authority, the FAA has been notified of the unsafe condition described in the MCAI referenced above. The FAA is issuing this AD because the agency evaluated all pertinent information and determined the unsafe condition exists and is likely to exist or develop on other products of the same type design.

Requirements of This AD

This AD requires accomplishing the actions specified in EASA AD 2019–0181 described previously, as incorporated by reference, except for any differences identified as exceptions in the regulatory text of this AD.

Explanation of Required Compliance Information

In the FAA’s ongoing efforts to improve the efficiency of the AD process, the FAA initially worked with Airbus and EASA to develop a process to use certain EASA ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has since coordinated with other manufacturers and civil aviation authorities (CAAs) to use this process. As a result, EASA AD 2019–0181 will be incorporated by

reference in the FAA final rule. This AD, therefore, requires compliance with EASA AD 2019–0181 in its entirety, through that incorporation, except for any differences identified as exceptions in the regulatory text of this AD. Using common terms that are the same as the heading of a particular section in the EASA AD does not mean that operators need comply only with that section. For example, where the AD requirement refers to “all required actions and compliance times,” compliance with this AD requirement is not limited to the section titled “Required Action(s) and Compliance Time(s)” in the EASA AD. Service information specified in EASA AD 2019–0181 that is required for compliance with EASA AD 2019–0181 will be available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2019–0724 after the FAA final rule is published.

FAA’s Justification and Determination of the Effective Date

Since there are currently no domestic operators of this product, notice and opportunity for public comment before issuing this AD are unnecessary. In addition, for the reasons stated above, the FAA finds that good cause exists for making this amendment effective in less than 30 days.

Comments Invited

This AD is a final rule that involves requirements affecting flight safety, and the FAA did not precede it by notice and opportunity for public comment. The FAA invites you to send any written relevant data, views, or arguments about this AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA–2019–0724; Product Identifier 2019–NM–134–AD” at the beginning of your comments. The FAA specifically invites comments on the overall regulatory, economic, environmental, and energy aspects of this AD. The FAA will consider all comments received by the closing date and may amend this AD based on those comments.

The FAA will post all comments received, without change, to <http://www.regulations.gov>, including any personal information you provide. The FAA will also post a report summarizing each substantive verbal contact received about this AD.

Costs of Compliance

Currently, there are no affected U.S.-registered airplanes. If an affected airplane is imported and placed on the U.S. Register in the future, the following

are the cost estimates to comply with this AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product
6 work-hour × \$85 per hour = \$510	\$0	\$510

The FAA estimates the following costs to do any necessary on-condition actions that would be required based on the results of any required actions. The FAA has no way of determining the number of aircraft that might need these on-condition action:

ESTIMATED COSTS OF ON-CONDITION ACTIONS

Labor cost	Parts cost	Cost per product
49 work-hours × \$85 per hour = \$4,165	\$83,600	\$87,765

According to the manufacturer, some or all of the costs of this AD may be covered under warranty, thereby reducing the cost impact on affected individuals. The FAA does not control warranty coverage for affected individuals. As a result, the FAA has included all known costs in the cost estimate.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes and associated appliances to

the Director of the System Oversight Division.

Regulatory Findings

The FAA has determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

2019–21–07 Airbus SAS: Amendment 39–19773; Docket No. FAA–2019–0724; Product Identifier 2019–NM–134–AD.

(a) Effective Date

This AD becomes effective November 21, 2019.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Airbus SAS Model A350–941 airplanes, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2019–0181, dated July 26, 2019 (“EASA AD 2019–0181”).

(d) Subject

Air Transport Association (ATA) of America Code 53, Fuselage.

(e) Reason

This AD was prompted by a report of cracked external lugs of the aluminum cargo door latch fittings in the lower part of the forward and aft cargo doors. The FAA is issuing this AD to address this condition, which, if not detected and corrected, could result in rapid decompression or loss of structural integrity of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2019–0181.

(h) Exceptions to EASA AD 2019–0181

(1) Where EASA AD 2019–0181 refers to its effective date, this AD requires using the effective date of this AD.

(2) The “Remarks” section of EASA AD 2019–0181 does not apply to this AD.

(i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Section, Transport Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Section, Transport Standards Branch, FAA; or EASA; or Airbus SAS's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC)*: For any service information referenced in EASA AD 2019-0181 that contains RC procedures and tests: Except as required by paragraph (i)(2) of this AD, RC procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

(j) Related Information

For more information about this AD, contact Kathleen Arrigotti, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3218.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2019-0181, dated July 26, 2019.

(ii) [Reserved]

(3) For information about EASA AD 2019-0181, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 89990 6017; email ADs@easa.europa.eu; Internet www.easa.europa.eu. You may find this

EASA AD on the EASA website at <https://ad.easa.europa.eu>.

(4) You may view this material at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0724.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fedreg.legal@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Des Moines, Washington, on October 18, 2019.

Dionne Palermo,

Acting Director, System Oversight Division, Aircraft Certification Service.

[FR Doc. 2019-24191 Filed 11-5-19; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2019-0522; Product Identifier 2019-NM-082-AD; Amendment 39-19737; AD 2019-19-01]

RIN 2120-AA64

Airworthiness Directives; Airbus SAS Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Final rule.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for all Airbus SAS Model A320-251N and -271N airplanes, and Model A321-251N, -253N, -271N, and -272N airplanes. This AD was prompted by reports that the regulated bleed temperature was measured above the design target with a temperature regulation shift phenomenon, and investigation results show that incorrect temperature regulation can degrade pneumatic system components located downstream of the pre-cooler. This AD requires uploading improved bleed monitoring computer (BMC) software (SW), as specified in a European Union Aviation Safety Agency (EASA) AD, which is incorporated by reference. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective December 11, 2019.

The Director of the Federal Register approved the incorporation by reference

of a certain publication listed in this AD as of December 11, 2019.

ADDRESSES: For the material incorporated by reference (IBR) in this AD, contact the EASA, at Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 89990 1000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find this IBR material on the EASA website at <https://ad.easa.europa.eu>. You may view this IBR material at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0522.

Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0522; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the regulatory evaluation, any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

FOR FURTHER INFORMATION CONTACT: Sanjay Ralhan, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3223.

SUPPLEMENTARY INFORMATION:**Discussion**

The EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2019-0094, dated April 26, 2019 ("EASA AD 2019-0094") (also referred to as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for all Airbus SAS Model A320-251N and -271N airplanes, and Model A321-251N, -253N, -271N, and -272N airplanes.

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to all Airbus SAS Model A320-251N and -271N airplanes, and Model A321-251N, -253N, -271N, and -272N airplanes. The NPRM published in the **Federal Register** on July 8, 2019 (84 FR