

additional analysis and tests may be required to demonstrate that the injury criteria are met for the area that an occupant could contact. For example, if different yaw angles could result in different airbag performance, then additional analysis or separate tests may be necessary to evaluate performance.

3. Neck Injury Criteria:

The seating system must protect the occupant from experiencing serious neck injury. The assessment of neck injury must be conducted with the airbag device activated, unless there is reason to also consider that the neck-injury potential would be higher for impacts below the airbag-device deployment threshold.

a. The N_{ij} (calculated in accordance with 49 CFR 571.208) must be below 1.0, where $N_{ij} = F_z/F_{zc} + M_y/M_{yc}$, and N_{ij} critical values are:

- i. $F_{zc} = 1530$ lb for tension
- ii. $F_{zc} = 1385$ lb for compression
- iii. $M_{yc} = 229$ lb-ft in flexion
- iv. $M_{yc} = 100$ lb-ft in extension

b. In addition, peak F_z must be below 937 lb in tension and 899 lb in compression.

c. Rotation of the head about its vertical axis, relative to the torso, is limited to 105 degrees in either direction from forward-facing.

d. The neck must not impact any surface that would produce concentrated loading on the neck.

4. Spine and Torso Injury Criteria:

a. The lumbar spine tension (F_z) cannot exceed 1200 lb.

b. Significant concentrated loading on the occupant's spine, in the area between the pelvis and shoulders during impact, including rebound, is not acceptable. During this type of contact, the interval for any rearward (X direction) acceleration exceeding 20g must be less than 3 milliseconds as measured by the thoracic instrumentation specified in 49 CFR part 572, subpart E, filtered in accordance with SAE International (SAE) recommended practice J211/1, "Instrumentation for Impact Test-Part 1-Electronic Instrumentation."

c. The occupant must not interact with the armrest or other seat components in any manner significantly different than would be expected for a forward-facing seat installation.

5. Pelvis Criteria:

Any part of the load-bearing portion of the bottom of the ATD pelvis must not translate beyond the edges of the seat bottom seat-cushion supporting structure.

6. Femur Criteria:

Axial rotation of the upper leg (about the z-axis of the femur per SAE

Recommended Practice J211/1) must be limited to 35 degrees from the nominal seated position. Evaluation during rebound does not need to be considered.

7. ATD and Test Conditions:

Longitudinal tests conducted to measure the injury criteria above must be performed with the FAA Hybrid III ATD, as described in SAE 1999-01-1609, "A Lumbar Spine Modification to the Hybrid III ATD for Aircraft Seat Tests." The tests must be conducted with an undeformed floor, at the most-critical yaw cases for injury, and with all lateral structural supports (e.g. armrests or walls) installed.

Note: The applicant must demonstrate that the installation of seats via plinths or pallets meets all applicable requirements. Compliance with the guidance contained in policy memorandum PS-ANM-100-2000-00123, "Guidance for Demonstrating Compliance with Seat Dynamic Testing for Plinths and Pallets," dated February 2, 2000, is acceptable to the FAA.

Inflatable Airbag Restraint Systems Special Conditions:

If inflatable airbag restraint systems are installed, the airbag systems must meet the requirements of Airbus Model A330 special conditions no. 25-395-SC, "Seats with Inflatable Lapbelts."

Issued in Des Moines, Washington, on December 6, 2019.

James E. Wilborn,

Acting Manager, Transport Standards Branch, Policy and Innovation Division, Aircraft Certification Service.

[FR Doc. 2019-26722 Filed 12-11-19; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2019-0584; Product Identifier 2019-NM-096-AD; Amendment 39-19809; AD 2019-23-15]

RIN 2120-AA64

Airworthiness Directives; Airbus Canada Limited Partnership (Type Certificate Previously Held by C Series Aircraft Limited Partnership (CSALP); Bombardier, Inc.) Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Final rule.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for certain Airbus Canada Limited Partnership Model BD-500-1A10 and BD-500-1A11 airplanes. This AD was prompted

by a determination that new or more restrictive airworthiness limitations are necessary. This AD requires revising the existing maintenance or inspection program, as applicable, to incorporate new or more restrictive airworthiness limitations. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective January 16, 2020.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of January 16, 2020.

ADDRESSES: For service information identified in this final rule, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; phone: 514-855-5000; fax: 514-855-7401; email: thd.crj@aero.bombardier.com;

internet: <http://www.bombardier.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0584.

Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0584; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the regulatory evaluation, any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

FOR FURTHER INFORMATION CONTACT:

Andrea Jimenez, Aerospace Engineer, Airframe and Propulsion Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone: 516-228-7330; fax: 516-794-5531; email: 9-avs-nyaco-cos@faa.gov.

SUPPLEMENTARY INFORMATION:

Discussion

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued Canadian AD CF-2019-14R1, dated September 11, 2019 ("AD CF-2019-14R1") (also referred to as the Mandatory Continuing Airworthiness Information, or "the

MCAI”), to correct an unsafe condition for certain Airbus Canada Limited Partnership Model BD–500–1A10 and BD–500–1A11 airplanes. You may examine the MCAI in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2019–0584.

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain Airbus Canada Limited Partnership Model BD–500–1A10 and BD–500–1A11 airplanes. The NPRM published in the **Federal Register** on August 5, 2019 (84 FR 37976). The NPRM was prompted by a determination that new or more restrictive airworthiness limitations are necessary. The NPRM proposed to require revising the existing maintenance or inspection program, as applicable, to incorporate new or more restrictive airworthiness limitations. The FAA is issuing this AD to address reduced structural integrity of the airplane or reduced controllability of the airplane. See the MCAI for additional background information.

The NPRM referred to Canadian AD CF–2019–14, dated April 5, 2019. Since the FAA issued the NPRM, TCCA has issued Canadian AD CF–2019–14R1, dated September 11, 2019, which has no significant changes that affect this AD.

Comments

The FAA gave the public the opportunity to participate in developing this final rule. The FAA has received no comments on the NPRM or on the determination of the cost to the public.

Conclusion

The FAA has reviewed the relevant data and determined that air safety and the public interest require adopting this final rule as proposed, except for minor editorial changes. The FAA has determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM for addressing the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM.

Related Service Information Under 1 CFR Part 51

Bombardier has issued C Series Airworthiness Limitations, BD500–3AB48–11400–02, Issue 009.00, dated June 6, 2019. This service information describes airworthiness limitations for fuel tank systems, safe life limits, and certification maintenance requirements. This service information is reasonably available because the interested parties

have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

Costs of Compliance

The FAA estimates that this AD affects 13 airplanes of U.S. registry. The FAA estimates the following costs to comply with this AD:

The FAA has determined that revising the existing maintenance or inspection program takes an average of 90 work-hours per operator, although the agency recognizes that this number may vary from operator to operator. In the past, the FAA has estimated that this action takes 1 work-hour per airplane. Since operators incorporate maintenance or inspection program changes for their affected fleet(s), the FAA has determined that a per-operator estimate is more accurate than a per-airplane estimate. Therefore, the FAA estimates the total cost per operator to be \$7,650 (90 work-hours × \$85 per work-hour).

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes and associated appliances to the Director of the System Oversight Division.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a

substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

2019–23–15 Airbus Canada Limited Partnership (Type Certificate previously held by C Series Aircraft Limited Partnership (CSALP); Bombardier, Inc.): Amendment 39–19809; Docket No. FAA–2019–0584; Product Identifier 2019–NM–096–AD.

(a) Effective Date

This AD is effective January 16, 2020.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Airbus Canada Limited Partnership (Type Certificate previously held by C Series Aircraft Limited Partnership (CSALP); Bombardier, Inc.) Model BD–500–1A10 and BD–500–1A11 airplanes, certificated in any category, identified in paragraphs (c)(1) and (2) of this AD.

(1) Model BD–500–1A10 airplanes, serial numbers 50001 and subsequent with an original airworthiness certificate or original export certificate of airworthiness issued on or before June 6, 2019.

(2) Model BD–500–1A11 airplanes, serial numbers 55001 and subsequent with an original airworthiness certificate or original export certificate of airworthiness issued on or before June 6, 2019.

(d) Subject

Air Transport Association (ATA) of America Code 05, Time Limits/Maintenance Checks.

(e) Reason

This AD was prompted by a determination that new or more restrictive airworthiness limitations are necessary. The FAA is issuing this AD to prevent reduced structural integrity of the airplane or reduced controllability of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Maintenance or Inspection Program Revision

Within 90 days after the effective date of this AD, revise the existing maintenance or inspection program, as applicable, to incorporate the information specified in Bombardier C Series Airworthiness Limitations, BD500-3AB48-11400-02, Issue 009.00, dated June 6, 2019. The initial compliance time for doing the tasks is at the time specified in Bombardier C Series Airworthiness Limitations, BD500-3AB48-11400-02, Issue 009.00, dated June 6, 2019, or within 90 days after the effective date of this AD, whichever occurs later.

(h) No Alternative Actions, Intervals, or Critical Design Configuration Control Limitations (CDCCLs)

After the existing maintenance or inspection program has been revised as required by paragraph (g) of this AD, no alternative actions (e.g., inspections), intervals, or CDCCLs may be used unless the actions, intervals, and CDCCLs are approved as an alternative method of compliance (AMOC) in accordance with the procedures specified in paragraph (i)(1) of this AD.

(i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: 516-228-7300; fax: 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation

(TCCA); or Airbus Canada Limited Partnership's TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

(j) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian AD CF-2019-14R1, dated September 11, 2019, for related information. This MCAI may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0584.

(2) For more information about this AD, contact Andrea Jimenez, Aerospace Engineer, Airframe and Propulsion Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone: 516-228-7330; fax: 516-794-5531; email: g-avs-nyaco-cos@faa.gov.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Bombardier C Series Airworthiness Limitations, BD500-3AB48-11400-02, Issue 009.00, dated June 6, 2019.

(ii) [Reserved]

(3) For service information identified in this AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; phone: 514-855-5000; fax: 514-855-7401; email: thd.crj@aero.bombardier.com; internet: <http://www.bombardier.com>.

(4) You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fedreg.legal@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Des Moines, Washington, on November 26, 2019.

Michael Kaszycki,

Acting Director, System Oversight Division, Aircraft Certification Service.

[FR Doc. 2019-26738 Filed 12-11-19; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2019-0443; Product Identifier 2019-NM-056-AD; Amendment 39-19807; AD 2019-23-13]

RIN 2120-AA64

Airworthiness Directives; Airbus SAS Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Final rule.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for certain Airbus SAS Model A320-251N and A321-253N airplanes. This AD was prompted by reports of cracks on the pylon block seals. This AD requires replacement of the pylon block seals, as specified in a European Union Aviation Safety Agency (EASA) AD, which is incorporated by reference. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective January 16, 2020.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of January 16, 2020.

ADDRESSES: For the material incorporated by reference (IBR) in this AD, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; phone: +49 221 89990 1000; email: ADs@easa.europa.eu; internet: www.easa.europa.eu. You may find this IBR material on the EASA website at <https://ad.easa.europa.eu>. You may view this IBR material at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0443.

Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0443; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the regulatory evaluation, any comments received, and other information. The address for Docket