

approved as an AMOC for the corresponding provisions of this AD.

(2) *Contacting the Manufacturer:* As of the effective date of this AD, for any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Section, Transport Standards Branch, FAA; or ANAC; or ANAC's authorized Designee. If approved by the ANAC Designee, the approval must include the Designee's authorized signature.

(l) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Brazilian AD 2019-05-01, effective May 2, 2019; corrected July 1, 2019; for related information. This MCAI may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0499.

(2) For more information about this AD, contact Krista Greer, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3221; email krista.greer@faa.gov.

(m) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(3) The following service information was approved for IBR on February 10, 2020.

(i) Appendix A—Airworthiness Limitations of EMBRAER 170/175 Maintenance Review Board Report (MRBR), MRB-1621, Revision 14, dated September 27, 2018.

(ii) Embraer Temporary Revision (TR) 14-1, dated November 13, 2018, to Part 4—Life Limited Items, of Appendix A of EMBRAER 170/175 Maintenance Review Board Report (MRBR), MRB-1621, Revision 14, dated September 27, 2018.

(4) The following service information was approved for IBR on May 11, 2017 (82 FR 16725, April 6, 2017).

(i) Appendix A—Airworthiness Limitations, of the EMBRAER 170/175 Maintenance Review Board Report (MRBR), MRB-1621, Revision 10, dated February 23, 2015.

(ii) [Reserved]

(5) For service information identified in this AD, contact Embraer S.A., Technical Publications Section (PC 060), Av. Brigadeiro Faria Lima, 2170-Putim-12227-901 São Jose dos Campos-SP-Brazil; telephone +55 12 3927-5852 or +55 12 3309-0732; fax +55 12 3927-7546; email distrib@embraer.com.br; internet <https://www.flyembraer.com>.

(6) You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(7) You may view this service information that is incorporated by reference at the National Archives and Records

Administration (NARA). For information on the availability of this material at NARA, email fedreg.legal@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Des Moines, Washington, on December 12, 2019.

Jeffrey E. Duven,

Director, System Oversight Division, Aircraft Certification Service.

[FR Doc. 2019-28466 Filed 1-3-20; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2019-0993; Product Identifier 2019-NM-198-AD; Amendment 39-21017; AD 2019-25-18]

RIN 2120-AA64

Airworthiness Directives; Bombardier, Inc., Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule; request for comments.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for all Bombardier, Inc., Model CL-600-2B19 (Regional Jet Series 100 & 440) airplanes. This AD was prompted by a report of a wing stall (wing drop/uncommanded roll) during landing flare, due to ice on the wing leading edges that was not detected by the anti-ice system. This AD requires revising the existing airplane flight manual (AFM) to include a limitation and normal operating procedure for the wing anti-ice system. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD becomes effective January 21, 2020.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of January 21, 2020.

The FAA must receive comments on this AD by February 20, 2020.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this final rule, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; Widebody Customer Response Center North America toll-free telephone 1-866-538-1247 or direct-dial telephone 1-514-855-2999; email ac.yul@aero.bombardier.com; internet <https://www.bombardier.com>. You may view this referenced service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0993.

Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0993; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office is listed above. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT: Siddeeq Bacchus, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7362; fax 516-794-5531; email 9-avs-nyaco-cos@faa.gov.

SUPPLEMENTARY INFORMATION:

Discussion

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued Canadian AD CF-2019-41, dated November 7, 2019, (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for all Bombardier, Inc., Model CL-600-2B19 (Regional Jet Series 100 & 440) airplanes. You may examine the MCAI on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0993.

This AD was prompted by a report of a wing stall (wing drop/uncommanded

roll) during landing flare, due to ice on the wing leading edges that was not detected by the anti-ice system. The FAA is issuing this AD to address ice on the wing leading edges, which could adversely affect the stall speeds, stall characteristics, and the protection provided by the stall protection system, which could result in loss of control of the airplane during takeoff or landing. See the MCAI for additional background information.

Related Service Information Under 1 CFR Part 51

Bombardier has issued the following operational limitation and procedure in the existing Bombardier CRJ Series Regional Jet Model CL-600-2B19 Airplane Flight Manual, CSP A-012, Volume 1, Revision 72, dated July 12, 2019. This service information describes a limitation and normal operating procedure for the wing anti-ice system.

- Paragraph 3.—“Operation in Icing Conditions,” of Section 02-04, “Operating Limitations,” of Chapter 2, LIMITATIONS.”
- Paragraph 5.—“Prior to Landing” of Section 04-02, “Consolidated Procedures” of Chapter 4 “NORMAL PROCEDURES.”

This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

FAA’s Determination

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of

Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. The FAA is issuing this AD because we evaluated all pertinent information and determined the unsafe condition exists and is likely to exist or develop on other products of the same type design.

Requirements of This AD

This AD requires revising the existing AFM to incorporate a limitation and normal operating procedure for the wing anti-ice system.

FAA’s Justification and Determination of the Effective Date

An unsafe condition exists that requires the immediate adoption of this AD without providing an opportunity for public comments prior to adoption. The FAA has found that the risk to the flying public justifies waiving notice and comment prior to adoption of this rule because ice on the wing leading edges could adversely affect the stall speeds, stall characteristics, and the protection provided by the stall protection system, which could result in loss of control of the airplane during takeoff or landing. Therefore, the FAA finds good cause that notice and opportunity for prior public comment are impracticable. In addition, for the reasons stated above, the FAA finds that good cause exists for making this amendment effective in less than 30 days.

Comments Invited

This AD is a final rule that involves requirements affecting flight safety, and

the FAA did not precede it by notice and opportunity for public comment. The FAA invites you to send any written relevant data, views, or arguments about this AD. Send your comments to an address listed under the ADDRESSES section. Include “Docket No. FAA-2019-0993; Product Identifier 2019-NM-198-AD” at the beginning of your comments. The FAA specifically invites comments on the overall regulatory, economic, environmental, and energy aspects of this AD. The FAA will consider all comments received by the closing date and may amend this AD based on those comments.

The FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The FAA will also post a report summarizing each substantive verbal contact received about this AD.

Regulatory Flexibility Act

The requirements of the Regulatory Flexibility Act (RFA) do not apply when an agency finds good cause pursuant to 5 U.S.C. 553 to adopt a rule without prior notice and comment. Because the FAA has determined that it has good cause to adopt this rule without notice and comment, RFA analysis is not required.

Costs of Compliance

The FAA estimates that this AD affects 503 airplanes of U.S. registry. The FAA estimates the following costs to comply with this AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

| Labor cost | Parts cost | Cost per product | Cost on U.S. operators |
|--|------------|------------------|------------------------|
| 1 work-hour × \$85 per hour = \$85 | \$0 | \$85 | \$42,755 |

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing

regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition

period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes and associated appliances to the Director of the System Oversight Division.

Regulatory Findings

The FAA has determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of

power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866, and
- (2) Will not affect intrastate aviation in Alaska.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

2019–25–18 Bombardier, Inc.: Amendment 39–21017; Docket No. FAA–2019–0993; Product Identifier 2019–NM–198–AD.

(a) Effective Date

This AD becomes effective January 21, 2020.

(b) Affected ADs

None.

(c) Applicability

This AD applies to all Bombardier, Inc., Model CL–600–2B19 (Regional Jet Series 100 & 440) airplanes, certificated in any category.

(d) Subject

Air Transport Association (ATA) of America Code 30, Ice and Rain Protection.

(e) Reason

This AD was prompted by a report of a wing stall (wing drop/uncommanded roll) during landing flare, due to ice on the wing leading edges that was not detected by the anti-ice system. The FAA is issuing this AD to address undetected ice on the wing leading edges, which could adversely affect the stall speeds, stall characteristics, and the protection provided by the stall protection system, which could result in loss of control of the airplane during takeoff or landing.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Revision of the Airplane Flight Manual (AFM)

Within 30 days after the effective date of this AD: Revise the existing AFM to

incorporate the information specified in paragraphs (g)(1) and (2) of this AD.

(1) Paragraph 3.—“Operation in Icing Conditions” of Section 02–04, “Operating Limitations,” of Chapter 2, LIMITATIONS,” of the Bombardier CRJ Series Regional Jet Model CL–600–2B19 Airplane Flight Manual, CSP A–012, Volume 1, Revision 72, dated July 12, 2019.

(2) Paragraph 5.—“Prior to Landing” of Section 04–02, “Consolidated Procedures” of Chapter 4 “NORMAL PROCEDURES,” of the Bombardier CRJ Series Regional Jet Model CL–600–2B19 Airplane Flight Manual, CSP A–012, Volume 1, Revision 72, dated July 12, 2019.

(h) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7300; fax 516–794–5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.’s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

(i) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian AD CF–2019–41, dated November 7, 2019, for related information. This MCAI may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2019–0993.

(2) For more information about this AD, contact Siddeeq Bacchus, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7362; fax 516–794–5531; email 9-avs-nyaco-cos@faa.gov.

(j) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Bombardier CRJ Series Regional Jet Model CL–600–2B19 Airplane Flight Manual, CSP A–012, Volume 1, Revision 72, dated July 12, 2019.

(A) Paragraph 3.—“Operation in Icing Conditions” of Section 02–04, “Operating Limitations,” of Chapter 2, LIMITATIONS.”

(B) Paragraph 5.—“Prior to Landing” of Section 04–02, “Consolidated Procedures” of Chapter 4 “NORMAL PROCEDURES.”

(ii) [Reserved]

(3) For service information identified in this AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; Widebody Customer Response Center North America toll-free telephone 1–866–538–1247 or direct-dial telephone 1–514–855–2999; email ac.yul@aero.bombardier.com; internet <https://www.bombardier.com>.

(4) You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fedreg.legal@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on December 20, 2019.

Michael Kaszycki,

Acting Director, System Oversight Division, Aircraft Certification Service.

[FR Doc. 2019–28365 Filed 1–3–20; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF COMMERCE

Bureau of Industry and Security

15 CFR Part 774

[Docket No. 191217–0116]

RIN 0694–AH89

Addition of Software Specially Designed To Automate the Analysis of Geospatial Imagery to the Export Control Classification Number 0Y521 Series

AGENCY: Bureau of Industry and Security, Commerce.

ACTION: Interim final rule with request for comments.

SUMMARY: In this interim final rule, the Bureau of Industry and Security (BIS) amends the Export Administration Regulations (EAR) to make certain items subject to the EAR and to impose a license requirement for the export and reexport of those items to all destinations, except Canada. Specifically, this rule classifies software specially designed to automate the analysis of geospatial imagery, as