

(2) Where Boeing Alert Service Bulletin 757–53A0108, Revision 1, dated July 17, 2019, uses the phrase “the original issue date of this service bulletin,” this AD requires using “May 3, 2018 (the effective date of AD 2018–06–07),” except where Alert Service Bulletin 757–53A0108, Revision 1, dated July 17, 2019, uses the phrase “the original issue date of this service bulletin” in a note or flag note.

(3) Where Boeing Alert Service Bulletin 757–53A0108, Revision 1, dated July 17, 2019, uses the phrase “the revision 1 date of this service bulletin,” this AD requires using “the effective date of this AD.”

(4) Where Aviation Partners Boeing (APB) Alert Service Bulletin AP757–53–001, Revision 2, dated October 22, 2019, specifies contacting Boeing for repair instructions or for alternative inspections: This AD requires doing the repair, or doing the alternative inspections and applicable on-condition actions using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

(5) Where Aviation Partners Boeing (APB) Alert Service Bulletin AP757–53–001, Revision 2, dated October 22, 2019, uses the phrase “the revision 1 issue date of this service bulletin,” this AD requires using “May 3, 2018 (the effective date of AD 2018–06–07),” except where Aviation Partners Boeing (APB) Alert Service Bulletin AP757–53–001, Revision 2, dated October 22, 2019, uses the phrase “the revision 1 issue date of this service bulletin” in a note or flag note.

(6) Where Aviation Partners Boeing (APB) Alert Service Bulletin AP757–53–001, Revision 2, dated October 22, 2019, uses the phrase “the revision 2 issue date of this service bulletin,” this AD requires using “the effective date of this AD.”

(i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Los Angeles ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j)(1) of this AD. Information may be emailed to: 9-ANM-LAACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, Los Angeles ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) AMOCs approved previously for AD 2018–06–07 are not approved as AMOCs for the corresponding provisions of this AD.

(5) Except as specified by paragraph (h) of this AD: For service information that contains steps that are labeled as Required for Compliance (RC), the provisions of paragraphs (i)(5)(i) and (ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. If a step or substep is labeled “RC Exempt,” then the RC requirement is removed from that step or substep. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

(j) Related Information

(1) For more information about this AD, contact Peter Jarzomb, Aerospace Engineer, Airframe Section, FAA, Los Angeles ACO Branch, 3960 Paramount Boulevard, Lakewood, CA 90712–4137; phone: 562–627–5234; fax: 562–627–5210; email: peter.jarzomb@faa.gov.

(2) For Aviation Partners Boeing service information identified in this AD, contact Aviation Partners Boeing, 2811 S 102nd Street, Suite 200, Seattle, WA 98168; phone: 206–830–7699; internet: <https://www.aviationpartnersboeing.com>.

(3) For Boeing service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; phone: 562–797–1717; internet: <https://www.myboeingfleet.com>.

(4) You may view this referenced service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

Issued on February 11, 2020.

Gaetano A. Sciortino,

Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020–03084 Filed 2–14–20; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2020–0097; Product Identifier 2019–NM–208–AD]

RIN 2120–AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for all The Boeing Company Model 737–300, –400, and –500 series airplanes. This proposed AD was prompted by a report that a crack indication consistent with fatigue cracking was found on the left nacelle support overwing fitting flange fastener hole during teardown of a Model 737–300 series airplane. This proposed AD would require a general visual inspection of the strut to wing diagonal brace at a certain location for cracking. For certain airplanes, this proposed AD would also require an ultrasonic inspection of certain fasteners of the nacelle support overwing fitting at a certain location for cracking. For certain other airplanes, this proposed AD would also require a magnetic check of the nacelle support overwing fitting at a certain location to determine the material composition. This proposed AD would also require applicable on-condition actions. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by April 3, 2020.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202–493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. It is also available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2020–0097.

Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2020–0097; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for Docket Operations is listed above. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT:

Wayne Ha, Aerospace Engineer, Airframe Section, FAA, Los Angeles ACO Branch, 3960 Paramount Boulevard, Lakewood, CA 90712–4137; phone: 562–627–5238; fax: 562–627–5210; email: wayne.ha@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA–2020–0097; Product Identifier 2019–NM–208–AD” at the beginning of your comments. The FAA specifically invites comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. The FAA will consider all comments received by the closing date and may amend this NPRM because of those comments.

The FAA will post all comments, without change, to <https://www.regulations.gov>, including any personal information you provide. The FAA will also post a report summarizing each substantive verbal contact the agency receives about this proposed AD.

Discussion

The FAA has received a report indicating that a crack indication consistent with fatigue cracking was found on the left nacelle support

overwing fitting flange fastener hole during teardown of a Model 737–300 series airplane. Further analysis determined the root cause of the crack is stress at the first two forward fasteners of the nacelle support overwing fitting being higher than anticipated. Existing maintenance planning document (MPD) inspections do not provide opportunities to detect a failed nacelle support overwing fitting at wing buttock line (WBL) 191. The crack finding occurred at 67,695 total flight cycles and 80,269 total flight hours. This condition, if not addressed, could result in an undetected crack in the nacelle support overwing fittings or strut to wing diagonal brace, which could result in the inability of the structure to carry limit load and could adversely affect the structural integrity of the airplane.

Related Service Information Under 1 CFR Part 51

The FAA reviewed Boeing Alert Requirements Bulletin 737–57A1345 RB, dated December 17, 2019. This service information describes procedures for a magnetic check to determine material composition of the nacelle support overwing fitting at WBL 191; ultrasonic inspections of the nacelle support overwing fitting at WBL 191 for cracking; general visual inspections of the strut to wing diagonal brace at nacelle station (STA) 278 for cracking; and applicable on-condition actions. On-condition actions include repetitive ultrasonic inspections of the nacelle support overwing fitting at WBL 191 for cracking, repetitive general visual inspections of the strut to wing diagonal brace at nacelle STA 278 for cracking, and repair. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

FAA’s Determination

The FAA is proposing this AD because the FAA evaluated all the

relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

Proposed AD Requirements

This proposed AD would require accomplishment of the actions identified in Boeing Alert Requirements Bulletin 737–57A1345 RB, dated December 17, 2019, described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD.

For information on the procedures and compliance times, see this service information at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2020–0097.

Explanation of Requirements Bulletin

The FAA worked in conjunction with industry, under the Airworthiness Directive Implementation Aviation Rulemaking Committee (AD ARC), to enhance the AD system. One enhancement is a process for annotating which steps in the service information are “required for compliance” (RC) with an AD. Boeing has implemented this RC concept into Boeing service bulletins.

In an effort to further improve the quality of ADs and AD-related Boeing service information, a joint process improvement initiative was worked between the FAA and Boeing. The initiative resulted in the development of a new process in which the service information more clearly identifies the actions needed to address the unsafe condition in the “Accomplishment Instructions.” The new process results in a Boeing Requirements Bulletin, which contains only the actions needed to address the unsafe condition (*i.e.*, only the RC actions).

Costs of Compliance

The FAA estimates that this proposed AD affects 158 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Magnetic Check	1 work-hour × \$85 per hour = \$85	\$0	\$85	\$13,430
Ultrasonic Inspection	5 work-hours × \$85 per hour = \$425	0	425	67,150
General Visual Inspection	1 work-hour × \$85 per hour = \$85	0	85	13,430

The FAA estimates the following costs to do any necessary on-condition

inspections that would be required. The FAA has no way of determining the

number of aircraft that might need these on-condition inspections:

ESTIMATED COSTS OF ON-CONDITION INSPECTIONS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Ultrasonic Inspections	5 work-hours × \$85 per hour = \$425 per inspection cycle.	\$0	\$425 per inspection cycle	\$67,150 per inspection cycle.
General Visual Inspections	1 work-hour × \$85 per hour = \$85 per inspection cycle.	0	\$85 per inspection cycle	\$13,430 per inspection cycle.

The FAA has received no definitive data that would enable us to provide cost estimates for the on-condition repairs specified in this proposed AD.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

The Boeing Company: Docket No. FAA–2020–0097; Product Identifier 2019–NM–208–AD.

(a) Comments Due Date

The FAA must receive comments by April 3, 2020.

(b) Affected ADs

None.

(c) Applicability

This AD applies to all The Boeing Company Model 737–300, –400, and –500 series airplanes, certificated in any category.

(d) Subject

Air Transport Association (ATA) of America Code 57, Wings.

(e) Unsafe Condition

This AD was prompted by a report that a crack indication consistent with fatigue cracking was found on the left nacelle support overwing fitting flange fastener hole during teardown of a Model 737–300 series airplane. The FAA is issuing this AD to address the potential for undetected cracks in the nacelle support overwing fittings or strut to wing diagonal brace, which could result in the inability of the structure to carry limit load and could adversely affect the structural integrity of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

Except as specified by paragraph (h) of this AD: At the applicable times specified in the "Compliance" paragraph of Boeing Alert Requirements Bulletin 737–57A1345 RB, dated December 17, 2019, do all applicable actions identified in, and in accordance with, the Accomplishment Instructions of Boeing

Alert Requirements Bulletin 737–57A1345 RB, dated December 17, 2019. Actions identified as terminating actions in Boeing Alert Requirements Bulletin 737–57A1345 RB, dated December 17, 2019, terminate the applicable required actions of this AD, provided the terminating action is done in accordance with the Accomplishment Instructions of Boeing Alert Requirements Bulletin 737–57A1345 RB, dated December 17, 2019.

Note 1 to paragraph (g): Guidance for accomplishing the actions required by this AD can be found in Boeing Alert Service Bulletin 737–57A1345, dated December 17, 2019, which is referred to in Boeing Alert Requirements Bulletin 737–57A1345 RB, dated December 17, 2019.

(h) Exceptions to Service Information Specifications

(1) Where Boeing Alert Requirements Bulletin 737–57A1345 RB, dated December 17, 2019, uses the phrase "the original issue date of Requirements Bulletin (RB) 737–57A1345 RB," this AD requires using "the effective date of this AD."

(2) Where Boeing Alert Requirements Bulletin 737–57A1345 RB, dated December 17, 2019, specifies contacting Boeing for repair instructions: This AD requires doing the repair before further flight using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

(i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Los Angeles ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j)(1) of this AD. Information may be emailed to: 9-ANM-LAACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, Los Angeles ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the

certification basis of the airplane, and the approval must specifically refer to this AD.

(j) Related Information

(1) For more information about this AD, contact Wayne Ha, Aerospace Engineer, Airframe Section, FAA, Los Angeles ACO Branch, 3960 Paramount Boulevard, Lakewood, CA 90712-4137; phone: 562-627-5238; fax: 562-627-5210; email: wayne.ha@faa.gov.

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued on February 11, 2020.

Gaetano A. Sciortino,

*Deputy Director for Strategic Initiatives,
Compliance & Airworthiness Division,
Aircraft Certification Service.*

[FR Doc. 2020-03083 Filed 2-14-20; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 71

[Docket No. FAA-2019-1022; Airspace
Docket No. 19-ANM-81]

RIN 2120-AA66

Proposed Amendment of Class E Airspace and Establishment of Class E Airspace Extension; Port Angeles, WA

AGENCY: Federal Aviation
Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking
(NPRM).

SUMMARY: This action proposes to modify the Class E surface area, Class E airspace extending upward from 700 feet above the surface and create Class E airspace as an extension to the Class E surface area at William R Fairchild International Airport, Port Angeles, WA. Following a review of the airspace, the FAA found it necessary to modify the existing airspace for William R Fairchild Airport for the safety and management of Instrument Flight Rules (IFR) operations at the Airport.

DATES: Comments must be received on or before April 3, 2020.

ADDRESSES: Send comments on this proposal to the U.S. Department of Transportation, Docket Operations, 1200 New Jersey Avenue SE, West Building Ground Floor, Room W12-140,

Washington, DC 20590; telephone: (800) 647-5527, or (202) 366-9826. You must identify FAA Docket No. FAA-2019-1022; Airspace Docket No. 19-ANM-81, at the beginning of your comments. You may also submit comments through the internet at <https://www.regulations.gov>.

FAA Order 7400.11D, Airspace Designations and Reporting Points, and subsequent amendments can be viewed online at <https://www.faa.gov/air-traffic/publications/>. For further information, you can contact the Airspace Policy Group, Federal Aviation Administration, 800 Independence Avenue SW, Washington, DC 20591; telephone: (202) 267-8783. The Order is also available for inspection at the National Archives and Records Administration (NARA). For information on the availability of FAA Order 7400.11D at NARA, email fedreg.legal@nara.gov or go to https://www.archives.gov/federal-register/cfr/ibr_locations.html.

FOR FURTHER INFORMATION CONTACT:

Richard Roberts, Federal Aviation Administration, Operations Support Group, Western Service Center, 2200 S 216th Street, Des Moines, WA 98198-6547; telephone (206) 231-2245.

SUPPLEMENTARY INFORMATION:

Authority for This Rulemaking

The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority. This rulemaking is promulgated under the authority described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it would modify the existing Class E airspace and establish new Class E airspace as an extension to the Class E surface area at William R Fairchild International Airport, Port Angeles, WA, in support of IFR operations at the airport.

Comments Invited

Interested parties are invited to participate in this proposed rulemaking by submitting such written data, views, or arguments, as they may desire. Comments that provide the factual basis supporting the views and suggestions presented are particularly helpful in developing reasoned regulatory decisions on the proposal. Comments

are specifically invited on the overall regulatory, aeronautical, economic, environmental, and energy-related aspects of the proposal.

Communications should identify both docket numbers (Docket No. FAA-2019-1022; Airspace Docket No. 19-ANM-81) and be submitted in triplicate to DOT Docket Operations (see **ADDRESSES** section for address and phone number). You may also submit comments through the internet at <https://www.regulations.gov>.

Persons wishing the FAA to acknowledge receipt of their comments on this notice must submit with those comments a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket No. FAA-2019-1022; Airspace Docket No. 19-ANM-81." The postcard will be date/time stamped and returned to the commenter.

All communications received on or before the specified closing date for comments will be considered before taking action on the proposed rule. The proposal contained in this notice may be changed in light of the comments received. A report summarizing each substantive public contact with FAA personnel concerned with this rulemaking will be filed in the docket.

Availability of NPRMs

An electronic copy of this document may be downloaded through the internet at <https://www.regulations.gov>. Recently published rulemaking documents can also be accessed through the FAA's web page at https://www.faa.gov/air-traffic/publications/airspace_amendments/.

You may review the public docket containing the proposal, any comments received, and any final disposition in person in the Dockets Office (see the **ADDRESSES** section for the address and phone number) between 9:00 a.m. and 5:00 p.m., Monday through Friday, except federal holidays. An informal docket may also be examined between 8:00 a.m. and 4:30 p.m., Monday through Friday, except federal holidays, at the Northwest Mountain Regional Office of the Federal Aviation Administration, Air Traffic Organization, Western Service Center, Operations Support Group, 2200 S 216th St., Des Moines, WA 98198-6547.

Availability and Summary of Documents for Incorporation by Reference

This document proposes to amend FAA Order 7400.11D, Airspace Designations and Reporting Points, dated August 8, 2019, and effective September 15, 2019. FAA Order