

(h) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Safety Management Section, Rotorcraft Standards Branch, FAA, may approve AMOCs for this AD. Send your proposal to: Matt Fuller, Senior Aviation Safety Engineer, Safety Management Section, Rotorcraft Standards Branch, FAA, 10101 Hillwood Pkwy., Fort Worth, TX 76177; telephone (817) 222-5161; email 9-ASW-FTW-AMOC-Requests@faa.gov.

(2) For operations conducted under a 14 CFR part 119 operating certificate or under 14 CFR part 91, subpart K, notify your principal inspector or lacking a principal inspector, the manager of the local flight standards district office or certificate holding district office, before operating any aircraft complying with this AD through an AMOC.

(i) Related Information

(1) The subject of this AD is addressed in European Union Aviation Safety Agency (previously European Aviation Safety Agency) (EASA) Emergency AD 2016-0173-E, dated August 24, 2016. This EASA AD may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket FAA-2020-0204.

(2) For service information identified in this AD, contact Leonardo S.p.A. Helicopters, Emanuele Bufano, Head of Airworthiness, Viale G. Agusta 520, 21017 C. Costa di Samarate (Va) Italy; telephone +39-0331-225074; fax +39-0331-229046; or at <https://www.leonardocompany.com/en/home>. You may view this service information at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy, Room 6N-321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222-5110.

Issued on March 16, 2020.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-05851 Filed 3-20-20; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2020-0203; Product Identifier 2019-NM-142-AD]

RIN 2120-AA64

Airworthiness Directives; Bombardier, Inc., Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain Bombardier, Inc., Model CL-600-1A11 (600), CL-600-2A12 (601),

and CL-600-2B16 (601-3A, 601-3R, and 604 Variants) airplanes. This proposed AD was prompted by a report that fast and easy access to the portable oxygen bottle may be prevented by the portable oxygen bottle installation's upper bracket latch assembly catching on the pressure gauge tube or on the pressure gauge bezel of the portable oxygen bottle. This proposed AD would require a check to identify the manufacturer and part number of the portable oxygen bottle installation, and, if necessary, modification of the portable oxygen bottle installation. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by May 7, 2020.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Bombardier, Inc., 200 Côte-Vertu Road West, Dorval, Québec H4S 2A3, Canada; North America toll-free telephone 1-866-538-1247 or direct-dial telephone 1-514-855-2999; email ac.yul@aero.bombardier.com; internet <https://www.bombardier.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0203; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for Docket Operations is listed above. Comments will be available in the AD docket shortly after receipt.

Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0203; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for Docket Operations is listed above. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT: Darren Gassetto, Aerospace Engineer,

Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7323; fax 516-794-5531; email 9-avs-nyaco-cos@faa.gov.

SUPPLEMENTARY INFORMATION:**Comments Invited**

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2020-0203; Product Identifier 2019-NM-142-AD" at the beginning of your comments. The FAA specifically invites comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. The FAA will consider all comments received by the closing date and may amend this NPRM because of those comments.

The FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The FAA will also post a report summarizing each substantive verbal contact received about this NPRM.

Discussion

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued Canadian AD CF-2019-26, dated July 9, 2019 (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for certain Bombardier, Inc., Model CL-600-1A11 (600), CL-600-2A12 (601), and CL-600-2B16 (601-3A, 601-3R, and 604 Variants) airplanes.

This proposed AD was prompted by a report that fast and easy access to the portable oxygen bottle may be prevented by the portable oxygen bottle installation's upper bracket latch assembly catching on the pressure gauge tube or on the pressure gauge bezel of the portable oxygen bottle. The FAA is proposing this AD to address this condition, which, if not detected and corrected, could prevent fast and easy access to the portable oxygen bottle in an emergency situation. See the MCAI for additional background information.

Related Service Information Under 14 CFR Part 51

Bombardier has issued the following service information:

- Bombardier Service Bulletin 600-0772, dated June 29, 2018;
- Bombardier Service Bulletin 601-0646, dated June 29, 2018;
- Bombardier Service Bulletin 604-35-006, dated June 29, 2018;

- Bombardier Service Bulletin 605–35–005, dated June 29, 2018;
- Bombardier Service Bulletin 650–35–001, dated June 29, 2018.

This service information describes procedures for a check to identify the manufacturer and part number of the portable oxygen bottle installation, and, if necessary, modification of the portable oxygen bottle installation. These documents are distinct since they apply to different airplane models. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

FAA’s Determination

This product has been approved by the aviation authority of another

country, and is approved for operation in the United States. Pursuant to a bilateral agreement with the State of Design Authority, the FAA has been notified of the unsafe condition described in the MCAI and service information referenced above. The FAA is proposing this AD because the agency evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop on other products of the same type design.

Proposed Requirements of This NPRM

This proposed AD would require accomplishing the actions specified in the service information described previously, except as discussed under “Differences Between this Proposed AD and the MCAI or Service Information.”

Differences Between This Proposed AD and the MCAI or Service Information

The MCAI specifies that airplanes having serial numbers not listed in the applicable service information must do certain actions in accordance with the applicable service information. This proposed AD would require airplanes having serial numbers not listed in the applicable service information to do those actions in accordance with the procedures specified in paragraph (j)(2) of this proposed AD.

Costs of Compliance

The FAA estimates that this proposed AD affects 188 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
3 work-hours × \$85 per hour = \$255 per installation..	\$1,530 per installation	\$1,785 per installation	\$335,580 per installation

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

Bombardier, Inc.: Docket No. FAA–2020–0203; Product Identifier 2019–NM–142–AD.

(a) Comments Due Date

We must receive comments by May 7, 2020.

(b) Affected ADs

None.

(c) Applicability

This AD applies to the Bombardier, Inc., airplanes identified in paragraphs (c)(1) through (3), certificated in any category, equipped with Scott (Avox/Zodiac) 5500 or 5600 series 11 cubic foot portable oxygen bottle(s) with upper bracket part number (P/N) 36758–02, P/N 36758–12 or P/N H3–2091–1 installed at the neck of the bottle(s).

(1) Model CL–600–1A11 (600) airplanes, serial numbers 1004 through 1085 inclusive.

(2) Model CL–600–2A12 (601) airplanes, serial numbers 3001 through 3066 inclusive.

(3) Model CL–600–2B16 (601–3A, 601–3R, and 604 Variants) airplanes, serial numbers 5001 through 5194 inclusive, 5301 through 5665 inclusive, 5701 through 5988 inclusive, and 6050 through 6119 inclusive.

(d) Subject

Air Transport Association (ATA) of America Code 35, Oxygen.

(e) Reason

This AD was prompted by a report that fast and easy access to the portable oxygen bottle may be prevented by the portable oxygen bottle installation’s upper bracket latch assembly catching on the pressure gauge tube or on the pressure gauge bezel of the portable oxygen bottle. The FAA is proposing this AD to address this condition, which, if not detected and corrected, could prevent fast and easy access to the portable oxygen bottle in an emergency situation.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Portable Oxygen Bottle Check

For airplanes with a serial number listed in Section 1.A of the applicable Bombardier service information specified in figure 1 to

paragraphs (g), (h), and (i) of this AD: Within 60 months after the effective date of this AD, check each portable oxygen bottle installation to determine the manufacturer and P/N, in accordance with paragraph 2.B.

of the Accomplishment Instructions of the applicable Bombardier service information specified in figure 1 to paragraphs (g), (h), and (i) of this AD.

Figure 1 to paragraphs (g), (h), and (i) – Service Information References

Airplane Model	Bombardier Service Information
Model CL-600-1A11	Bombardier Service Bulletin 600-0772, dated June 29, 2018
Model CL-600-2A12	Bombardier Service Bulletin 601-0646, dated June 29, 2018
Model CL-600-2B16	Bombardier Service Bulletin 601-0646, dated June 29, 2018
Model CL-600-2B16	Bombardier Service Bulletin 604-35-006, dated June 29, 2018
Model CL-600-2B16	Bombardier Service Bulletin 605-35-005, dated June 29, 2018
Model CL-600-2B16	Bombardier Service Bulletin 650-35-001, dated June 29, 2018

(h) Bracket Modifications

If, during the inspection specified in paragraph (g) of this AD, any portable oxygen bottle is found to be manufactured by Scott (Avox/Zodiac) and is a 5500 or 5600 series 11 cubic foot bottle, with upper bracket P/N 36758-02, 36758-12, or H3-2091-1 installed at the neck of the bottle: Modify the portable oxygen bottle brackets in accordance with the paragraph 2.C. of the Accomplishment Instructions of the applicable Bombardier service information specified in figure 1 to paragraphs (g), (h), and (i) of this AD.

(i) Portable Oxygen Bottle Check and Corrective Actions for Airplanes Not Listed in the Service Information

For airplanes with a serial number that is not listed in section 1.A of the applicable Bombardier service information specified in figure 1 to paragraphs (g), (h), and (i) of this AD: Within 60 months after the effective date of this AD, check each portable oxygen bottle installation to determine the manufacturer and part number and accomplish corrective actions in accordance with the procedures specified in paragraph (j)(2) of this AD.

(j) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York ACO Branch, FAA, has the authority to approve

AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier's TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

(k) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian AD CF-2019-26, dated July 9, 2019, for related information. This MCAI may be found in the AD docket on the internet at

<https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0203.

(2) For more information about this AD, contact Darren Gassetto, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7323; fax 516-794-5531; email 9-avs-nyacos@faa.gov.

(3) For service information identified in this AD, contact Bombardier, Inc., 200 Côte-Vertu Road West, Dorval, Québec H4S 2A3, Canada; North America toll-free telephone 1-866-538-1247 or direct-dial telephone 1-514-855-2999; email ac.yul@aero.bombardier.com; internet <https://www.bombardier.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued on March 13, 2020.

Gaetano A. Sciortino,

Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-05771 Filed 3-20-20; 8:45 am]

BILLING CODE 4910-13-P