

determining an optimum supply volume, the Board may recommend a desirable carry-out inventory not to exceed 100 million pounds.

■ 3. Revise § 930.256 to read as follows:

§ 930.256 Free and restricted percentages for the 2019–20 crop year.

The percentages for tart cherries handled by handlers during the crop year beginning on July 1, 2019, which shall be free and restricted, respectively, are designated as follows: Free percentage, 67 percent and restricted percentage, 33 percent.

Bruce Summers,

Administrator, Agricultural Marketing Service.

[FR Doc. 2020–13125 Filed 7–7–20; 8:45 am]

BILLING CODE P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2020–0638; Project Identifier MCAI–2020–00308–E; Amendment 39–21158; AD 2020–14–04]

RIN 2120–AA64

Airworthiness Directives; Rolls-Royce Deutschland Ltd & Co KG (Type Certificate Previously Held by Rolls-Royce plc) Turbofan Engines

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule; request for comments.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for all Rolls-Royce Deutschland Ltd. & Co KG (RRD) Trent 1000–A, Trent 1000–AE, Trent 1000–C, Trent 1000–CE, Trent 1000–D, Trent 1000–E, Trent 1000–G, and Trent 1000–H model turbofan engines. This AD requires removing and replacing one or both affected engines, depending on whether the engine pairing combinations are compliant or non-compliant, as described in the service information. This AD was prompted by occurrences of in-service engine surges on affected RRD Trent model turbofan engines with a high number of intermediate pressure compressor (IPC) module flight hours since new (HSN) or cycles since new (CSN). The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective July 23, 2020.

The Director of the Federal Register approved the incorporation by reference

of a certain publication listed in this AD as of July 23, 2020.

The FAA must receive comments on this AD by August 24, 2020.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202–493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this final rule, contact Rolls-Royce Deutschland Ltd & Co KG, Eschenweg 11, 15827 Blankenfelde-Mahlow, Germany; phone: +49 (0) 33 708 6 0; email: <https://www.rolls-royce.com/contact-us.aspx>. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 1200 District Avenue, Burlington, MA 01803. For information on the availability of this material at the FAA, call 781–238–7759. It is also available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2020–0638.

Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2020–0638; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT: Stephen Elwin, Aerospace Engineer, ECO Branch, FAA, 1200 District Avenue, Burlington, MA 01803; phone: 781–238–7236; fax: 781–238–7199; email: stephen.l.elwin@faa.gov.

SUPPLEMENTARY INFORMATION:

Discussion

The European Union Aviation Safety Agency (EASA), which is the Technical

Agent for the Member States of the European Community, has issued EASA AD 2020–0010R2, dated March 4, 2020 (referred to after this as “the MCAI”), to address an unsafe condition for the specified products. The MCAI states:

Occurrences have been reported of engine surges on certain Trent 1000 engines, particularly those that have accumulated a high number of flight hours (FH) and engine flight cycles (EFC). The investigation into the cause(s) of these events is on-going. This condition, if not corrected, could lead to a dual engine surge, possibly resulting in a dual engine in-flight shut-down and consequent reduced control of the aeroplane.

To address this potential unsafe condition, Rolls-Royce published the NMSB to provide de-pairing instructions, reducing the risk of a dual surge event. Instructions for in-shop performance recovery are being developed. Prompted by some errors detected in Table 1 of the NMSB, Appendix 1 of this [EASA] AD must be used instead. Rolls-Royce will revise the NMSB to correct those errors.

For the reasons described above, EASA issued AD 2020–0010 (later revised) to require de-pairing of the affected engines.

Since EASA AD 2020–0010R1 was issued, Rolls-Royce issued NMSB TRENT 1000 72–K494, providing instructions for in-shop action to restore the surge margin.

Embodiment of Part B of this NMSB allows relaxation of the de-pairing actions as required by this [EASA] AD. Rolls-Royce have revised NMSB TRENT 1000 72–AK468 accordingly, including a new Table 1, defining de-pairing upper and lower thresholds (pre- and post-NMSB 72–K494 embodied) and Table 2 (which was Table 1 in the NMSB 72–AK468 at original issue) for de-pairing when one engine has embodied Part B of NMSB TRENT 1000 72–K494, and when both engines have embodied Part B of NMSB TRENT 1000 72–K494.

Consequently, this [EASA] AD is revised to include references to NMSB TRENT 1000 72–K494 and to NMSB TRENT 1000 72–AK468 Revision 1, and Table 2 thereof.

You may obtain further information by examining the MCAI in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2020–0638.

Related Service Information Under 14 CFR Part 51

The FAA reviewed Rolls-Royce plc (RR) Alert Non-Modification Service Bulletin (NMSB) Trent 1000 72–AK468, Revision 1, dated March 3, 2020. The Alert NMSB describes compliant and non-compliant engine pairing combinations based on IPC module flight HSN or CSN. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

Related Service Information

The FAA reviewed RR NMSB Trent 1000 72–K494, Initial Issue, dated March 3, 2020. The NMSB describes procedures for the inspection, repair, and replacement of specified IPC module components to restore surge margin and recover IPC performance.

FAA’s Determination

This product has been approved by EASA and is approved for operation in the United States. Pursuant to our bilateral agreement with the European Community, EASA has notified us of the unsafe condition described in the MCAI. The FAA is issuing this AD because it evaluated all the relevant information provided by EASA and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

AD Requirements

This AD requires removing and replacing one or both affected engines, depending on whether the engine pairing combinations are compliant or non-compliant, as described in the Accomplishment Instructions of RR Alert NMSB Trent 1000 72–AK468, Revision 1, dated March 3, 2020.

Justification for Immediate Adoption and Determination of the Effective Date

Section 553(b)(3)(B) of the Administrative Procedure Act (APA) (5 U.S.C.) authorizes agencies to dispense with notice and comment procedures for rules when the agency, for “good cause,” finds that those procedures are “impracticable, unnecessary, or contrary to the public interest.” Under this section, an agency, upon finding good cause, may issue a final rule without seeking comment prior to the rulemaking. Similarly, Section 553(d) of the APA authorizes agencies to make

rules effective in less than 30 days, upon a finding of good cause.

The FAA has found the risk to the flying public justifies waiving notice and comment prior to adoption of this rule because no domestic operators use this product. It is unlikely that the FAA will receive any adverse comments or useful information about this AD from U.S. operators. Therefore, the FAA finds good cause that notice and opportunity for prior public comment are unnecessary. In addition, for this same reason, the FAA finds that good cause exists for making this amendment effective in less than 30 days.

Comments Invited

This AD is a final rule that involves requirements affecting flight safety and was not preceded by notice and an opportunity for public comment. However, the FAA invites you to send any written data, views, or arguments about this final rule. Send your comments to an address listed under the **ADDRESSES** section. Include the docket number FAA–2020–0638 and Project Identifier MCAI–2020–00308–E at the beginning of your comments. The FAA specifically invites comments on the overall regulatory, economic, environmental, and energy aspects of this final rule. The FAA will consider all comments received by the closing date and may amend this final rule because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The FAA will also post a report summarizing each substantive verbal contact received about this final rule.

Confidential Business Information

Confidential Business Information (CBI) is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this final rule contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this final rule, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this final rule. Submissions containing CBI should be sent to Stephen Elwin, Aerospace Engineer, ECO Branch, FAA, 1200 District Avenue, Burlington, MA 01803. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Regulatory Flexibility Act

The requirements of the Regulatory Flexibility Act (RFA) do not apply when an agency finds good cause pursuant to 5 U.S.C. 553 to adopt a rule without prior notice and comment. Because the FAA has determined that it has good cause to adopt this rule without notice and comment, RFA analysis is not required.

Costs of Compliance

The FAA estimates that this AD affects 0 engines installed on airplanes of U.S. registry.

The FAA estimates the following costs to comply with this AD:

ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Remove and replace engine	48 work-hours × \$85 per hour = \$4,080	\$0	\$4,080	\$0

According to the manufacturer, some of the costs of this AD may be covered under warranty, thereby reducing the cost impact on affected individuals. The FAA does not control warranty coverage for affected individuals. As a result, the FAA has included all costs in our estimate.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of

that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this AD:

(1) Is not a “significant regulatory action” under Executive Order 12866, and

(2) Will not affect intrastate aviation in Alaska.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

2020–14–04 Rolls-Royce Deutschland Ltd & Co KG (Type Certificate previously held by Rolls-Royce plc): Amendment 39–21158; Docket No. FAA–2020–0638; Project Identifier MCAI–2020–00308–E.

(a) Effective Date

This AD is effective July 23, 2020.

(b) Affected ADs

None.

(c) Applicability

This AD applies to all Rolls-Royce Deutschland Ltd. & Co KG (RRD) (Type Certificate previously held by Rolls-Royce plc) Trent 1000–A, Trent 1000–AE, Trent 1000–C, Trent 1000–CE, Trent 1000–D, Trent 1000–E, Trent 1000–G, and Trent 1000–H model turbofan engines.

(d) Subject

Joint Aircraft System Component (JASC) Code 7230, Turbine Engine Compressor Section.

(e) Unsafe Condition

This AD was prompted by occurrences of in-service engine surges on affected RRD Trent model turbofan engines with a high number of intermediate pressure compressor (IPC) module flight hours since new or cycles since new. Investigation by the manufacturer shows reduced surge margin caused by IPC deterioration has led to in-service engine surges. The FAA is issuing this AD to reduce the risk of a dual-engine surge event. The unsafe condition, if not addressed, could result in failure of one or more engines, loss of thrust control, and loss of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

Within 30 days after the effective date of this AD, remove and replace one or both affected engines identified as “Not Acceptable De-pair required” in paragraph 3, Accomplishment Instructions, Table 2, “Examples of compliant and non-compliant engine pairing combinations,” of Rolls-Royce plc (RR) Alert Non-Modification Service Bulletin (NMSB) Trent 1000 72–AK468, Revision 1, dated March 3, 2020.

(h) Installation Prohibition

After the effective date of this AD, do not install on any aircraft, an engine pairing combination identified as “Not Acceptable De-pair required” in paragraph 3, Accomplishment Instructions, Table 2, “Examples of compliant and non-compliant engine pairing combinations,” of RR Alert NMSB Trent 1000 72–AK468, Revision 1, dated March 3, 2020.

(i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, ECO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j)(1) of this AD. You may email your request to: ANE-AD-AMOC@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(j) Related Information

(1) For more information about this AD, contact Stephen Elwin, Aerospace Engineer, ECO Branch, FAA, 1200 District Avenue, Burlington, MA 01803; phone: 781–238–7236; fax: 781–238–7199; email: stephen.l.elwin@faa.gov.

(2) Refer to European Union Aviation Safety Agency (EASA) AD 2020–0010R2, dated March 4, 2020, for more information. You may examine the EASA AD in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating it in Docket No. FAA–2020–0638.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Rolls-Royce plc (RR) Alert Non-Modification Service Bulletin Trent 1000 72–AK468, Revision 1, dated March 3, 2020.

(ii) [Reserved]

(3) For RR service information identified in this AD, contact Rolls-Royce Deutschland Ltd & Co KG, Eschenweg 11, 15827 Blankenfelde-Mahlow, Germany; phone: +49 (0) 33 708 6 0; email: <https://www.rolls-royce.com/contact-us.aspx>.

(4) You may view this service information at FAA, Airworthiness Products Section, Operational Safety Branch, 1200 District Avenue, Burlington, MA 01803. For information on the availability of this material at the FAA, call 781–238–7759.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email: fedreg.legal@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on July 1, 2020.

Gaetano A. Sciortino,

Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020–14601 Filed 7–7–20; 8:45 am]

BILLING CODE 4910–13–P

CONSUMER PRODUCT SAFETY COMMISSION

16 CFR Part 1224

[Docket No. CPSC–2011–0019]

Revisions to Safety Standard for Portable Bed Rails; Corrections

AGENCY: Consumer Product Safety Commission.

ACTION: Correcting amendments.

SUMMARY: On February 25, 2020, the Consumer Product Safety Commission (Commission or CPSC) issued a direct final rule revising CPSC’s mandatory standard for portable bed rails to incorporate by reference the most recent version of the applicable ASTM standard. That document contained typographical errors. In this document, we correct those errors, provide an additional option for viewing the standard, and add new contact information, which will provide the public several ways to contact CPSC, even during the COVID–19 pandemic.

DATES: Effective July 8, 2020.