

TIS or until all 48 elevator torque tube attach fasteners are replaced, whichever occurs first.

(iii) For airplanes that have accumulated 4,000 or more hours TIS as of the effective date of this AD, complete a one-time visual inspection within 200 hours TIS after the effective date of the AD. No repetitive inspections are required after completion of the one-time visual inspection.

(2) If there are any loose, fretting, or incorrectly installed fasteners, remove the elevator and replace all 48 elevator torque tube attach fasteners (24 per side, with 12 each on the inboard and outboard elevator torque tube attach point) before further flight. Maintain proper alignment by marking each part prior to removal and by replacing one fastener at a time. Replacing all 48 fasteners is terminating action for the repetitive inspections required by paragraphs (g)(1)(i) and (ii) of this AD.

(3) If all 48 fasteners were replaced before the effective date of this AD by following the instructions in paragraph (g)(2) of this AD, then the initial and recurring inspections detailed in paragraph (g)(1) of this AD are not required provided you report the information required by paragraph (h) of this AD.

#### (h) Reporting Requirement

Within 30 days after doing the initial inspection (regardless if loose, fretting, or incorrectly installed fasteners were found) or within 30 days after the effective date of this AD, whichever occurs later, and then within 30 days after each inspection where loose, fretting, or incorrectly installed fasteners were found, report the following information to the FAA at [Wichita-COS@faa.gov](mailto:Wichita-COS@faa.gov):

(1) Name and address of owner.

(2) Date of the inspection.

(3) Name, address, telephone number, and email address of person submitting the report.

(4) Airplane serial number, registration number, and total hours TIS on the airplane at the time of the inspection.

(5) If an earlier inspection identified loose, fretting, or incorrectly installed fasteners, identify the hours TIS on the airplane and which fasteners were replaced, if known, or if all fasteners were replaced.

(6) If loose, fretting, or incorrectly installed fasteners were found, detailed information including a sketch or picture showing the location of the loose, fretting, or incorrectly installed fasteners and identification of any installed supplemental type certificates (STCs), alterations, repairs, or field approvals affecting the area of concern.

#### (i) Paperwork Reduction Act Burden Statement

A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a currently valid OMB Control Number. The OMB Control Number for this information collection is 2120-0056. Public reporting for this collection of information is estimated to be approximately 1 hour per response, including the time for reviewing

instructions, searching existing data sources, gathering and maintaining the data needed, completing and reviewing the collection of information. All responses to this collection of information are mandatory. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden to: Information Collection Clearance Officer, Federal Aviation Administration, 10101 Hillwood Parkway, Fort Worth, TX 76177-1524.

#### (j) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Wichita ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in the Related Information section of this AD.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

#### (k) Related Information

(1) For more information about this AD, contact Bobbie Kroetch, Aerospace Engineer, Wichita ACO Branch, FAA, 1801 Airport Rd, Wichita, KS 67209; phone: 316-946-4155; fax: 316-946-4107; email: [bobbie.kroetch@faa.gov](mailto:bobbie.kroetch@faa.gov) or [Wichita-COS@faa.gov](mailto:Wichita-COS@faa.gov).

(2) For service information identified in this AD, contact Textron Aviation Inc., One Cessna Boulevard, Wichita, KS 67215, telephone: 316-517-5800, email: [teamturbopropsupport@txtav.com](mailto:teamturbopropsupport@txtav.com), internet: <https://support.cessna.com>. You may review this referenced service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

Issued on September 15, 2020.

#### Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-20681 Filed 9-21-20; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION Federal Aviation Administration

### 14 CFR Part 39

[Docket No. FAA-2020-0846; Project Identifier MCAI-2020-00806-T]

RIN 2120-AA64

### Airworthiness Directives; Airbus SAS Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for certain Airbus SAS Model A350-941 and -1041 airplanes. This proposed AD was prompted by reports of migration of the bushings of the horizontal tail plane (HTP) lateral load fittings (LLFs) on the left- and right-hand sides during flight test. This proposed AD would require repetitive inspections for migration of the bushings of the HTP LLFs on the left- and right-hand sides, and terminating repair or modification of any affected bushing, as specified in a European Union Aviation Safety Agency (EASA), which will be incorporated by reference. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by November 6, 2020.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For the material incorporated by reference (IBR) in this AD, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this IBR material on the EASA website at <https://ad.easa.europa.eu>. You may view this IBR material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0846.

#### Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0846; or in person at Docket Operations

between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:**

Kathleen Arrigotti, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3218; email [kathleen.arrigotti@faa.gov](mailto:kathleen.arrigotti@faa.gov).

**SUPPLEMENTARY INFORMATION:**

**Comments Invited**

The FAA invites you to participate in this rulemaking by submitting written comments, data, or views about this proposal. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. To ensure the docket does not contain duplicate comments, commenters should send only one copy of written comments, or if comments are filed electronically, commenters should submit only one time. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2020-0846; Project Identifier MCAI-2020-00806-T at the beginning of your comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, as well as a report summarizing each substantive public contact with FAA personnel concerning this proposed rulemaking. Before acting on this proposal, the FAA will consider all comments received by the closing date for comments. The FAA will consider comments filed after the comment period has closed if it is possible to do so without incurring expense or delay. The FAA may change this NPRM because of those comments.

**Confidential Business Information**

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as

private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to the person identified in the **FOR FURTHER INFORMATION CONTACT** section. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

**Discussion**

The EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2020-0139R1, dated July 3, 2020 ("EASA AD 2020-0139R1") (also referred to as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for certain Airbus SAS Model A350-941 and -1041 airplanes.

This proposed AD was prompted by reports of migration of the bushings of the HTP LLFs on the left- and right-hand sides during flight test. The FAA is proposing this AD to address combined corrosion and fatigue damage of the primary structure, possibly resulting in failure of an HTP LLF and damage to adjacent structure, which could result in reduced controllability of the airplane. See the MCAI for additional background information.

**Related IBR Material Under 1 CFR Part 51**

EASA AD 2020-0139R1 describes procedures for repetitive detailed inspections for migration of the bushings of the HTP LLF on the left- and right-hand sides; and repair or modification of any affected bushing, which eliminates the need for the repetitive inspections. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

**FAA's Determination and Requirements of This Proposed AD**

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to the FAA's bilateral agreement with the State of Design Authority, the FAA has been

notified of the unsafe condition described in the MCAI referenced above. The FAA is proposing this AD because the FAA evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

**Proposed AD Requirements**

This proposed AD would require accomplishing the actions specified in EASA AD 2020-0139R1 described previously, as incorporated by reference, except for any differences identified as exceptions in the regulatory text of this AD.

**Explanation of Required Compliance Information**

In the FAA's ongoing efforts to improve the efficiency of the AD process, the FAA initially worked with Airbus and EASA to develop a process to use certain EASA ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has since coordinated with other manufacturers and civil aviation authorities (CAAs) to use this process. As a result, EASA AD 2020-0139R1 will be incorporated by reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2020-0139R1 in its entirety, through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in the EASA AD does not mean that operators need comply only with that section. For example, where the AD requirement refers to "all required actions and compliance times," compliance with this AD requirement is not limited to the section titled "Required Action(s) and Compliance Time(s)" in the EASA AD. Service information specified in EASA AD 2020-0139R1 that is required for compliance with EASA AD 2020-0139R1 will be available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0846 after the FAA final rule is published.

**Costs of Compliance**

The FAA estimates that this proposed AD affects 13 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
10 work-hours × \$85 per hour = \$850 .....	\$0	\$850	\$11,050 per inspection cycle.

The FAA estimates that it would take about 1 work-hour per product to comply with the proposed reporting

requirement in this proposed AD. The average labor rate is \$85 per hour. Based on these figures, the FAA estimates the

cost of reporting the inspection results on U.S. operators to be \$1,105, or \$85 per product.

ESTIMATED COSTS FOR OPTIONAL ACTIONS

Labor cost	Parts cost	Cost per product
Up to 38 work-hours × \$85 per hour = Up to \$3,230 .....	\$0	Up to \$3,230.

**Paperwork Reduction Act**

A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB control number. The control number for the collection of information required by this proposed AD is 2120–0056. The paperwork cost associated with this proposed AD has been detailed in the Costs of Compliance section of this document and includes time for reviewing instructions, as well as completing and reviewing the collection of information. Therefore, all reporting associated with this proposed AD is mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to Information Collection Clearance Officer, Federal Aviation Administration, 10101 Hillwood Parkway, Fort Worth, TX 76177–1524.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an

unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Airbus SAS:** Docket No. FAA–2020–0846; Project Identifier MCAI–2020–00806–T.

**(a) Comments Due Date**

The FAA must receive comments by November 6, 2020.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to Airbus SAS Model A350–941 and –1041 airplanes, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2020–0139R1, dated July 3, 2020 (“EASA AD 2020–0139R1”).

**(d) Subject**

Air Transport Association (ATA) of America Code 55, Stabilizers.

**(e) Reason**

This AD was prompted by reports of migration of the bushings of the horizontal tail plane (HTP) lateral load fittings (LLFs) on the left- and right-hand sides during flight test. The FAA is issuing this AD to address combined corrosion and fatigue damage of the primary structure, possibly resulting in failure of an HTP LLF and damage to adjacent structure, which could result in reduced controllability of the airplane.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Requirements**

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2020–0139R1.

**(h) Exceptions to EASA AD 2020–0139R1**

- (1) The “Remarks” section of EASA AD 2020–0139R1 does not apply to this AD.
- (2) Paragraph (6) of EASA AD 2020–0139R1 specifies to report inspection results to Airbus within a certain compliance time. For this AD, report inspection results at the applicable time specified in paragraph (h)(2)(i) or (ii) of this AD.
  - (i) If the inspection was done on or after the effective date of this AD: Submit the report within 30 days after the inspection.
  - (ii) If the inspection was done before the effective date of this AD: Submit the report

within 30 days after the effective date of this AD.

**(i) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (j)(2) of this AD. Information may be emailed to: [9-AVS-AIR-730-AMOC@faa.gov](mailto:9-AVS-AIR-730-AMOC@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or Airbus SAS's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC)*: For any service information referenced in EASA AD 2020-0139R1 that contains RC procedures and tests: Except as required by paragraph (i)(2) of this AD, RC procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

(4) *Paperwork Reduction Act Burden Statement*: A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120-0056. Public reporting for this collection of information is estimated to be approximately 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. All responses to this collection of information are mandatory as required by this AD. Send comments regarding this burden estimate or any other aspect of this collection of information,

including suggestions for reducing this burden to Information Collection Clearance Officer, Federal Aviation Administration, 10101 Hillwood Parkway, Fort Worth, TX 76177-1524.

**(j) Related Information**

(1) For information about EASA AD 2020-0139R1, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADS@easa.europa.eu](mailto:ADS@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>. You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0846.

(2) For more information about this AD, contact Kathleen Arrigotti, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3218; email [kathleen.arrigotti@faa.gov](mailto:kathleen.arrigotti@faa.gov).

Issued on September 14, 2020.

**Lance T. Gant,**

*Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2020-20676 Filed 9-21-20; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 71**

[Docket No. FAA-2020-0822; Airspace Docket No. 20-ASO-23]

**RIN 2120-AA66**

**Proposed Amendment of Class D Airspace, and Proposed Removal of Class E Airspace; Homestead, FL**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** This action proposes to amend Class D airspace, and remove Class E airspace designated as an extension to a Class D surface area for Homestead Air Reserve Base (ARB), Homestead, FL. This action would also update the geographic coordinates of the airport. Controlled airspace is necessary for the safety and management of instrument flight rules (IFR) operations in the area.

**DATES:** Comments must be received on or before November 6, 2020.

**ADDRESSES:** Send comments on this proposal to: the U.S. Department of

Transportation, Docket Operations, 1200 New Jersey Avenue SE, West Building Ground Floor, Room W12-140, Washington, DC 20590-0001; Telephone: (800) 647-5527, or (202) 366-9826. You must identify the Docket No. FAA-2020-0822; Airspace Docket No. 20-ASO-23, at the beginning of your comments. You may also submit comments through the internet at <https://www.regulations.gov>.

FAA Order 7400.11E, Airspace Designations and Reporting Points, and subsequent amendments can be viewed on-line at [https://www.faa.gov/air\\_traffic/publications/](https://www.faa.gov/air_traffic/publications/). For further information, you can contact the Airspace Policy Group, Federal Aviation Administration, 800 Independence Avenue SW, Washington, DC 20591; Telephone: (202) 267-8783. The Order is also available for inspection at the National Archives and Records Administration (NARA). For information on the availability of FAA Order 7400.11E at NARA, email [fedreg.legal@nara.gov](mailto:fedreg.legal@nara.gov) or go to <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

**FOR FURTHER INFORMATION CONTACT:** John Fornito, Operations Support Group, Eastern Service Center, Federal Aviation Administration, 1701 Columbia Avenue, College Park, GA 30337; Telephone (404) 305-6364.

**SUPPLEMENTARY INFORMATION:**

**Authority for This Rulemaking**

The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority. This rulemaking is promulgated under the authority described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it would amend Class D airspace and remove Class E airspace designated as an extension to a Class D surface area for Homestead ARB, Homestead, FL, to support IFR operations in the area.

**Comments Invited**

Interested persons are invited to comment on this proposed rulemaking by submitting such written data, views, or arguments, as they may desire. Comments that provide the factual basis supporting the views and suggestions