

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**MHI RJ Aviation ULC (Type Certificate Previously Held by Bombardier, Inc.):**  
Docket No. FAA-2020-1137; Project Identifier MCAI-2020-00816-T.

**(a) Comments Due Date**

The FAA must receive comments by February 4, 2021.

**(b) Affected Airworthiness Directives (ADs)**

None.

**(c) Applicability**

This AD applies to MHI RJ Aviation ULC airplanes identified in paragraphs (c)(1) and (2) of this AD, certificated in any category.

(1) Model CL-600-2C10 (Regional Jet Series 700, 701 & 702) and Model CL-600-2C11 (Regional Jet Series 550) airplanes having serial numbers (S/Ns) 10082, 10135, 10141, 10155, 10166, 10173, 10178, 10186, 10249, 10296, and 10327.

(2) Model CL-600-2D24 (Regional Jet Series 900) airplanes having S/Ns 15099, 15102, 15144, 15159, 15201, 15212, 15279, 15396, 15409 through 15413 inclusive, 15415, 15419 through 15427 inclusive, 15430, 15449, and 15453.

**(d) Subject**

Air Transport Association (ATA) of America Code 30, Ice and Rain Protection.

**(e) Reason**

This AD was prompted by a report that some piccolo ducts for the wing anti-ice system have bleed holes that do not conform to requirements (such as being undersized, un-burred, or in the wrong location). The FAA is issuing this AD to address non-conforming piccolo duct bleed holes, which could lead to degradation of the wing anti-ice protection of the leading edge of certain slats, and possibly result in airplane handling issues during critical phases of flight.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Inspection and Corrective Action**

Within 8,800 flight hours after the effective date of this AD, inspect for the presence of affected piccolo duct assemblies, as applicable, and replace each affected piccolo duct with a new piccolo duct, as applicable, in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 670BA-30-025, dated December 17, 2019.

**(h) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation (TCCA); or MHI RJ Aviation ULC's TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

**(i) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian AD CF-2020-23, dated June 24, 2020, for related information. This MCAI may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-1137.

(2) For more information about this AD, contact Siddeeq Bacchus, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7362; email [9-avs-nyaco-cos@faa.gov](mailto:9-avs-nyaco-cos@faa.gov).

(3) For service information identified in this AD, contact MHI RJ Aviation ULC, 12655 Henri-Fabre Blvd., Mirabel, Québec J7N 1E1 Canada; Widebody Customer Response Center North America toll-free telephone +1-844-272-2720 or direct-dial telephone +1-514-855-8500; fax +1-514-855-8501; email [thd.crj@mhirj.com](mailto:thd.crj@mhirj.com); internet <https://mhirj.com>. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued on December 15, 2020.

**Lance T. Gant,**

*Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2020-27907 Filed 12-18-20; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2020-1136; Project Identifier MCAI-2020-01301-R]

**RIN 2120-AA64**

**Airworthiness Directives; Airbus Helicopters**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for all Airbus Helicopters Model AS332L, AS332L1, AS332C, and AS332C1 helicopters. This proposed AD was prompted by the failure of a second stage planet gear installed in the main gearbox (MGB). This proposed AD would require identifying the part number of each second stage planet gear assembly installed in the MGB, replacing an MGB having certain second stage planet gear assembly part numbers with a serviceable MGB, modifying the helicopter by installing a full flow magnetic plug (FFMP), repetitively inspecting the FFMP and the MGB bottom housing and conical housing for metal particles, analyzing any metal particles that are found, and applying corrective actions if necessary, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by February 4, 2021.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

• *Hand Delivery*: Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For material that will be incorporated by reference (IBR) in this AD, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this IBR material on the EASA website at <https://ad.easa.europa.eu>. You may view this IBR material at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N-321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call 817-222-5110. It is also available in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-1136.

#### Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-1136; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above. Comments will be available in the AD docket shortly after receipt.

#### FOR FURTHER INFORMATION CONTACT:

Mahmood Shah, Aviation Safety Engineer, Fort Worth ACO Branch, FAA, 10101 Hillwood Pkwy., Fort Worth, TX 76177; telephone 817-222-5538; email [mahmood.g.shah@faa.gov](mailto:mahmood.g.shah@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include "Docket No. FAA-2020-1136; Project Identifier MCAI-2020-01301-R" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments

received, without change, to <http://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this proposal.

#### Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Mahmood Shah, Aviation Safety Engineer, Fort Worth ACO Branch, FAA, 10101 Hillwood Pkwy., Fort Worth, TX 76177; telephone 817-222-5538; email [mahmood.g.shah@faa.gov](mailto:mahmood.g.shah@faa.gov). Any commentary that the FAA receives that is not specifically designated as CBI will be placed in the public docket for this rulemaking.

#### Discussion

The EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2020-0022R1, dated September 18, 2020 (EASA AD 2020-0022R1) (also referred to as the Mandatory Continuing Airworthiness Information, or the MCAI), to correct an unsafe condition for all Airbus Helicopters Model AS332L, AS332L1, AS332C, and AS332C1 helicopters. This proposed AD was prompted by the failure of a second stage planet gear installed in the MGB of an Airbus Helicopters Model EC225LP helicopter. Airbus Helicopters Model AS332L, AS332L1, AS332C, and AS332C1 helicopters have a similar design to the affected Model EC225LP helicopter, therefore, these models may be subject to the unsafe condition revealed on the Model EC225LP helicopter. The FAA is proposing this AD to address failure of a second stage planet gear installed in the MGB, which could result in failure of the MGB and subsequent loss of control of the helicopter. See the MCAI for additional background information.

#### Related Service Information Under 1 CFR Part 51

EASA AD 2020-0022R1 describes procedures for identifying the part number of each second stage planet gear assembly installed in the MGB, replacing a MGB having certain second stage plane gear assembly part numbers with a serviceable MGB, modifying the helicopter by installing an FFMP, repetitively inspecting the FFMP and the MGB bottom housing and conical housing for metal particles, analyzing any metal particles that are found, and applicable corrective actions. The corrective actions include replacing an affected MGB with a serviceable MGB.

This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

#### FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to the bilateral agreement with the State of Design Authority, the FAA has been notified of the unsafe condition described in the MCAI referenced above. The FAA is proposing this AD because the FAA evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

#### Proposed AD Requirements

This proposed AD would require accomplishing the actions specified in EASA AD 2020-0022R1, described previously, as incorporated by reference, except for any differences identified as exceptions in the regulatory text of this proposed AD.

#### Explanation of Required Compliance Information

In the FAA's ongoing efforts to improve the efficiency of the AD process, the FAA initially worked with Airbus and EASA to develop a process to use certain EASA ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has since coordinated with other manufacturers and civil aviation authorities (CAAs) to use this process. As a result, EASA AD 2020-0022R1 will be incorporated by reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2020-0022R1 in its entirety, through that incorporation, except for any differences

identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in the EASA AD does not mean that operators need comply only with that section. For example, where the AD requirement refers to “all required actions and compliance times,” compliance with this AD requirement is

not limited to the section titled “Required Action(s) and Compliance Time(s)” in the EASA AD. Service information specified in EASA AD 2020–0022R1 that is required for compliance with EASA AD 2020–0022R1 will be available on the internet at <https://www.regulations.gov> by searching for and locating Docket No.

FAA–2020–1136 after the FAA final rule is published.

**Costs of Compliance**

The FAA estimates that this proposed AD affects 11 helicopters of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

**ESTIMATED COSTS FOR REQUIRED ACTIONS**

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
8.50 work-hours × \$85 per hour = \$722.50 .....	\$17,625	\$18,347.50	\$201,822.50

The FAA estimates the following costs to do any necessary on-condition actions that would be required based on

the results of any required actions. The FAA has no way of determining the

number of helicopters that might need these on-condition actions:

**ESTIMATED COSTS OF ON-CONDITION ACTIONS**

Labor cost	Parts cost	Cost per product
40.50 work-hour × \$85 per hour = \$3,442.50 .....	\$275,000 (overhauled part) .....	\$278,442.50

According to the manufacturer, some or all of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected operators. The FAA does not control warranty coverage for affected operators. As a result, the FAA has included all known costs in the cost estimate.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

The FAA determined that this proposed AD would not have federalism implications under Executive Order

13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**Airbus Helicopters:** Docket No. FAA–2020–1136; Project Identifier MCAI–2020–01301–R.

**(a) Comments Due Date**

The FAA must receive comments by February 4, 2021.

**(b) Affected Airworthiness Directives (ADs)**

None.

**(c) Applicability**

This AD applies to all Airbus Helicopters Model AS332L, AS332L1, AS332C, and AS332C1 helicopters, certificated in any category.

**(d) Subject**

Joint Aircraft System Component (JASC) Code 6320, Main Rotor Gear Box.

**(e) Reason**

This AD was prompted by the failure of a second stage planet gear installed in the main gearbox (MGB). The FAA is issuing this AD to address failure of an MGB second stage planet gear, which could result in failure of the MGB and subsequent loss of control of the helicopter.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Requirements**

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in

accordance with, European Union Aviation Safety Agency (EASA) AD 2020–0022R1, dated September 18, 2020 (EASA AD 2020–0022R1).

**(h) Exceptions to EASA AD 2020–0022R1**

(1) Where EASA AD 2020–0022R1 refers to March 30, 2018 (the effective date of EASA AD 2018–0066, dated March 23, 2018) or February 21, 2020 (the effective date of EASA AD 2020–0022, dated February 21, 2020), this AD requires using the effective date of this AD.

(2) The “Remarks” section of EASA AD 2020–0022R1 does not apply to this AD.

(3) Where EASA AD 2020–0022R1 refers to flight hours (FH), this AD requires using hours time-in-service.

(4) Where the service information referred to in paragraphs (5) and (6) of EASA AD 2020–0022R1 specifies to perform a metallurgical analysis and contact the manufacturer if unsure about the characterization of the particles collected, this AD does not require contacting the manufacturer to determine the characterization of the particles collected.

(5) Although the service information referred to in paragraph (6) of EASA AD 2020–0022R1 specifies that if any 16NCD13 particles are found send a 1-liter sample of oil to the manufacturer, this AD does not require that action.

(6) Although the service information referenced in EASA AD 2020–0022R1 specifies to discard certain parts, this AD does not include that requirement.

(7) Although the service information referenced in EASA AD 2020–0022R1 specifies returning certain parts to the manufacturer, this AD does not require that action.

(8) Although the service information referenced in EASA AD 2020–0022R1 specifies to contact the manufacturer if certain specified criteria are exceeded, this AD does not include that requirement.

(9) Although the service information referenced in EASA AD 2020–0022R1 specifies to submit certain information to the manufacturer, this AD does not include that requirement.

(10) Although the service information referenced in EASA AD 2020–0022R1 specifies to watch a video for removing the grease from the FFMP, using a cleaning agent, and collecting particles, this AD does not include that requirement.

(11) Where EASA AD 2020–0022R1 requires actions after the last flight of the day or “ALF,” this AD requires those actions before the first flight of the day.

**(i) Special Flight Permit**

Special flight permits may be issued in accordance with 14 CFR 21.197 and 21.199 to operate the helicopter to a location where the helicopter can be modified (if the operator elects to do so), provided no passengers are onboard.

**(j) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Strategic Policy Rotorcraft Section, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19.

In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the Strategic Policy Rotorcraft Section, send it to: Manager, Strategic Policy Rotorcraft Section, FAA, 10101 Hillwood Pkwy., Fort Worth, TX 76177; telephone 817–222–5110; email 9-ASW-FTW-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

**(k) Related Information**

(1) For EASA AD 2020–0022R1, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>. You may view this material at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N–321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call 817–222–5110. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2020–1136.

(2) For more information about this AD, contact Mahmood Shah, Aviation Safety Engineer, Fort Worth ACO Branch, FAA, 10101 Hillwood Pkwy., Fort Worth, TX 76177; telephone 817 222 5538; email [mahmood.g.shah@faa.gov](mailto:mahmood.g.shah@faa.gov).

Issued on December 15, 2020.

**Lance T. Gant,**

*Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2020–28026 Filed 12–18–20; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF HEALTH AND HUMAN SERVICES**

**Food and Drug Administration**

**21 CFR Part 169**

[Docket No. FDA–2020–N–1807]

RIN 0910–AI16

**French Dressing; Proposed Revocation of a Standard of Identity**

**AGENCY:** Food and Drug Administration, HHS.

**ACTION:** Proposed rule.

**SUMMARY:** The Food and Drug Administration (FDA or we) proposes to revoke the standard of identity for French dressing. This action, in part, responds to a citizen petition submitted by the Association for Dressings and Sauces (ADS). We tentatively conclude that this standard no longer promotes honesty and fair dealing in the interest

of consumers. Revocation of the standard of identity for French dressing could provide greater flexibility in the product’s manufacture, consistent with comparable, nonstandardized foods available in the marketplace.

**DATES:** Submit either electronic or written comments on the proposed rule by March 22, 2021.

**ADDRESSES:** You may submit comments as follows. Please note that late, untimely filed comments will not be considered. Electronic comments must be submitted on or before March 22, 2021. The <https://www.regulations.gov> electronic filing system will accept comments until 11:59 p.m. Eastern Time at the end of March 22, 2021. Comments received by mail/hand delivery/courier (for written/paper submissions) will be considered timely if they are postmarked or the delivery service acceptance receipt is on or before that date.

*Electronic Submissions*

Submit electronic comments in the following way:

- *Federal eRulemaking Portal:* <https://www.regulations.gov>. Follow the instructions for submitting comments. Comments submitted electronically, including attachments, to <https://www.regulations.gov> will be posted to the docket unchanged. Because your comment will be made public, you are solely responsible for ensuring that your comment does not include any confidential information that you or a third party may not wish to be posted, such as medical information, your or anyone else’s Social Security number, or confidential business information, such as a manufacturing process. Please note that if you include your name, contact information, or other information that identifies you in the body of your comments, that information will be posted on <https://www.regulations.gov>.

- If you want to submit a comment with confidential information that you do not wish to be made available to the public, submit the comment as a written/paper submission and in the manner detailed (see “Written/Paper Submissions” and “Instructions”).

*Written/Paper Submissions*

Submit written/paper submissions as follows:

- *Mail/Hand Delivery/Courier (for written/paper submissions):* Dockets Management Staff (HFA–305), Food and Drug Administration, 5630 Fishers Lane, Rm. 1061, Rockville, MD 20852.
- For written/paper comments submitted to the Dockets Management Staff, FDA will post your comment, as