

leakage paths for halon and smoke to escape from the aft cargo compartment in the event of a fire. The FAA is issuing this AD to address increased leakage paths, which, in the event of a fire, could result in loss of fire suppressant in the cargo compartment, and could lead to an uncontained fire and subsequent loss of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

Except as specified by paragraph (h) of this AD: At the applicable times specified in the "Compliance" paragraph of Boeing Special Attention Requirements Bulletin 777-25-0753 RB, dated July 31, 2020, do all applicable actions identified in, and in accordance with, the Accomplishment Instructions of Boeing Special Attention Requirements Bulletin 777-25-0753 RB, dated July 31, 2020.

Note 1 to paragraph (g): Guidance for accomplishing the actions required by this AD can be found in Boeing Special Attention Service Bulletin 777-25-0753, dated July 31, 2020, which is referred to in Boeing Special Attention Requirements Bulletin 777-25-0753 RB, dated July 31, 2020.

(h) Exceptions to Service Information Specifications

Where Boeing Special Attention Requirements Bulletin 777-25-0753 RB, dated July 31, 2020, uses the phrase "the original issue date of the Requirements Bulletin 777-25-0753 RB," this AD requires using "the effective date of this AD."

(i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j)(1) of this AD. Information may be emailed to: 9-ANM-Seattle-ACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(j) Related Information

(1) For more information about this AD, contact Susan L. Monroe, Aerospace

Engineer, Cabin Safety and Environmental Systems Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3570; email: susan.l.monroe@faa.gov.

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued on November 13, 2020.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-28824 Filed 12-28-20; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2020-1028; Project Identifier AD-2020-00978-T]

RIN 2120-AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for all The Boeing Company Model 717-200 airplanes. This proposed AD was prompted by a report of discrepant spoiler assemblies, which have the wrong splice bar installed and lack reinforcing doublers. This proposed AD would require a one-time inspection of the left- and right-wing inboard and outboard spoiler assemblies for the correct splice bar and doublers configuration, and repair if necessary. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by February 12, 2021.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of

Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-1028.

Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-1028; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT:

Mohit Garg, Aerospace Engineer, Airframe Section, FAA, Los Angeles ACO Branch, 3960 Paramount Boulevard, Lakewood, CA 90712-4137; phone: 562-627-5264; fax: 562-627-5210; email: mohit.garg@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to participate in this rulemaking by submitting written comments, data, or views about this proposal. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. To ensure the docket does not contain duplicate comments, commenters should submit only one copy of the comments. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2020-1028; Project Identifier AD-2020-00978-T" at the beginning of your comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, as well as a report summarizing each substantive public contact with FAA personnel concerning this proposed rulemaking. Before acting on this proposal, the FAA will consider all comments received by the closing date for comments. The FAA will consider comments filed after the comment period has closed if it is possible to do so without incurring expense or delay. The FAA may change this NPRM because of those comments.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to the person identified in the **FOR FURTHER INFORMATION CONTACT** section. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Discussion

The FAA has received a report of discrepant spoiler assemblies, which have the wrong splice bar installed and lack reinforcing doublers. These two

features were introduced to meet fail-safe requirements. The splice bar, unique to the Boeing Model 717 airplane, features the capability to minimize uncommanded spoiler float in the event of a spoiler drive connection failure. The Boeing Model 717 airplane design utilizes a back-up to the hold-down actuator. The drive link in the spoiler operating mechanism features hooks that are designed to engage the splice bar when the spoiler unintentionally rises. In normal operation, the hooks of the drive link never contact the splice bar. Although the incorrect spoilers with no reinforcing doublers and an incorrect splice bar do not affect the strength requirements of the spoiler under normal conditions, an incorrect splice bar is not structurally adequate to support the spoiler drive link hook fail-safe load condition. This condition, if not addressed, could lead to failure of the splice bar to keep the spoiler drive link engaged, and could result in spoiler float and consequent reduced controllability of the airplane.

Related Service Information Under 1 CFR Part 51

The FAA reviewed Boeing Alert Requirements Bulletin 717-57A0027 RB, dated June 26, 2020. This service information describes procedures for a one-time general visual inspection of the left- and right-wing inboard and outboard spoiler assemblies for the correct splice bar and doublers configuration, and repair. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

FAA’s Determination

The FAA is proposing this AD because the agency evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop

in other products of the same type design.

Proposed AD Requirements

This proposed AD would require accomplishment of the actions identified in Boeing Alert Requirements Bulletin 717-57A0027 RB, dated June 26, 2020, described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD.

For information on the procedures and compliance times, see this service information at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-1028.

Explanation of Requirements Bulletin

The FAA worked in conjunction with industry, under the Airworthiness Directive Implementation Aviation Rulemaking Committee (AD ARC), to enhance the AD system. One enhancement is a process for annotating which steps in the service information are “required for compliance” (RC) with an AD. Boeing has implemented this RC concept into Boeing service bulletins.

In an effort to further improve the quality of ADs and AD-related Boeing service information, a joint process improvement initiative was worked between the FAA and Boeing. The initiative resulted in the development of a new process in which the service information more clearly identifies the actions needed to address the unsafe condition in the “Accomplishment Instructions.” The new process results in a Boeing Requirements Bulletin, which contains only the actions needed to address the unsafe condition (*i.e.*, only the RC actions).

Costs of Compliance

The FAA estimates that this proposed AD affects 114 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspection	4 work-hours × \$85 per hour = \$340	\$0	\$340	\$38,760

The FAA estimates the following costs to do any necessary on-condition

actions that would be required. The FAA has no way of determining the

number of aircraft that might need these on-condition actions:

ESTIMATED COSTS OF ON-CONDITION ACTIONS

Labor cost	Parts cost	Cost per product
Up to 2 work-hour × \$85 per hour = \$170 per spoiler assembly	\$5,432 per spoiler assembly	Up to \$5,602 per spoiler assembly.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

The Boeing Company: Docket No. FAA–2020–1028; Project Identifier AD–2020–00978–T.

(a) Comments Due Date

The FAA must receive comments by February 12, 2021.

(b) Affected ADs

None.

(c) Applicability

This AD applies to all The Boeing Company Model 717–200 airplanes, certificated in any category.

(d) Subject

Air Transport Association (ATA) of America Code 57, Wings.

(e) Unsafe Condition

This AD was prompted by a report of discrepant spoiler assemblies, which have the wrong splice bar installed and lack reinforcing doublers. The FAA is issuing this AD to address splice bars which are not structurally adequate, which can lead to failure of the splice bar to keep the spoiler drive link engaged, and could result in spoiler float and consequent reduced controllability of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

Except as specified by paragraph (h) of this AD: At the applicable times specified in the "Compliance" paragraph of Boeing Alert Requirements Bulletin 717–57A0027 RB, dated June 26, 2020, do all applicable actions identified in, and in accordance with, the Accomplishment Instructions of Boeing Alert Requirements Bulletin 717–57A0027 RB, dated June 26, 2020.

Note 1 to paragraph (g): Guidance for accomplishing the actions required by this AD can be found in Boeing Alert Service Bulletin 717–57A0027, dated June 26, 2020, which is referred to in Boeing Alert Requirements Bulletin 717–57A0027 RB, dated June 26, 2020.

(h) Exceptions to Service Information Specifications

(1) Where Boeing Alert Requirements Bulletin 717–57A0027 RB, dated June 26, 2020, uses the phrase "the original issue date of Requirements Bulletin 717–57A0027 RB," this AD requires using "the effective date of this AD."

(2) Where Boeing Alert Requirements Bulletin 717–57A0027 RB, dated June 26, 2020, specifies contacting Boeing for repair instructions: This AD requires doing the repair before further flight using a method approved in accordance with the procedures specified in paragraph (k) of this AD.

(i) Credit for Previous Actions

This paragraph provides credit for the actions specified in paragraph (g) of this AD, if those actions were performed before the effective date of this AD using Boeing Multi Operator Message MOM–MOM–19–0572–01B, dated October 16, 2019.

(j) Parts Installation Limitation

As of the effective date of this AD, no person may install, on any airplane, any affected spoiler assembly (a spoiler assembly that does not have a splice bar having part number 3914588–501 and two doublers having part/number 5940974–31), unless it has been inspected and all applicable corrective actions have been done as specified in paragraph (g) of this AD.

(k) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Los Angeles ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (l)(1) of this AD. Information may be emailed to: 9-ANM-LAACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, Los Angeles ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(I) Related Information

(1) For more information about this AD, contact Mohit Garg, Aerospace Engineer, Airframe Section, FAA, Los Angeles ACO Branch, 3960 Paramount Boulevard, Lakewood, CA 90712-4137; phone: 562-627-5264; fax: 562-627-5210; email: mohit.garg@faa.gov.

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued on November 13, 2020.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-28825 Filed 12-28-20; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 71**

[Docket No. FAA-2020-1147; Airspace Docket No. 20-ASO-30]

RIN 2120-AA66

Proposed Amendment of Area Navigation (RNAV) Route Q-29; Northeastern United States

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: This action proposes to amend Area Navigation (RNAV) route Q-29 in the northeastern United States in support of the Northeast Corridor Atlantic Coast Route Project (NEC ACR) for improve efficiency of the National Airspace System (NAS) while reducing the dependency on ground based navigational systems.

DATES: Comments must be received on or before February 12, 2021.

ADDRESSES: Send comments on this proposal to the U.S. Department of Transportation, Docket Operations, 1200 New Jersey Avenue SE, West Building Ground Floor, Room W12-140, Washington, DC 20590; telephone: 1(800) 647-5527, or (202) 366-9826. You must identify FAA Docket No. FAA-2020-1147; Airspace Docket No. 20-ASO-30 at the beginning of your comments. You may also submit

comments through the internet at <https://www.regulations.gov>.

FAA Order 7400.11E, Airspace Designations and Reporting Points, and subsequent amendments can be viewed online at https://www.faa.gov/air_traffic/publications/. For further information, you can contact the Rules and Regulations Group, Federal Aviation Administration, 800 Independence Avenue SW, Washington, DC, 20591; telephone: (202) 267-8783. The Order is also available for inspection at the National Archives and Records Administration (NARA). For information on the availability of FAA Order 7400.11E at NARA, email: fedreg.legal@nara.gov or go to <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

FOR FURTHER INFORMATION CONTACT:

Sean Hook, Rules and Regulations Group, Office of Policy, Federal Aviation Administration, 800 Independence Avenue SW, Washington, DC 20591; telephone: (202) 267-8783.

SUPPLEMENTARY INFORMATION:**Authority for This Rulemaking**

The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority. This rulemaking is promulgated under the authority described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of the airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it would expand the availability of RNAV routes in the NAS, increase airspace capacity, and reduce complexity in high air traffic volume areas.

Comments Invited

Interested parties are invited to participate in this proposed rulemaking by submitting such written data, views, or arguments as they may desire. Comments that provide the factual basis supporting the views and suggestions presented are particularly helpful in developing reasoned regulatory decisions on the proposal. Comments are specifically invited on the overall regulatory, aeronautical, economic, environmental, and energy-related aspects of the proposal.

Communications should identify both docket numbers (FAA Docket No. FAA-2020-1147 and Airspace Docket No. 20-

ASO-30) and be submitted in triplicate to the Docket Management Facility (*see ADDRESSES* section for address and phone number). You may also submit comments through the internet at <https://www.regulations.gov>.

Commenters wishing the FAA to acknowledge receipt of their comments on this action must submit with those comments a self-addressed, stamped postcard on which the following statement is made: "Comments to FAA Docket No. FAA-2020-1147 and Airspace Docket No. 20-ASO-30." The postcard will be date/time stamped and returned to the commenter.

All communications received on or before the specified comment closing date will be considered before taking action on the proposed rule. The proposal contained in this action may be changed in light of comments received. A report summarizing each substantive public contact with FAA personnel concerned with this rulemaking will be filed in the docket.

Availability of NPRM's

An electronic copy of this document may be downloaded through the internet at <https://www.regulations.gov>. Recently published rulemaking documents can also be accessed through the FAA's web page at https://www.faa.gov/air_traffic/publications/airspace_amendments/.

You may review the public docket containing the proposal, any comments received and any final disposition in person in the Dockets Office (*see ADDRESSES* section for address and phone number) between 9:00 a.m. and 5:00 p.m., Monday through Friday, except federal holidays. An informal docket may also be examined during normal business hours at the office of the Eastern Service Center, Federal Aviation Administration, Room 210, 1701 Columbia Ave., College Park, GA 30337.

Availability and Summary of Documents for Incorporation by Reference

This document proposes to amend FAA Order 7400.11E, Airspace Designations and Reporting Points, dated July 21, 2020 and effective September 15, 2020. FAA Order 7400.11E is publicly available as listed in the **ADDRESSES** section of this document. FAA Order 7400.11E lists Class A, B, C, D, and E airspace areas, air traffic service routes, and reporting points.

Background

The Northeast Corridor Atlantic Coast Route (NEC ACR) project developed