

For the reasons discussed above, I certify that the proposed regulation:

(1) Is not a “significant regulatory action” under Executive Order 12866,

(2) Would not affect intrastate aviation in Alaska, and

(3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by:

- a. Removing Airworthiness Directive 2020–13–07, Amendment 39–21152 (85 FR 38312, June 26, 2020); and
- b. Adding the following new airworthiness directive:

**Rolls-Royce Deutschland Ltd & Co KG (Type Certificate previously held by Rolls-Royce plc):** Docket No. FAA–2021–0198; Project Identifier MCAI–2020–00950–E.

#### (a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by May 14, 2021.

#### (b) Affected ADs

This AD replaces AD 2020–13–07, Amendment 39–21152 (85 FR 38312, June 26, 2020).

#### (c) Applicability

This AD applies to Rolls-Royce Deutschland Ltd & Co KG (RRD) (Type Certificate previously held by Rolls-Royce plc) Trent 1000–A, Trent 1000–A2, Trent 1000–AE, Trent 1000–AE2, Trent 1000–C, Trent 1000–C2, Trent 1000–CE, Trent 1000–CE2, Trent 1000–D, Trent 1000–D2, Trent 1000–G, Trent 1000–G2, Trent 1000–H, Trent 1000–H2, Trent 1000–J2, Trent 1000–K2, and Trent 1000–L2 model turbofan engines with a fuel pump, part number (P/N) G5030FPU01 or P/N TPS1000–05, installed.

#### (d) Subject

Joint Aircraft System Component (JASC) Code 7314, Engine Fuel Pump.

#### (e) Unsafe Condition

This AD was prompted by the manufacturer’s investigation into an

unexpected reduction in fuel pump performance in certain high life fuel pumps and life-related wear-out of the internal components, which causes deterioration in fuel pump efficiency. The FAA is issuing this AD to prevent failure of the fuel pump, loss of engine thrust control and reduced control of the airplane. The unsafe condition, if not addressed, could result in failure of the fuel pump, loss of thrust control, and loss of the airplane.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Required Actions

Within the compliance time specified in Planning Information, paragraph 1.D.2, of Rolls-Royce (RR) Alert Non-Modification Service Bulletin TREN1000 73–AK581, Revision 2, dated December 2, 2020 (the RR Alert NMSB), or within 30 days after the effective date of this AD, whichever occurs later, remove the fuel pump, P/N G5030FPU01 or P/N TPS1000–05, and replace it with a part eligible for installation.

#### (h) Definition

For the purpose of this AD, a “part eligible for installation” is a fuel pump with a P/N other than G5030FPU01 or TPS1000–05 or a fuel pump that has not exceeded the compliance time specified in Planning Information, paragraph 1.D.2, of the RR Alert NMSB.

#### (i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, ECO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in Related Information. You may email your request to: [ANE-AD-AMOC@faa.gov](mailto:ANE-AD-AMOC@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

#### (j) Related Information

(1) For more information about this AD, contact Kevin M. Clark, Aviation Safety Engineer, ECO Branch, FAA, 1200 District Avenue, Burlington, MA 01803; phone: (781) 238–7088; fax: (781) 238–7199; email: [kevin.m.clark@faa.gov](mailto:kevin.m.clark@faa.gov).

(2) Refer to European Union Aviation Safety Agency (EASA) AD 2021–0006, dated January 7, 2021, for more information. You may examine the EASA AD in the AD docket at <https://www.regulations.gov> by searching for and locating it in Docket No. FAA–2021–0198.

(3) For service information identified in this AD, contact Rolls-Royce plc, P.O. Box 31, Derby, DE24 8BJ, United Kingdom; phone: +44 (0)1332 242424; website: <https://www.rolls-royce.com/contact-us.aspx>. You

may view this referenced service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 1200 District Avenue, Burlington, MA 01803. For information on the availability of this material at the FAA, call (781) 238–7759.

Issued on March 24, 2021.

**Lance T. Gant,**

*Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2021–06408 Filed 3–29–21; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA–2021–0199; Project Identifier MCAI–2021–00016–R]

RIN 2120–AA64

#### Airworthiness Directives; Airbus Helicopters Deutschland GmbH (AHD) Helicopters

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for Airbus Helicopters Deutschland GmbH (AHD) Model EC135P1, EC135P2, EC135P2+, EC135P3, EC135T1, EC135T2, EC135T2+, and EC135T3 helicopters. This proposed AD was prompted by a report of a report of increased control force in the collective axis. This proposed AD would require a one-time visual inspection of the main rotor actuator (MRA), as specified in a European Aviation Safety Agency (now European Union Aviation Safety Agency) (EASA) AD, which is proposed for incorporation by reference (IBR). The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by May 14, 2021.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202–493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For material that is proposed for IBR in this AD, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this material on the EASA website at <https://ad.easa.europa.eu>. You may view this material at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N-321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222-5110. It is also available in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0199.

### Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0199; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Katherine Venegas, Aviation Safety Engineer, Los Angeles ACO Branch, FAA, 3960 Paramount Blvd., Lakewood, California 90712; telephone (562) 627-5353; email [katherine.venegas@faa.gov](mailto:katherine.venegas@faa.gov).

### SUPPLEMENTARY INFORMATION:

#### Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include "Docket No. FAA-2021-0199; Project Identifier MCAI-2021-00016-R" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this proposal.

### Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Katherine Venegas, Aviation Safety Engineer, Los Angeles ACO Branch, FAA, 3960 Paramount Blvd., Lakewood, California 90712; telephone (562) 627-5353; email [katherine.venegas@faa.gov](mailto:katherine.venegas@faa.gov). Any commentary that the FAA receives that is not specifically designated as CBI will be placed in the public docket for this rulemaking.

### Discussion

The EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2018-0284, dated December 20, 2018 (EASA AD 2018-0284), to correct an unsafe condition for Airbus Helicopters Deutschland GmbH (AHD) Model EC135 P1, EC135 P2, EC135 P2+, EC135 P3, EC135 T1, EC135 T2, EC135 T2+, EC135 T3, EC635 P2+, EC635 P3, EC635 T1, EC635 T2+, and EC635 T3 helicopters. Model EC635 P2+, EC635 P3, EC635 T1, and EC635 T3 helicopters are not certificated by the FAA and are not included on the U.S. type certificate data sheet; this proposed AD therefore does not include those helicopters in the applicability.

This proposed AD was prompted by a report of a report of increased control force in the collective axis on an AHD Model EC135 helicopter. Subsequent inspections determined that a nut on a piston of the MRA had cracked and separated from the piston rod. The FAA is proposing this AD to prevent failure of the MRA and subsequent loss of control of the helicopter. See the EASA AD for additional background information.

### Related Service Information Under 1 CFR Part 51

EASA AD 2018-0284 describes procedures for a one-time visual

inspection of the MRA and depending on the results, replacing the affected parts.

This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

### FAA's Determination and Requirements of This Proposed AD

These products have been approved by the aviation authority of another country, and are approved for operation in the United States. Pursuant to the bilateral agreement with the State of Design Authority, the FAA has been notified of the unsafe condition described in the Mandatory Continuing Airworthiness Information (MCAI) referenced above. The FAA is proposing this AD after evaluating all the relevant information and determining the unsafe condition described previously is likely to exist or develop in other products of these same type designs.

### Proposed AD Requirements

This proposed AD would require accomplishing the actions specified in EASA AD 2018-0284 described previously, as incorporated by reference, except for any differences identified as exceptions in the regulatory text of this proposed AD and except as discussed under "Differences Between this Proposed AD and the MCAI."

### Explanation of Required Compliance Information

In the FAA's ongoing efforts to improve the efficiency of the AD process, the FAA initially worked with Airbus and EASA to develop a process to use certain EASA ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has since coordinated with other manufacturers and civil aviation authorities (CAAs) to use this process. As a result, EASA AD 2018-0284 will be incorporated by reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2018-0284 in its entirety, through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in the EASA AD does not mean that operators need comply only with that section. For example, where the AD requirement refers to "all required actions and compliance times," compliance with this AD requirement is not limited to the section titled

“Required Action(s) and Compliance Time(s)” in the EASA AD. Service information specified in EASA AD 2018–0284 that is required for compliance with EASA AD 2018–0284 will be available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2021–0199 after the FAA final rule is published.

#### Differences Between This Proposed AD and the EASA AD

The EASA AD requires contacting Airbus Helicopters or replacing an affected part, where as this proposed AD would require performing the corrective action in accordance with FAA-approved procedures or removing the affected parts from service instead. Where the EASA AD specifies a compliance time for the inspection in terms of calendar time or flight hours, this proposed AD would require a compliance time in terms of hours time-in-service instead. Where the EASA AD specifies a compliance time of 15 days for reporting the inspection results, this proposed AD would require that the findings be reported within 30 days.

#### Interim Action

The FAA considers this proposed AD interim action. If final action is later identified, the FAA might consider further rulemaking then.

#### Costs of Compliance

The FAA estimates that this AD affects 331 helicopters of U.S. Registry. Labor rates are estimated at \$85 per work-hour. Based on these numbers, the FAA estimates that operators may incur the following costs in order to comply with this proposed AD.

Inspecting the nuts on the MRA pistons would take about 1 work-hour for an estimated cost of \$85 per helicopter and \$28,135 for the U.S. fleet.

Replacing the MRA would take about 7 work-hours and parts would cost \$325,081 for an estimated cost of \$325,676 per helicopter.

Repairing the MRA would take up to about 8 work-hours and parts would cost about \$110 for an estimated cost of up to \$790 per MRA.

Reporting information would take about 1 hour for an estimated cost of \$85 per helicopter and \$28,135 for the U.S. fleet.

#### Paperwork Reduction Act

A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to penalty for failure to comply with a collection of information subject to the requirements of the Paperwork

Reduction Act unless that collection of information displays a current valid OMB control number. The control number for the collection of information required by this proposed AD is 2120–0056. The paperwork cost associated with this proposed AD has been detailed in the Costs of Compliance section of this document and includes time for reviewing instructions, as well as completing and reviewing the collection of information. Therefore, all reporting associated with this proposed AD is mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to Information Collection Clearance Officer, Federal Aviation Administration, 10101 Hillwood Parkway, Fort Worth, TX 76177–1524.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

#### Airbus Helicopters Deutschland GmbH

(AHD): Docket No. FAA–2021–0199; Project Identifier MCAI–2021–00016–R.

#### (a) Comments Due Date

- The FAA must receive comments by May 14, 2021.
- (b) Affected Airworthiness Directives (ADs) None.

#### (c) Applicability

This AD applies to all Airbus Helicopters Deutschland GmbH (AHD) Model EC135P1, EC135P2, EC135P2+, EC135P3, EC135T1, EC135T2, EC135T2+, and EC135T3 helicopters, certificated in any category.

**Note 1 to paragraph (c):** Helicopters with an EC135P3H designation are Model EC135P3 helicopters. Helicopters with an EC135T3H designation are Model EC135T3 helicopters.

#### (d) Subject

Joint Aircraft System Component (JASC) Code: 6710, Main Rotor Control.

#### (e) Reason

This AD was prompted by a report of increased control force in the collective axis. The FAA is issuing this AD to prevent failure of the main rotor actuator and subsequent loss of control of the helicopter.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, European Aviation Safety Agency (now European Union Aviation Safety Agency) (EASA) AD 2018–0284, dated December 20, 2018 (EASA AD 2018–0284).

#### (h) Exceptions to EASA AD 2018–0284

- (1) Where EASA AD 2018–0284 refers to its effective date, this AD requires using the effective date of this AD.
- (2) Where paragraph (3) of EASA AD 2018–0284 specifies contacting Airbus Helicopters,

this AD requires performing the corrective action in accordance with FAA-approved procedures.

(3) Where paragraph (4) of EASA AD 2018–0284 specifies an alternative method to comply with the requirements of paragraph (3) of EASA AD 2018–0284 by replacing an affected part, this AD requires removing the affected part from service as an alternative method.

(4) Where paragraph (1) of EASA AD 2018–0284 specifies a compliance time of “3 months or 50 flight hours, whichever occurs first,” this AD requires a compliance time of within 50 hours time-in-service (TIS) from the effective date of this AD.

(5) Where paragraph (2) of EASA AD 2018–0284 specifies a compliance time of “15 days,” this AD requires using a compliance time of “30 days.”

(6) The “Remarks” section of EASA AD 2018–0284 does not apply to this AD.

#### (i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the International Validation Branch, send it to the attention of the person identified in paragraph (j)(2) of this AD. Information may be emailed to: [9-AVS-AIR-730-AMOC@faa.gov](mailto:9-AVS-AIR-730-AMOC@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

#### (j) Related Information

(1) For EASA AD 2018–0284, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>. You may view this material at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N–321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call 817–222–5110. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2021–0199.

(2) For more information about this AD, contact Katherine Venegas, Aviation Safety Engineer, Los Angeles ACO Branch, FAA, 3960 Paramount Blvd., Lakewood, California 90712; telephone (562) 627–5353; email [katherine.venegas@faa.gov](mailto:katherine.venegas@faa.gov).

Issued on March 24, 2021.

**Lance T. Gant,**

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2021–06473 Filed 3–29–21; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF JUSTICE

### Drug Enforcement Administration

#### 21 CFR Part 1308

[Docket No. DEA–491]

#### Schedules of Controlled Substances: Placement of 5F-EDMB-PINACA, 5F-MDMB-PICA, FUB-AKB48, 5F-CUMYL-PINACA and FUB-144 in Schedule I

**AGENCY:** Drug Enforcement Administration, Department of Justice.

**ACTION:** Notice of proposed rulemaking.

**SUMMARY:** The Drug Enforcement Administration proposes placing ethyl 2-(1-(5-fluoropentyl)-1H-indazole-3-carboxamido)-3,3-dimethylbutanoate (trivial name: 5F-EDMB-PINACA); methyl 2-(1-(5-fluoropentyl)-1H-indole-3-carboxamido)-3,3-dimethylbutanoate (trivial name: 5F-MDMB-PICA); N-(adamantan-1-yl)-1-(4-fluorobenzyl)-1H-indazole-3-carboxamide (trivial names: FUB-AKB48; FUB-APINACA; AKB48 N-(4-fluorobenzyl)); 1-(5-fluoropentyl)-N-(2-phenylpropan-2-yl)-1H-indazole-3-carboxamide (trivial names: 5F-CUMYL-PINACA; SGT-25); and (1-(4-fluorobenzyl)-1H-indol-3-yl)(2,2,3,3-tetramethylcyclopropyl)methanone (trivial name: FUB-144), including their salts, isomers, and salts of isomers whenever the existence of such salts, isomers, and salts of isomers is possible, in schedule I of the Controlled Substances Act. If finalized, this action would make permanent the existing regulatory controls and administrative, civil, and criminal sanctions applicable to schedule I controlled substances on persons who handle (manufacture, distribute, import, export, engage in research, conduct instructional activities or chemical analysis with, or possess) or propose to handle 5F-EDMB-PINACA, 5F-MDMB-PICA, FUB-AKB48, 5F-CUMYL-PINACA and FUB-144.

**DATES:** Comments must be submitted electronically or postmarked on or before April 29, 2021.

Requests for hearing and waivers of an opportunity for a hearing or to participate in a hearing must be received on or before April 29, 2021.

**ADDRESSES:** To ensure proper handling of comments, please reference “Docket No. DEA–491” on all electronic and written correspondence, including any attachments.

• *Electronic comments:* Interested persons may file written comments on this proposal in accordance with 21 CFR 1308.43(g). The Drug Enforcement Administration (DEA) encourages that all comments be submitted

electronically through the Federal eRulemaking Portal, which provides the ability to type short comments directly into the comment field on the web page or attach a file for lengthier comments. Please go to <http://www.regulations.gov> and follow the on-line instructions at that site for submitting comments. Upon completion of your submission, you will receive a Comment Tracking Number. Please be aware that submitted comments are not instantaneously available for public view on <http://www.regulations.gov>. If you have received a Comment Tracking Number, your comment has been submitted successfully, and there is no need to resubmit the same comment. Commenters should be aware that the electronic Federal Docket Management System will not accept comments after 11:59 p.m. Eastern Time on the last day of the comment period.

• *Paper comments:* Paper comments that duplicate electronic submissions are not necessary and are discouraged. Should you wish to mail a paper comment in lieu of an electronic comment, send via regular or express mail to: Drug Enforcement Administration, Attn: DEA Federal Register Representative/DPW, 8701 Morrisette Drive, Springfield, Virginia 22152.

• *Hearing requests:* All requests for a hearing and waivers of participation, together with a written statement of position on the matters of fact and law asserted in the hearing, must be sent to: Drug Enforcement Administration, Attn: Administrator, 8701 Morrisette Drive, Springfield, Virginia 22152. All requests for hearing and waivers of participation should also be sent to: (1) Drug Enforcement Administration, Attn: Hearing Clerk/OALJ, 8701 Morrisette Drive, Springfield, Virginia 22152; and (2) Drug Enforcement Administration, Attn: DEA Federal Register Representative/DPW 8701 Morrisette Drive, Springfield, Virginia 22152.

**FOR FURTHER INFORMATION CONTACT:** Terrence L. Boos, Drug and Chemical Evaluation Section, Drug Enforcement Administration; Telephone: (571) 362–3249.

#### SUPPLEMENTARY INFORMATION:

##### Posting of Public Comments

Please note that all comments received in response to this docket are considered part of the public record. They will, unless reasonable cause is given, be made available by the Drug Enforcement Administration (DEA) for public inspection online at <http://www.regulations.gov>. Such information includes personal identifying