

their aggregate amount reported at least quarterly to the institution's board of directors. (See additional reporting requirements described under "Exceptions to the General Policy.")

The aggregate amount of all loans in excess of the supervisory loan-to-value limits should not exceed 100 percent of total capital.⁴ Moreover, within the aggregate limit, total loans for all commercial, agricultural, multifamily or other non-1-to-4 family residential properties should not exceed 30 percent of total capital. An institution will come under increased supervisory scrutiny as the total of such loans approaches these levels.

In determining the aggregate amount of such loans, institutions should: (a) Include all loans secured by the same property if any one of those loans exceeds the supervisory loan-to-value limits; and (b) include the recourse obligation of any such loan sold with recourse. Conversely, a loan should no longer be reported to the directors as part of aggregate totals when reduction in principal or senior liens, or additional contribution of collateral or equity (e.g., improvements to the real property securing the loan), bring the loan-to-value ratio into compliance with supervisory limits.

* * * * *

Federal Deposit Insurance Corporation.

By order of the Board of Directors.

Dated at Washington, DC, on June 15, 2021.

James P. Sheesley,

Assistant Executive Secretary.

[FR Doc. 2021-12973 Filed 6-24-21; 8:45 am]

BILLING CODE 6714-01-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2021-0451; Project Identifier AD-2021-00007-T]

RIN 2120-AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to supersede Airworthiness Directive (AD) 2019-01-08, which applies to certain The Boeing Company Model 777-200,

⁴ For the purposes of these Guidelines, for state non-member banks and state savings associations, "total capital" refers to the FDIC-supervised institution's tier 1 capital, as defined in § 324.2 of this chapter, plus the allowance for loan and leases losses or the allowance for credit losses attributable to loans and leases, as applicable. The allowance for credit losses attributable to loans and leases is applicable for institutions that have adopted the Current Expected Credit Losses methodology.

-200LR, -300, and -300ER series airplanes. AD 2019-01-08 requires modifications for galley mounted attendant seat fittings. Since the FAA issued AD 2019-01-08, the FAA determined that additional airplanes are subject to the unsafe condition. This proposed AD would retain the requirements of AD 2019-01-18 and expand the applicability to include additional airplanes. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD August 9, 2021.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202-493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.
- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; internet <https://www.myboeingfleet.com>. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0451.

Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0451; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above.

FOR FURTHER INFORMATION CONTACT: Brandon Lucero, Aerospace Engineer, Cabin Safety and Environmental Systems Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-

231-3569; email: brandon.lucero@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include "Docket No. FAA-2021-0451; Project Identifier AD-2021-00007-T" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend the proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this proposed AD.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Brandon Lucero, Aerospace Engineer, Cabin Safety and Environmental Systems Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3569; email: brandon.lucero@faa.gov. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

The FAA issued AD 2019-01-08, Amendment 39-19547 (84 FR 4318,

February 15, 2019) (AD 2019–01–08), for certain The Boeing Company Model 777–200, –200LR, –300, and –300ER series airplanes. AD 2019–01–08 was prompted by a report that showed non-compliance exists on some in-service galley mounted attendant seat fitting installations. AD 2019–01–08 requires modifications for galley mounted attendant seat fittings. The agency issued AD 2019–01–08 to address non-compliant flight attendant seats, which could fail in a high-G crash and result in potential injury to flight attendants and consequent inability of the flight attendants to assist with passenger evacuation in a timely manner.

Actions Since AD 2019–01–08 Was Issued

Since the FAA issued AD 2019–01–08, an operator reported that line numbers (L/Ns) 413, 421, 424, 425, 426, and 439, which are equipped with galley part number (P/N) 1013G42A00000 (one of the affected part numbers identified in Boeing Special Attention Service Bulletin 777–25–0649, Revision 1, dated October 6, 2017) were not included in AD 2019–01–08. A subsequent investigation by Boeing determined that L/Ns 1111,

1115, and 1137 were also missing from the effectivity of Boeing Special Attention Service Bulletin 777–25–0649, Revision 1, dated October 6, 2017, and therefore not included in the applicability of AD 2019–01–08.

FAA’s Determination

The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop on other products of the same type design.

Related Service Information Under 1 CFR Part 51

The FAA reviewed Boeing Special Attention Service Bulletin 777–25–0649, Revision 2, dated October 8, 2020. This service information specifies procedures for modifying galley mounted attendant seat fittings. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

Proposed AD Requirements in This NPRM

Although this proposed AD does not explicitly restate the requirements of AD

2019–01–08, this proposed AD would retain all of the requirements of AD 2019–01–08. Those requirements are referenced in the service information identified previously, which, in turn, is referenced in paragraph (g) of this proposed AD. This proposed AD would add airplanes to the applicability. This proposed AD would also require accomplishment of the actions identified as “RC” (required for compliance) in the Accomplishment Instructions of Boeing Special Attention Service Bulletin 777–25–0649, Revision 2, dated October 8, 2020, described previously.

For information on the procedures and compliance times, see this service information at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2021–0451.

Costs of Compliance

The FAA estimates that this AD, if adopted as proposed, would affect 50 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS

| Action | Labor cost | Parts cost | Cost per product | Cost on U.S. operators |
|--------------------|--------------------------------------------|------------|------------------|------------------------|
| Modification | 7 work-hours × \$85 per hour = \$595 | \$0 | \$595 | \$29,750 |

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, Section 106, describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701, General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism

implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that the proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator,

the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by:
 - a. Removing Airworthiness Directive 2019–01–08, Amendment 39–19547 (84 FR 4318, February 15, 2019), and
 - b. Adding the following new airworthiness directive:

The Boeing Company: Docket No. FAA–2021–0451; Project Identifier AD–2021–00007–T.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) action by August 9, 2021.

(b) Affected ADs

This AD replaces AD 2019–01–08, Amendment 39–19547 (84 FR 4318, February 15, 2019) (AD 2019–01–08).

(c) Applicability

This AD applies to The Boeing Company Model 777-200, -200LR, -300, and -300ER series airplanes, certificated in any category, as identified in Boeing Special Attention Service Bulletin 777-25-0649, Revision 2, dated October 8, 2020.

(d) Subject

Air Transport Association (ATA) of America Code 25, Equipment/furnishings.

(e) Unsafe Condition

This AD was prompted by a report that showed a non-compliance exists on some in-service galley attendant seat fitting installations, and a determination that additional airplanes are subject to the unsafe condition. The FAA is issuing this AD to address non-compliant flight attendant seats, which could fail in a high-G crash and result in potential injury to flight attendants and consequent inability of the flight attendants to assist with passenger evacuation in a timely manner.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

Except as specified by paragraph (h) of this AD: At the applicable times specified in paragraph 1.E., "Compliance," of Boeing Special Attention Service Bulletin 777-25-0649, Revision 2, dated October 8, 2020, do all applicable actions identified as "RC" (required for compliance) in, and in accordance with, the Accomplishment Instructions of Boeing Special Attention Service Bulletin 777-25-0649, Revision 2, dated October 8, 2020.

(h) Exception to Service Information Specifications

Where Boeing Special Attention Service Bulletin 777-25-0649, Revision 2, dated October 8, 2020, uses the phrase "the Revision 2 date of this service bulletin," this AD requires using "the effective date of this AD."

(i) No Reporting Requirement

Although the service information referenced in Boeing Special Attention Service Bulletin 777-25-0649, Revision 2, dated October 8, 2020, specifies to submit certain information to the manufacturer, this AD does not include that requirement.

(j) Credit for Previous Actions

This paragraph provides credit for the actions specified in paragraph (g) of this AD, if those actions were performed before the effective date of this AD using Boeing Special Attention Service Bulletin 777-25-0649, Revision 1, dated October 6, 2017 (which is incorporated by reference in AD 2019-01-08).

(k) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with

14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in Related Information. Information may be emailed to: 9-ANM-Seattle-ACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) AMOCs approved for AD 2019-01-08 are approved as AMOCs for the corresponding provisions of Boeing Special Attention Service Bulletin 777-25-0649, Revision 2, dated October 8, 2020, that are required by paragraph (g) of this AD.

(5) For service information that contains steps that are labeled as Required for Compliance (RC), the provisions of paragraphs (k)(5)(i) and (ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. If a step or substep is labeled "RC Exempt," then the RC requirement is removed from that step or substep. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

(l) Related Information

(1) For more information about this AD, contact Brandon Lucero, Aerospace Engineer, Cabin Safety and Environmental Systems Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3569; email: brandon.lucero@faa.gov.

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued on May 28, 2021.

Gaetano A. Sciortino,

Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2021-13407 Filed 6-24-21; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2021-0502; Project Identifier 2018-CE-043-AD]

RIN 2120-AA64

Airworthiness Directives; B-N Group Ltd. Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain B-N Group Ltd. Models BN-2, BN-2A, BN-2A-2, BN-2A-3, BN-2A-6, BN-2A-8, BN-2A-9, BN-2A-20, BN-2A-21, BN-2A-26, BN-2A-27, BN-2B-20, BN-2B-21, BN-2B-26, BN-2B-27, BN-2T, and BN-2T-4R airplanes. This proposed AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI identifies the unsafe condition as failure of the rudder final drive rod because of cracks in the region of the taper pins. This proposed AD would require repetitively inspecting the rudder final drive rod assembly and replacing the rudder final drive assembly, if necessary. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by August 9, 2021.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* (202) 493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.