

provided by the construction of the fuel tank and/or other surrounding features.

The proposed special conditions contain the additional safety standards that the Administrator considers necessary to establish a level of safety equivalent to that established by the existing airworthiness standards.

Applicability

As discussed above, these special conditions are applicable to the Airbus Model A321NeoXLR airplane. Should Airbus apply at a later date for a change to the type certificate to include another model incorporating the same novel or unusual design feature, these special conditions would apply to that model as well.

Conclusion

This action affects only a certain novel or unusual design feature on one model of airplane. It is not a rule of general applicability.

List of Subjects in 14 CFR Part 25

Aircraft, Aviation safety, Reporting and recordkeeping requirements.

Authority Citation

The authority citation for these special conditions is as follows:

Authority: 49 U.S.C. 106(f), 106(g), 40113, 44701, 44702, 44704.

The Proposed Special Conditions

The Federal Aviation Administration (FAA) proposes the following special conditions as part of the type certification basis for Airbus Model A321NeoXLR airplanes.

Passenger Protection From External Fire

The lower half of the fuselage, spanning the longitudinal location of the rear center fuel tank, must be resistant to fire penetration.

Issued in Kansas City, Missouri, on April 1, 2022.

Patrick R. Mullen,

Manager, Technical Innovation Policy Branch, Policy and Innovation Division, Aircraft Certification Service.

[FR Doc. 2022-07228 Filed 4-5-22; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2022-0394; Project Identifier MCAI-2021-00904-T]

RIN 2120-AA64

Airworthiness Directives; De Havilland Aircraft of Canada Limited (Type Certificate Previously Held by Bombardier, Inc.) Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain De Havilland Aircraft of Canada Limited Model DHC-8-401 and -402 airplanes. This proposed AD was prompted by reports of nose wheel steering (NWS) hydraulic motors jamming during pushback or towing. This proposed AD would require doing an inspection to determine the part number and serial number of the NWS hydraulic motor, and re-identifying or replacing the NWS hydraulic motor if necessary. This proposed AD would also prohibit the installation of certain NWS hydraulic motors. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by May 23, 2022.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202-493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.
- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact De Havilland Aircraft of Canada Limited, Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416-375-4000; fax 416-375-4539; email thd@dehavilland.com; internet <https://dehavilland.com>. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South

216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0394; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above.

FOR FURTHER INFORMATION CONTACT: Elizabeth Dowling, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531; email 9-avs-nyaco-cos@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include "Docket No. FAA-2022-0394; Project Identifier MCAI-2021-00904-T" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend the proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI

as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Elizabeth Dowling, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7300; fax 516–794–5531; email 9-avs-nyaco-cos@faa.gov. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued TCCA AD CF–2021–28, dated August 5, 2021 (also referred to after this as the Mandatory Continuing Airworthiness Information, or the MCAI), to correct an unsafe condition for certain De Havilland Aircraft of Canada Limited Model DHC–8–401 and –402 airplanes. You may examine the MCAI in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2022–0394.

This proposed AD was prompted by reports of NWS hydraulic motors

jamming during pushback or towing caused by worn out piston rod shoes. An investigation revealed that a design change had been introduced by the hydraulic motor supplier that corrected this condition but this change was not documented. Thereby, resulting in a loss of configuration control for this component. The FAA is proposing this AD to address a possible NWS hydraulic motor jam, which could lead to a runway excursion and loss of controllability of the airplane. See the MCAI for additional background information.

Related Service Information Under 1 CFR Part 51

De Havilland Aircraft of Canada Limited has issued Service Bulletin 84–32–164, Revision A, dated May 13, 2021. This service information describes procedures for doing an inspection to determine the part number and serial number of the NWS hydraulic motor, and re-identifying, the redesigned NWS hydraulic motor, or replacing, the original NWS hydraulic motor, as necessary.

This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

FAA’s Determination

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to the FAA’s bilateral agreement with the State of Design Authority, the FAA has been notified of the unsafe condition described in the MCAI and service information referenced above. The FAA is proposing this AD because the FAA evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop on other products of the same type design.

Proposed AD Requirements in This NPRM

This proposed AD would require accomplishing the actions specified in the service information already described. This proposed AD would also prohibit the installation of certain NWS hydraulic motors.

Costs of Compliance

The FAA estimates that this AD, if adopted as proposed, would affect 52 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Up to 11 work-hours × \$85 per hour = \$935	\$80	Up to \$1,015	Up to \$52,780.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

De Havilland Aircraft of Canada Limited (Type Certificate Previously Held by Bombardier, Inc.): Docket No. FAA–

2022-0394; Project Identifier MCAI-2021-00904-T.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by May 23, 2022.

(b) Affected ADs

None.

(c) Applicability

This AD applies to De Havilland Aircraft of Canada Limited Model DHC-8-401 and -402 airplanes, certificated in any category, serial numbers 4001 and 4003 through 4622 inclusive.

(d) Subject

Air Transport Association (ATA) of America Code 32, Landing gear.

(e) Unsafe Condition

This AD was prompted by reports of nose wheel steering (NWS) hydraulic motors jamming during pushback or towing caused by worn out piston rod shoes. The FAA is issuing this AD to address a possible NWS hydraulic motor jam, which could lead to a runway excursion and loss of controllability of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

Within 12,000 flight hours or 72 months, whichever occurs first, after the effective date of this AD: Inspect to determine the part number and serial number of the NWS hydraulic motor, and re-identify or replace the NWS hydraulic motor, as applicable, in accordance with paragraph 3.B. of the Accomplishment Instructions of De Havilland Aircraft of Canada Service Bulletin 84-32-164, Revision A, dated May 13, 2021.

(h) Parts Installation Prohibition

As of the effective date of this AD, no person may install a NWS hydraulic motor, part number (P/N) RS1267-1, P/N RS1267-1 MOD SB 32-13, P/N RS1267-2, P/N RS1267-2 MOD SB 32-13, and P/N RS1267-3, on any airplane.

(i) No Return of Parts

Although De Havilland Aircraft of Canada Service Bulletin 84-32-164, Revision A, dated May 13, 2021, specifies to return certain parts to the manufacturer, this AD does not include that requirement.

(j) Credit for Previous Actions

This paragraph provides credit for actions required by paragraph (g) of this AD, if those actions were performed before the effective date of this AD using De Havilland Aircraft of Canada Limited Service Bulletin 84-32-164, dated April 20, 2020.

(k) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York ACO

Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation (TCCA); or De Havilland Aircraft of Canada Limited's TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

(l) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) TCCA AD CF-2021-28, dated August 5, 2021, for related information. This MCAI may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0394.

(2) For more information about this AD, contact Elizabeth Dowling, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531; email 9-avs-nyaco-cos@faa.gov.

(3) For service information identified in this AD, contact De Havilland Aircraft of Canada Limited, Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416-375-4000; fax 416-375-4539; email thd@dehavilland.com; internet <https://dehavilland.com>. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued on March 31, 2022.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.
[FR Doc. 2022-07159 Filed 4-5-22; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2022-0393; Project Identifier MCAI-2021-01249-T]

RIN 2120-AA64

Airworthiness Directives; Airbus Canada Limited Partnership (Type Certificate Previously Held by C Series Aircraft Limited Partnership (CSALP); Bombardier, Inc.) Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain Airbus Canada Limited Partnership Model BD-500-1A10 and BD-500-1A11 airplanes. This proposed AD was prompted by the discovery that overwing emergency exit door (OWEED) handle covers were difficult to open on some airplanes. This proposed AD would require replacing the existing OWEED handle cover brackets with newly designed OWEED handle cover brackets and the installation of a placard regarding this replacement, as specified in Transport Canada Civil Aviation (TCCA) AD, which is proposed for incorporation by reference. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by May 23, 2022.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For material that will be incorporated by reference (IBR) in this AD, contact TCCA, Transport Canada National Aircraft Certification, 159 Cleopatra Drive, Nepean, Ontario K1A 0N5, Canada; telephone 888-663-3639; email AD-CN@tc.gc.ca; internet <https://tc.canada.ca/en/aviation>. You may view this material at the FAA, Airworthiness Products Section, Operational Safety