

2022-0394; Project Identifier MCAI-2021-00904-T.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by May 23, 2022.

(b) Affected ADs

None.

(c) Applicability

This AD applies to De Havilland Aircraft of Canada Limited Model DHC-8-401 and -402 airplanes, certificated in any category, serial numbers 4001 and 4003 through 4622 inclusive.

(d) Subject

Air Transport Association (ATA) of America Code 32, Landing gear.

(e) Unsafe Condition

This AD was prompted by reports of nose wheel steering (NWS) hydraulic motors jamming during pushback or towing caused by worn out piston rod shoes. The FAA is issuing this AD to address a possible NWS hydraulic motor jam, which could lead to a runway excursion and loss of controllability of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

Within 12,000 flight hours or 72 months, whichever occurs first, after the effective date of this AD: Inspect to determine the part number and serial number of the NWS hydraulic motor, and re-identify or replace the NWS hydraulic motor, as applicable, in accordance with paragraph 3.B. of the Accomplishment Instructions of De Havilland Aircraft of Canada Service Bulletin 84-32-164, Revision A, dated May 13, 2021.

(h) Parts Installation Prohibition

As of the effective date of this AD, no person may install a NWS hydraulic motor, part number (P/N) RS1267-1, P/N RS1267-1 MOD SB 32-13, P/N RS1267-2, P/N RS1267-2 MOD SB 32-13, and P/N RS1267-3, on any airplane.

(i) No Return of Parts

Although De Havilland Aircraft of Canada Service Bulletin 84-32-164, Revision A, dated May 13, 2021, specifies to return certain parts to the manufacturer, this AD does not include that requirement.

(j) Credit for Previous Actions

This paragraph provides credit for actions required by paragraph (g) of this AD, if those actions were performed before the effective date of this AD using De Havilland Aircraft of Canada Limited Service Bulletin 84-32-164, dated April 20, 2020.

(k) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York ACO

Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation (TCCA); or De Havilland Aircraft of Canada Limited's TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

(l) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) TCCA AD CF-2021-28, dated August 5, 2021, for related information. This MCAI may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0394.

(2) For more information about this AD, contact Elizabeth Dowling, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531; email 9-avs-nyaco-cos@faa.gov.

(3) For service information identified in this AD, contact De Havilland Aircraft of Canada Limited, Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416-375-4000; fax 416-375-4539; email thd@dehavilland.com; internet <https://dehavilland.com>. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued on March 31, 2022.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.
[FR Doc. 2022-07159 Filed 4-5-22; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2022-0393; Project Identifier MCAI-2021-01249-T]

RIN 2120-AA64

Airworthiness Directives; Airbus Canada Limited Partnership (Type Certificate Previously Held by C Series Aircraft Limited Partnership (CSALP); Bombardier, Inc.) Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain Airbus Canada Limited Partnership Model BD-500-1A10 and BD-500-1A11 airplanes. This proposed AD was prompted by the discovery that overwing emergency exit door (OWEED) handle covers were difficult to open on some airplanes. This proposed AD would require replacing the existing OWEED handle cover brackets with newly designed OWEED handle cover brackets and the installation of a placard regarding this replacement, as specified in Transport Canada Civil Aviation (TCCA) AD, which is proposed for incorporation by reference. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by May 23, 2022.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For material that will be incorporated by reference (IBR) in this AD, contact TCCA, Transport Canada National Aircraft Certification, 159 Cleopatra Drive, Nepean, Ontario K1A 0N5, Canada; telephone 888-663-3639; email AD-CN@tc.gc.ca; internet <https://tc.canada.ca/en/aviation>. You may view this material at the FAA, Airworthiness Products Section, Operational Safety

Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0393.

Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0393; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

FOR FURTHER INFORMATION CONTACT:

Gabriel Kim, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 201-674-2367; email Gabriel.D.Kim@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include "Docket No. FAA-2022-0393; Project Identifier MCAI-2021-01249-T" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial

information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Gabriel Kim, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 201-674-2367; email Gabriel.D.Kim@faa.gov. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

The TCCA, which is the aviation authority for Canada, has issued TCCA AD CF-2021-39, dated November 10, 2021 (TCCA AD CF-2021-39) (also referred to as the MCAI), to correct an unsafe condition for certain Airbus Canada Limited Partnership Models BD-500-1A10 and BD-500-1A11 airplanes.

This proposed AD was prompted by the discovery that overwing emergency exit door (OWEED) handle covers were difficult to open on some airplanes. An investigation revealed that brackets of certain OWEED handle covers are prone to flexure, thus increasing the force necessary to remove the OWEED handle cover beyond design requirements. As a result, the OWEED handle covers must be removed in order to access the emergency exit, which could delay passenger evacuation. The FAA is proposing this AD to address the increased force necessary to remove the OWEED handle cover to access the emergency exit, which could hinder passenger evacuation in emergency. See the MCAI for additional background information.

Related Service Information Under 1 CFR Part 51

TCCA AD CF-2021-39 specifies procedures for replacing the existing OWEED handle cover brackets with newly designed OWEED handle cover brackets and also instructions for installing a placard regarding this replacement. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

FAA's Determination

This product has been approved by the aviation authority of another country and is approved for operation in the United States. Pursuant to the FAA's bilateral agreement with the State of Design Authority, it has notified the FAA of the unsafe condition described in the MCAI referenced above. The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop in other products of the same type design.

Proposed AD Requirements in This NPRM

This proposed AD would require accomplishing the actions specified in TCCA AD CF-2021-39 described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD.

Explanation of Required Compliance Information

In the FAA's ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, the FAA proposes to incorporate TCCA AD CF-2021-39 by reference in the FAA final rule. This proposed AD would, therefore require compliance with TCCA AD CF-2021-39 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in TCCA AD CF-2021-39 does not mean that operators need comply only with that section. For example, where the AD requirement refers to "all required actions and compliance times," compliance with this AD requirement is not limited to the section titled "Required Action(s) and Compliance Time(s)" in TCCA AD CF-2021-39. Service information required by TCCA AD CF-2021-39 for compliance will be available at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0393 after the FAA final rule is published.

Costs of Compliance

The FAA estimates that this proposed AD would affect 21 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
3 work-hours × \$85 per hour = \$255	\$40	\$295	\$6,195

According to the manufacturer, some or all of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected individuals. The FAA does not control warranty coverage for affected individuals. As a result, the FAA has included all known costs in the cost estimate.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

Airbus Canada Limited Partnership (Type Certificate Previously Held by C Series Aircraft Limited Partnership (CSALP); Bombardier, Inc.): Docket No. FAA–2022–0393; Project Identifier MCAI–2021–01249–T.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by May 23, 2022.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Airbus Canada Limited Partnership (Type Certificate Previously Held by C Series Aircraft Limited Partnership (CSALP); Bombardier, Inc.) Model BD–500–1A10 and BD–500–1A11 airplanes, certificated in any category, as identified in Transport Canada Civil Aviation (TCCA) AD CF–2021–39, dated November 10, 2021 (TCCA AD CF–2021–39).

(d) Subject

Air Transport Association (ATA) of America Code 52, Doors.

(e) Unsafe Condition

This AD was prompted by discovery that overwing emergency exit door (OWEED) handle covers were difficult to open on some airplanes. An investigation revealed that brackets of certain OWEED handle covers are prone to flexure, thus increasing the force necessary to remove the OWEED handle cover beyond design requirements. The FAA is proposing this AD to address the increased force necessary to remove the OWEED handle cover to access the emergency exit, which could hinder passenger evacuation in an emergency.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, TCCA AD CF–2021–39.

(h) Exception to TCCA AD CF–2021–39

Where TCCA AD CF–2021–39 refers to its effective date, this AD requires using the effective date of this AD.

(i) Additional AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7300. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or TCCA; or Airbus Canada Limited Partnership's TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

(j) Related Information

(1) For TCCA AD CF–2021–39, contact TCCA, Transport Canada National Aircraft Certification, 159 Cleopatra Drive, Nepean, Ontario K1A 0N5, Canada; telephone 888–663–3639; email AD-CN@tc.gc.ca; internet <https://tc.canada.ca/en/aviation>. You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. This material may be found in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2022–0393.

(2) For more information about this AD, contact Gabriel Kim, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO

Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 201-674-2367; email Gabriel.D.Kim@faa.gov.

Issued on March 31, 2022.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2022-07161 Filed 4-5-22; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2022-0395; Project Identifier MCAI-2021-01048-T]

RIN 2120-AA64

Airworthiness Directives; ATR-GIE Avions de Transport Régional Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to supersede Airworthiness Directive (AD) 2018-18-05, which applies to all ATR-GIE Avions de Transport Régional Model ATR42-200, -300, and -320 airplanes; and AD 2020-09-16, which applies to all ATR-GIE Avions de Transport Régional Model ATR42-200, -300, and -320 airplanes. AD 2018-18-05 and AD 2020-09-16 require revising the existing maintenance or inspection program, as applicable, to incorporate new or more restrictive airworthiness limitations. Since the FAA issued AD 2018-18-05 and AD 2020-09-16, the FAA has determined that new or more restrictive airworthiness limitations are necessary. This proposed AD would retain the requirements of AD 2020-09-16. This proposed AD would also require revising the existing maintenance or inspection program, as applicable, to incorporate new or more restrictive airworthiness limitations, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by May 23, 2022.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov> Follow the instructions for submitting comments..

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For material that will be incorporated by reference (IBR) in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find this IBR material on the EASA website at <https://ad.easa.europa.eu>. You may view this IBR material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0395.

Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0395; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

FOR FURTHER INFORMATION CONTACT:

Shahram Daneshmandi, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone 206-231-3220; email shahram.daneshmandi@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include "Docket No. FAA-2022-0395; Project Identifier MCAI-2021-01048-T" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider

all comments received by the closing date and may amend the proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Shahram Daneshmandi, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone 206-231-3220; email shahram.daneshmandi@faa.gov. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

The FAA issued AD 2018-18-05, Amendment 39-19384 (83 FR 44463, August 31, 2018) (AD 2018-18-05), which applies to certain ATR-GIE Avions de Transport Régional Model ATR42-200, -300, and -320 airplanes. AD 2018-18-05 requires revising the existing maintenance or inspection program, as applicable, to incorporate new or more restrictive maintenance requirements and airworthiness limitations. The FAA issued AD 2018-18-05 to prevent reduced structural integrity of the airplane.

The FAA also issued AD 2020-09-16, Amendment 39-19912 (85 FR 29596, May 18, 2020) (AD 2020-09-16), which applies to all ATR-GIE Avions de Transport Régional Model ATR42-200, -300, and -320 airplanes. AD 2020-09-