

purpose, by other means available to the consumer reporting agency.

(2) *Contents.* The notice must include the following:

(i) A statement that the review of the submission is completed;

(ii) A statement of the outcome of the review of the submission, including the reason(s) if the consumer reporting agency declined or rescinded to block the requested adverse information under paragraph (d) of this section;

(iii) A consumer report, provided at no cost to the consumer, that is based upon the consumer's revised file (if applicable) as a result of the consumer's submission;

(iv) A description of the procedure used to determine the outcome;

(v) A method for contacting the consumer reporting agency to appeal the determination or revise the submission to cure any of the noted reasons for declining to block the requested adverse information; and

(vi) The web page consumers can use to submit complaints to the Consumer Financial Protection Bureau.

(g) *Record retention.* For a period of seven years after the date the submission by the consumer is received under paragraph (d)(2) of this section, a consumer reporting agency must retain evidence of all such submissions, including the actions taken by the consumer reporting agency, reasons for declining or rescinding the block requests, and compliance with this section.

(h) *Policies and procedures to ensure and maintain compliance.* A consumer reporting agency must establish and maintain written policies and procedures reasonably designed to ensure and monitor the compliance of the consumer reporting agency and its employees with the requirements of paragraphs in this section. These written policies and procedures must be appropriate to the nature, size, complexity, and scope of the activities of the consumer reporting agency and its employees.

**Rohit Chopra,**

*Director, Consumer Financial Protection Bureau.*

[FR Doc. 2022-07528 Filed 4-7-22; 8:45 am]

**BILLING CODE P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2022-0450; Project Identifier MCAI-2021-00854-A]

RIN 2120-AA64

#### Airworthiness Directives; Diamond Aircraft Industries Inc. Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for all Diamond Aircraft Industries Inc. Model DA 40, DA 40 F, and DA 40 NG airplanes. This proposed AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as baggage nets installed with defective buckles, which may result in failure of the baggage net to restrain the baggage or cargo, which could lead to injury to the occupants in the case of an emergency landing. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by May 23, 2022.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* (202) 493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Diamond Aircraft Industries Inc., Att: Thit Tun, 1560 Crumlin Road, London, N5V 1S2, Canada; phone: (519) 457-4000; email: [T.Tun@diamondaircraft.com](mailto:T.Tun@diamondaircraft.com). You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 901 Locust, Kansas City, MO 64106. For information on the availability of this material at the FAA, call (817) 222-5110.

### Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0450; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the MCAI, any comments received, and other information. The street address for Docket Operations is listed above.

#### FOR FURTHER INFORMATION CONTACT:

Chirayu Gupta, Aviation Safety Engineer, New York ACO Branch, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: (516) 228-7300; email: [Chirayu.A.Gupta@faa.gov](mailto:Chirayu.A.Gupta@faa.gov).

#### SUPPLEMENTARY INFORMATION:

#### Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2022-0450; Project Identifier MCAI-2021-00854-A" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

#### Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this AD.

Submissions containing CBI should be sent to Chirayu Gupta, Aviation Safety Engineer, New York ACO Branch, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

**Background**

Transport Canada, which is the aviation authority for Canada, has issued Transport Canada AD CF-2021-24, dated July 21, 2021 (referred to after this as “the MCAI”), to correct an unsafe condition on all Diamond Aircraft Industries Inc. Model DA 40, DA 40 D, DA 40 F, DA 40 NG, and DA 62 airplanes. The MCAI states:

Diamond Aircraft Industries Inc. (DAI) has received reports of defective buckles installed as part of the baggage nets on DA 40 NG and DA 62 aeroplanes. An investigation revealed a quality escape in the manufacturing of the Quick Fix Baggage Net Assembly, part number (P/N) D44-2550-90-00 and P/N D67-2550-90-00\_02, by the supplier. P/N D44-2550-90-00 baggage nets can also be installed on DA 40, DA 40 D and DA 40 F aeroplanes. The baggage nets installed with defective buckles may not maintain sufficient holding force to restrain the baggage or cargo that is carried in the same compartment as passengers, and consequently, may not provide adequate means to protect the passengers from injury.

This condition, if not corrected, could result in the failure of the baggage net to restrain the baggage or cargo, which could lead to injury to the occupants in the case of an emergency landing.

DAI undertook a voluntary campaign to replace all defective Quick Fix Baggage Net Assemblies. However, DAI was unable to

complete the campaign in its entirety, and therefore, a number of aeroplanes with defective baggage nets that have not yet been replaced, remain in operation.

As a result, DAI issued Mandatory Service Bulletin (MSB) 40-093, MSB D4-110, MSB F4-039, MSB 40NG-065 and MSB 62-028, providing accomplishment instructions to replace the defective Quick Fix Baggage Net Assemblies.

This [Transport Canada] AD mandates the removal and replacement of the affected baggage nets. This [Transport Canada] AD also renders any affected baggage nets not eligible for installation as a replacement part on DA 40, DA 40 D, DA 40 F, DA 40 NG and DA 62 aeroplanes.

You may examine the MCAI in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0450.

**FAA’s Determination and Requirements of the Proposed AD**

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to the FAA’s bilateral agreement with this State of Design Authority, it has notified the FAA of the unsafe condition described in the MCAI and service information referenced above. The FAA is issuing this NPRM after determining the unsafe condition described previously is likely to exist or develop on other products of the same type design.

**Related Service Information Under 1 CFR Part 51**

The FAA reviewed the following service information issued by Diamond

Aircraft Industries, which specify procedures for identifying, removing, and replacing the affected baggage nets.

- Mandatory Service Bulletin No. MSB 40-093, Rev. 0, dated July 6, 2021.
- Mandatory Service Bulletin No. MSB F4-039, Rev. 0, dated July 6, 2021.
- Mandatory Service Bulletin No. MSB 40NG-065, Rev. 1, dated July 6, 2021.

These documents are distinct since they apply to different airplane models.

This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

**Differences Between This Proposed AD and the MCAI or Service Information**

The MCAI applies to Diamond Aircraft Industries Inc. Model DA 40, DA 40 D, DA 40 F, DA 40 NG, and DA 62 airplanes. This proposed AD would not apply to Model DA 62 airplanes. The FAA plans to address Model DA 62 airplanes in future rulemaking.

In addition, the MCAI applies to the Model DA 40 D airplane and this proposed AD would not because it does not have an FAA type certificate.

**Costs of Compliance**

The FAA estimates that this AD, if adopted as proposed, would affect 800 airplanes of U.S. registry.

The FAA estimates the following costs to comply with this proposed AD:

**ESTIMATED COSTS**

Action	Labor cost	Parts cost	Cost per airplane	Cost on U.S. operators
Replace Model DA 40, DA 40 F, and DA 40 NG baggage net.	0.25 work-hour × \$85 per hour = \$21.25 .....	\$382	\$403.25	\$322,600

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing

regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or

on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**Diamond Aircraft Industries Inc.:** Docket No. FAA–2022–0450; Project Identifier MCAI–2021–00854–A.

**(a) Comments Due Date**

The FAA must receive comments on this airworthiness directive (AD) by May 23, 2022.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to Diamond Aircraft Industries Inc. Model DA 40, DA 40 F, and DA 40 NG airplanes (including Model DA 40 D airplanes that have been converted to Model DA 40 NG), all serial numbers, certificated in any category.

**(d) Subject**

Joint Aircraft System Component (JASC) Code 2550, Cargo Compartments.

**(e) Unsafe Condition**

This AD was prompted by mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as baggage nets installed with defective buckles. The FAA is issuing this AD to prevent failure of the baggage net to restrain the baggage or cargo. This unsafe condition, if not corrected, could result in injury to occupants in the case of an emergency landing.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Definition**

The following are “affected baggage nets” for purposes of this AD:

- (1) Quick fix baggage net assembly part number (P/N) D44–2550–90–00 with a date of manufacture of December 2015, November 2016, or March 2017; and
- (2) Quick fix baggage net assembly P/N D67–2550–90–00\_02 with a date of manufacture of June 2016.

**(h) Required Actions**

(1) Within 12 months after the effective date of this AD or within 50 hours time-in-service (TIS) after the effective date of this AD, whichever occurs first, inspect each baggage net to determine whether an affected baggage net is installed on your airplane.

**Note to paragraph (h)(1):** The date of manufacture is located on the label with the abbreviation “DMF.”

(i) If an affected baggage net is installed, before further flight, remove the baggage net from service.

(ii) Before the next flight carrying baggage or cargo in the baggage compartment, install a baggage net that is not an affected baggage net in accordance with Figure 1 of the Accomplishment Instructions in the applicable service information in paragraph (i) of this AD.

(2) As of the effective date of this AD, do not install an affected baggage net on any airplane.

**(i) Service Information**

(1) Diamond Aircraft Industries Mandatory Service Bulletin No. MSB 40–093, Rev. 0, dated July 6, 2021, for Model DA 40 airplanes.

(2) Diamond Aircraft Industries Mandatory Service Bulletin No. MSB F4–039, Rev. 0, dated July 6, 2021, for Model DA 40 F airplanes.

(3) Diamond Aircraft Industries Mandatory Service Bulletin No. MSB 40NG–065, Rev. 1, dated July 6, 2021, for Model DA 40 NG airplanes.

**(j) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (k)(1) of this AD.

(2) For any requirement in this AD to obtain corrective actions from a manufacturer, the action must instead be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation (TCCA); or Diamond Aircraft Industries Inc.’s Design Organization Approval (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

**(k) Related Information**

(1) For more information about this AD, contact Chirayu Gupta, Aviation Safety Engineer, New York ACO Branch, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: (516) 228–7300; email: [chirayu.a.gupta@faa.gov](mailto:chirayu.a.gupta@faa.gov).

(2) Refer to Transport Canada AD CF–2021–24, dated July 21, 2021, for more information. You may examine the Transport Canada AD in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2022–0450.

(3) For service information identified in this AD, contact Diamond Aircraft Industries

Inc., Att: Thit Tun, 1560 Crumlin Road, London, N5V 1S2, Canada; phone: (519) 457–4000; email: [T.Tun@diamondaircraft.com](mailto:T.Tun@diamondaircraft.com). You may view this referenced service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 901 Locust, Kansas City, MO 64106. For information on the availability of this material at the FAA, call (817) 222–5110.

Issued on April 4, 2022.

**Lance T. Gant,**

*Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2022–07527 Filed 4–7–22; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA–2022–0396; Project Identifier MCAI–2021–01050–T]

RIN 2120–AA64

**Airworthiness Directives; ATR—GIE Avions de Transport Régional Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to supersede Airworthiness Directive (AD) 2021–09–13, which applies to certain ATR—GIE Avions de Transport Régional Model ATR42–500 airplanes. AD 2021–09–13 requires revising the existing maintenance or inspection program, as applicable, to incorporate new or more restrictive airworthiness limitations. Since the FAA issued AD 2021–09–13, the FAA has determined that new or more restrictive airworthiness limitations are necessary. This proposed AD would revise the applicability by adding airplanes. This proposed AD would also continue to require the actions in AD 2021–09–13 and require revising the existing maintenance or inspection program, as applicable, to incorporate new or more restrictive airworthiness limitations, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by May 23, 2022.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods: