

specified in paragraph (1) of European Union Aviation Safety Agency (EASA) AD 2022–0083, dated May 11, 2022 (EASA AD 2022–0083).

(2) The owner/operator (pilot) holding at least a private pilot certificate may perform the action required by paragraph (g)(1) of this AD for your engine and must enter compliance with the applicable paragraphs of this AD into the engine maintenance records in accordance with 14 CFR 43.9(a) and 91.417(a)(2)(v). The record must be maintained as required by 14 CFR 91.417, 121.380, or 135.439.

(h) Provisions for Alternative Actions and Intervals

After the actions required by paragraph (g) of this AD have been done, no alternative actions and associated thresholds and intervals, including life limits, are allowed unless they are approved as specified in the provisions of the “Ref Publication” section of EASA AD 2022–0083.

(i) Alternative Methods of Compliance (AMOCs)

The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j) of this AD and email to: ANE-AD-AMOC@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(j) Additional Information

For more information about this AD, contact Kevin Clark, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: (781) 238–7088; email: kevin.m.clark@faa.gov.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) European Union Aviation Safety Agency AD 2022–0083, dated May 11, 2022.

(ii) [Reserved]

(3) For EASA AD 2022–0083, contact EASA, KonradAdenauer-Ufer 3, 50668 Cologne, Germany; phone: +49 221 8999 000; email: ADs@easa.europa.eu. You may find this material on the EASA website at ad.easa.europa.eu.

(4) You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 1200 District Avenue, Burlington, MA 01803. For information on the availability of this material at the FAA, call (817) 222–5110.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email: fr.inspection@nara.gov, or go to: www.archives.gov/federal-register/cfr/ibr-locations.html.

Issued on July 6, 2023.

Michael Linegang,

Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2023–14843 Filed 7–13–23; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2023–1414; Project Identifier MCAI–2023–00438–T]

RIN 2120–AA64

Airworthiness Directives; Airbus SAS Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain Airbus SAS Model A350–941 airplanes. This proposed AD was prompted by a report the axis index washers on the forward and rear main landing gear door hinges were found inverted in production. This proposed AD would require a one-time detailed inspection of the axis index washers for correct installation, and, depending on findings, replacement of the axis index washers, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference (IBR). The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by August 28, 2023.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to regulations.gov. Follow the instructions for submitting comments.

- *Fax:* 202–493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5

p.m., Monday through Friday, except Federal holidays.

AD Docket: You may examine the AD docket at regulations.gov under Docket No. FAA–2023–1414; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

Material Incorporated by Reference:

- For material that is proposed for IBR in this NPRM, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email: ADs@easa.europa.eu; website: easa.europa.eu. You may find this material on the EASA website: ad.easa.europa.eu. It is also available at regulations.gov under Docket No. FAA–2023–1414.

- You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th Street, Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

FOR FURTHER INFORMATION CONTACT: Dat Le, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7317; email: dat.v.le@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA–2023–1414; Project Identifier MCAI–2023–00438–T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to regulations.gov, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and

actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Dat Le, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7317; email: dat.v.le@faa.gov. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2023-0051, dated March 10, 2023 (EASA AD 2023-0051) (also referred to as the MCAI), to correct an unsafe condition for certain Airbus SAS Model A350-941 airplanes. The MCAI states that the forward (#1) and rear (#3) main landing gear door (MLGD) hinge axis index washers were found inverted in production (index washer for forward fitting installed at rear fitting and vice versa). This condition, if not detected and corrected, could lead to reduced structural integrity of the MLGD hinge fittings, possibly resulting in the loss of an

MLGD during flight, and consequent injury to persons on the ground.

The FAA is proposing this AD to address the unsafe condition on these products. You may examine the MCAI in the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2023-1414.

Related Service Information Under 1 CFR Part 51

EASA AD 2023-0051 specifies procedures for a one-time detailed inspection of the MLGD forward and rear hinges for incorrectly installed axis index washers and, depending on findings, replacement of the axis index washers.

This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in ADDRESSES section.

FAA's Determination

This product has been approved by the aviation authority of another country and is approved for operation in the United States. Pursuant to the FAA's bilateral agreement with this State of Design Authority, it has notified the FAA of the unsafe condition described in the MCAI referenced above. The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop in other products of the same type design.

Proposed AD Requirements in This NPRM

This proposed AD would require accomplishing the actions specified in EASA AD 2023-0051 described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD.

Explanation of Required Compliance Information

In the FAA's ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, the FAA proposes to incorporate EASA AD 2023-0051 by reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2023-0051 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in EASA AD 2023-0051 does not mean that operators need comply only with that section. For example, where the AD requirement refers to "all required actions and compliance times," compliance with this AD requirement is not limited to the section titled "Required Action(s) and Compliance Time(s)" in EASA AD 2023-0051. Service information required by EASA AD 2023-0051 for compliance will be available at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2023-1414 after the FAA final rule is published.

Costs of Compliance

The FAA estimates that this AD, if adopted as proposed, would affect 23 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
2.25 work-hours × \$85 per hour = \$192	\$0	\$192	\$4,416

The FAA estimates the following costs to do any necessary on-condition action that would be required based on

the results of any required actions. The FAA has no data to determine the

number of airplanes that might need this on-condition action:

ESTIMATED COSTS OF ON-CONDITION ACTIONS

Labor cost	Parts cost	Cost per product
8.25 work-hours × \$85 per hour = \$702	\$10 per door	\$712

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

Airbus SAS: Docket No. FAA–2023–1414; Project Identifier MCAI–2023–00438–T.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by August 28, 2023.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Airbus SAS Model A350–941 airplanes, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2023–0051, dated March 10, 2023 (EASA AD 2023–0051).

(d) Subject

Air Transport Association (ATA) of America Code: 52, Doors.

(e) Unsafe Condition

This AD was prompted by a report the axis index washers on the forward and rear main landing gear door (MLGD) hinges were found inverted in production. The FAA is issuing this AD to address incorrectly installed washers. The unsafe condition, if not addressed, could result in reduced structural integrity of the MLGD hinge fittings, possibly resulting in a loss of an MLGD during flight, and consequent injury to persons on the ground.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2023–0051.

(h) Exceptions to EASA AD 2023–0051

- (1) Where the applicability and Groups definitions of EASA AD 2023–0051 refer to serial numbers, replace the text "the SB" with "Airbus Service Bulletin A350–52–P048, dated November 24, 2022."
- (2) This AD does not adopt the "Remarks" section of EASA AD 2023–0051.

(i) No Reporting Requirement

Although the service information referenced in EASA AD 2023–0051 specifies to submit certain information to the manufacturer, this AD does not include that requirement.

(j) Additional AD Provisions

The following provisions also apply to this AD:

- (1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your

request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the International Validation Branch, send it to the attention of the person identified in paragraph (k) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Validation Branch, FAA; or EASA; or Airbus SAS's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC):* Except as required by paragraph (j)(2) of this AD, if any service information contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

(k) Additional Information

For more information about this AD, contact Dat Le, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7317; email: dat.v.le@faa.gov.

(l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2023–0051, dated March 10, 2023.

(ii) [Reserved]

(3) For EASA AD 2023–0051, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email: Ads@easa.europa.eu; website: easa.europa.eu. You may find this EASA AD on the EASA website: ad.easa.europa.eu.

(4) You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th Street, Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fr.inspection@nara.gov, or go to:

www.archives.gov/federal-register/cfr/ibr-locations.html.

Issued on July 8, 2023.

Michael Linegang,

Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2023-14851 Filed 7-13-23; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2023-1492; Project Identifier MCAI-2023-00195-T]

RIN 2120-AA64

Airworthiness Directives; Airbus SAS Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to supersede Airworthiness Directive (AD) 2022-18-09, which applies to certain Airbus SAS Model A319-111, -112, -113, -114, -115, -131, -132, and -133; A320-211, -212, -214, -216, -231, -232, -233, -251N, and -271N; and A321-111, -112, -131, -211, -212, -213, -231, -232, -251N, and -253N airplanes. AD 2022-18-09 continues to require the actions in AD 2019-26-01 and AD 2021-23-15, and adds airplanes to the applicability. Since the FAA issued AD 2022-18-09, it was determined that additional airplanes and galleys are subject to the unsafe condition, and a compliance time for certain airplanes should be extended. This proposed AD would continue to require the actions in AD 2022-18-09 and would require expanding the applicability, obtaining and following additional instructions for certain modified airplanes, and extending the compliance time for certain airplanes, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference (IBR). The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by August 28, 2023.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to regulations.gov. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

AD Docket: You may examine the AD docket at regulations.gov under Docket No. FAA-2023-1492; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

Material Incorporated by Reference:

- For the AD identified in this NPRM, you may contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; website easa.europa.eu. You may find this material on the EASA website at ad.easa.europa.eu. It is also available at regulations.gov under Docket No. FAA-2023-1492.

- You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

FOR FURTHER INFORMATION CONTACT:

Timothy Dowling, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 206-231-3667; email timothy.p.dowling@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include "Docket No. FAA-2023-1492; Project Identifier MCAI-2023-00195-T" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments

received, without change, to regulations.gov, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Timothy Dowling, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 206-231-3667; email timothy.p.dowling@faa.gov. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

The FAA issued AD 2022-18-09, Amendment 39-22160 (87 FR 56576, September 15, 2022) (AD 2022-18-09), for certain Airbus SAS Model A319-111, -112, -113, -114, -115, -131, -132, and -133; A320-211, -212, -214, -216, -231, -232, -233, -251N, and -271N, and A321-111, -112, -131, -211, -212, -213, -231, -232, -251N, and -253N airplanes. AD 2022-18-09 was prompted by an MCAI originated by EASA, which is the Technical Agent for the Member States of the European Union. EASA issued AD 2022-0026, dated February 16, 2022, to correct an unsafe condition.

AD 2022-18-09 continues to require the actions that were required by AD 2019-26-11, Amendment 39-21022 (85 FR 6755, February 6, 2020) (AD 2019-26-11) and AD 2021-23-15, Amendment 39-21813 (86 FR 68894, December 6, 2021) (AD 2021-23-15), and adds airplanes to the applicability. The FAA issued AD 2022-18-09 to address potential failure of the galley door and release of waste bins during a rejected take-off or an emergency landing, and potential container detachment from the galley under