

Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this material at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, visit www.archives.gov/federal-register/cfr/ibr-locations or email fr.inspection@nara.gov.

Issued on February 10, 2026.

Peter A. White,

Deputy Director, Integrated Certificate Management Division, Aircraft Certification Service.

[FR Doc. 2026-02912 Filed 2-12-26; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2026-1323; Project Identifier MCAI-2025-01190-T]

RIN 2120-AA64

Airworthiness Directives; Airbus SAS Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for all Airbus SAS Model A350-941 and -1041 airplanes. This proposed AD was prompted by the obsolescence of the clamp holding in place the oxygen generator in the container and introduction of a new clamp from another manufacturer with different locking torque specifications, which were not properly reflected in Airbus documentation. This proposed AD would require replacing each affected part, would prohibit accomplishing maintenance actions using certain versions of a maintenance procedure task, and would also prohibit the installation of affected parts. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by March 30, 2026.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to regulations.gov. Follow the instructions for submitting comments.
- *Fax:* 202-493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room

W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

• *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

AD Docket: You may examine the AD docket at regulations.gov under Docket No. FAA-2026-1323; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

Material Incorporated by Reference:

• For European Union Aviation Safety Agency (EASA) material identified in this proposed AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADS@easa.europa.eu. You may find this material on the EASA website at ad.easa.europa.eu. It is also available at regulations.gov under Docket No. FAA-2026-1323.

• You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

FOR FURTHER INFORMATION CONTACT: Dan Rodina, Aviation Safety Engineer, FAA, 2200 South 216th St., Des Moines, WA 98198; phone: 206-231-3225; email: Dan.Rodina@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments using a method listed under the **ADDRESSES** section. Include “Docket No. FAA-2026-1323; Project Identifier MCAI-2025-01190-T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to regulations.gov, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Dan Rodina, Aviation Safety Engineer, FAA, 2200 South 216th St., Des Moines, WA 98198; phone: 206-231-3225; email: Dan.Rodina@faa.gov. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2025-0138, dated July 1, 2025 (EASA AD 2025-0138) (also referred to as the MCAI), to correct an unsafe condition for all Airbus SAS Model A350-941 and -1041 airplanes. The MCAI states that due to the obsolescence of the clamp holding in place the oxygen generator in the container, Collins introduced a new clamp from another manufacturer with different locking torque specifications. This new torque value was not properly reflected in Airbus documentation. Installing a part using the incorrect torque value (not updated with new specifications) could lead to damage of the chemical oxygen generator housing. This condition, if not corrected, could lead to a reduction of the available oxygen capacity of the airplane when needed, possibly resulting in injury to the airplane occupants.

The FAA is proposing this AD to address the unsafe condition on these products.

You may examine the MCAI in the AD docket at regulations.gov under Docket No. FAA-2026-1323.

Material Incorporated by Reference Under 1 CFR Part 51

EASA AD 2025-0138 specifies procedures for replacing each affected chemical oxygen generator. EASA AD 2025-0138 also prohibits accomplishing

maintenance actions using maintenance procedure task A350-A-35-21-36-A0001-720A-A dated earlier than October 2024, and prohibits the installation of affected parts. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

FAA’s Determination

These products have been approved by the civil aviation authority of another country and are approved for operation in the United States. Pursuant to the FAA’s bilateral agreement with this State of Design Authority, that authority has notified the FAA of the unsafe condition described in the MCAI referenced above. The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop in other products of the same type design.

Proposed AD Requirements in This NPRM

This proposed AD would require accomplishing the actions specified in EASA AD 2025-0138 described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD.

Explanation of Required Compliance Information

In the FAA’s ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, the FAA proposes to incorporate EASA AD 2025-0138 by reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2025-0138 in its entirety through that

incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in EASA AD 2025-0138 does not mean that operators need comply only with that section. For example, where the AD requirement refers to “all required actions and compliance times,” compliance with this AD requirement is not limited to the section titled “Required Action(s) and Compliance Time(s)” in EASA AD 2025-0138. Material required by EASA AD 2025-0138 for compliance will be available at *regulations.gov* under Docket No. FAA-2026-1323 after the FAA final rule is published.

Costs of Compliance

The FAA estimates that this AD, if adopted as proposed, would affect 38 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Up to 350 work-hour × \$85 per hour = \$29,750	Up to \$230,300	Up to \$260,050	Up to \$9,881,900.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national government and the States, or

on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

Airbus SAS: Docket No. FAA-2026-1323; Project Identifier MCAI-2025-01190-T.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by March 30, 2026.

(b) Affected ADs

None.

(c) Applicability

This AD applies to all Airbus SAS Model A350-941 and -1041 airplanes, certificated in any category.

(d) Subject

Air Transport Association (ATA) of America Code 35, Oxygen.

(e) Unsafe Condition

This AD was prompted by the obsolescence of the clamp holding in place the oxygen generator in the container and introduction of a new clamp from another manufacturer with different locking torque specifications, which were not properly reflected in Airbus documentation. Installing a part using the incorrect torque value (not updated with new specifications) could lead to damage of the chemical oxygen generator housing. This condition, if not addressed, could result in a reduction of the available

oxygen capacity of the airplane when needed, possibly resulting in injury to the airplane occupants.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, European Union Aviation Safety Agency (EASA) AD 2025–0138, dated July 1, 2025 (EASA AD 2025–0138).

(h) Exceptions to EASA AD 2025–0138

(1) Where EASA AD 2025–0138 refers to its effective date, this AD requires using the effective date of this AD.

(2) Where EASA AD 2025–0138 defines the affected parts as those meeting certain conditions listed in “Table 1 of the AOT”, this AD requires replacing that text with “Table 1 of Airbus Alert Operator Transmission (AOT) A35P024–24, dated April 22, 2025”.

(3) Where EASA AD 2025–0138 defines a serviceable part as “Any chemical oxygen generator, eligible for installation in accordance with Airbus approved instructions, that is not an affected part”, this AD requires replacing that text with “Any chemical oxygen generator, eligible for installation, that is not an affected part”.

(4) This AD does not adopt the “Remarks” section of EASA AD 2025–0138.

(i) Additional AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, AIR–520, Continued Operational Safety Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the Continued Operational Safety Branch, send it to the attention of the person identified in paragraph (j) of this AD and email to: AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, AIR–520, Continued Operational Safety Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC)*: Except as required by paragraph (i)(2) of this AD, if any material referenced in EASA AD 2025–0138 contains paragraphs that are labeled as RC, the instructions in RC paragraphs, including subparagraphs under an RC paragraph, must be done to comply with this AD; any paragraphs, including subparagraphs under

those paragraphs, that are not identified as RC are recommended. The instructions in paragraphs, including subparagraphs under those paragraphs, not identified as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the instructions identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to instructions identified as RC require approval of an AMOC.

(j) Additional Information

For more information about this AD, contact Dan Rodina, Aviation Safety Engineer, FAA, 2200 South 216th St., Des Moines, WA 98198; phone: 206–231–3225; email: Dan.Rodina@faa.gov.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference of the material listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this material as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2025–0138, dated July 1, 2025.

(ii) [Reserved]

(3) For EASA material identified in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu. You may find this material on the EASA website at ad.easa.europa.eu.

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(5) You may view this material at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, visit www.archives.gov/federal-register/cfr/ibr-locations or email fr.inspection@nara.gov.

Issued on February 10, 2026.

Peter A. White,

Deputy Director, Integrated Certificate Management Division, Aircraft Certification Service.

[FR Doc. 2026–02910 Filed 2–12–26; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 71

[Docket No. FAA–2023–2225; Airspace Docket No. 23–AGL–35]

RIN 2120–AA66

Establishment of Class E Airspace; Wall Municipal Airport, Wall, SD

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: This action proposes to establish Class E airspace extending upward from 700 feet above the surface at Wall Municipal Airport, Wall, SD, to accommodate the airport’s transition to instrument flight rules (IFR) service. This action would support the safety and management of IFR operations at the airport.

DATES: Comments must be received on or before March 30, 2026.

ADDRESSES: Send comments identified by FAA Docket No. FAA–2023–2225 and Airspace Docket No. 23–AGL–35 using any of the following methods:

* *Federal eRulemaking Portal:* Go to www.regulations.gov and follow the online instructions for sending your comments electronically.

* *Mail:* Send comments to Docket Operations, M–30; U.S. Department of Transportation, 1200 New Jersey Avenue SE, Room W12–140, West Building Ground Floor, Washington, DC 20590–0001.

* *Hand Delivery or Courier:* Take comments to Docket Operations in Room W12–140 of the West Building Ground Floor at 1200 New Jersey Avenue SE, Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

* *Fax:* Fax comments to Docket Operations at (202) 493–2251.

Docket: Background documents or comments received may be read at www.regulations.gov at any time. Follow the online instructions for accessing the docket or go to the Docket Operations in Room W12–140 of the West Building Ground Floor at 1200 New Jersey Avenue SE, Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

FAA Order JO 7400.11K, Airspace Designations and Reporting Points, and subsequent amendments can be viewed online at www.faa.gov/air_traffic/publications/.

FOR FURTHER INFORMATION CONTACT:

Nathan A. Chaffman, Federal Aviation Administration, Western Service Center, Operations Support Group, 2200 S 216th Street, Des Moines, WA 98198; telephone (206) 231–3460.

SUPPLEMENTARY INFORMATION:

Authority for This Rulemaking

The FAA’s authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the