

Remedies and complaint filing deadlines vary by program or incident.

Persons with disabilities who require alternative means of communication to obtain program information (e.g., Braille, large print, audiotape, American Sign Language, etc.) should contact the State or local Agency that administers the program or contact USDA through the Telecommunications Relay Service at 711 (voice and TTY). Program information may be made available in languages other than English.

To file a program discrimination complaint, a complainant should complete a Form AD-3027, *USDA Program Discrimination Complaint Form*, which can be obtained online at <https://www.usda.gov/sites/default/files/documents/ad-3027.pdf> and at any USDA office or write a letter addressed to USDA and provide in the letter all the information requested in the form. To request a copy of the complaint form, call (866) 632-9992. Submit your completed form or letter to USDA by:

- a. *Mail*: U.S. Department of Agriculture, Office of the Assistant Secretary for Civil Rights, 1400 Independence Avenue SW, Mail Stop 9410, Washington, DC 20250-9410; or
 - b. *Fax*: (202) 690-7442; or
 - c. *Email*: program.intake@usda.gov.
- USDA is an equal opportunity provider, employer, and lender.

List of Subjects in 7 CFR Part 3560

Accounting, Administrative practice and procedure, Aged, Conflict of interest, Government property management, Grant programs—housing and community development, Insurance, Loan programs—agriculture, Loan programs—housing and community development, Low and moderate-income housing, Migrant labor, Mortgages, Nonprofit organizations, Public housing, Rent subsidies, Reporting and recordkeeping requirements, Rural areas.

For the reasons set forth in the preamble, the Rural Housing Service amends 7 CFR part 3560 as follows:

PART 3560—DIRECT MULTI-FAMILY HOUSING LOANS AND GRANTS

- 1. The authority citation for part 3560 continues to read as follows:

Authority: 42 U.S.C. 1480.

Subpart D—Multi-Family Housing Occupancy

- 2. Amend § 3560.156 by revising paragraph (c)(18)(xvi) to read as follows:

§ 3560.156 Lease requirements.

* * * * *

(c) * * *

(18) * * *

(xvi) The procedures that must be followed by the borrower and the tenant in giving notices required under terms of the lease, including lease violation notices;

* * * * *

§ 3560.159 [Amended]

- 3. Amend § 3560.159 by removing paragraph (a)(3).

§ 3560.160 [Amended]

- 4. Amend § 3560.160 by removing paragraph (c)(4).

George Kelly,

Administrator, Rural Housing Service, USDA Rural Development.

[FR Doc. 2026-03716 Filed 2-24-26; 8:45 am]

BILLING CODE 3410-XV-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2026-0744; Project Identifier MCAI-2026-00001-Q; Amendment 39-23258; AD 2026-03-09]

RIN 2120-AA64

Airworthiness Directives; Aerospace & Defense Oxygen Systems SaS (Part of Safran Aerosystems) (Formerly Known as Air Liquide) Portable Breathing Equipment (PBE)

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule; request for comments.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for certain Aerospace & Defense Oxygen Systems SaS portable breathing equipment (PBE). This AD was prompted by reports of occurrences of PBE not delivering oxygen once donned. This AD requires replacing affected PBE and prohibits the installation of affected PBE. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective March 12, 2026.

The Director of the Federal Register approved the incorporation by reference of certain publications listed in this AD as of March 12, 2026.

The FAA must receive comments on this AD by April 13, 2026.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal*: Go to [regulations.gov](https://www.regulations.gov). Follow the instructions for submitting comments.

- *Fax*: 202-493-2251.

- *Mail*: U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery*: Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

AD Docket: You may examine the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2026-0744; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

Material Incorporated by Reference:

- For European Union Aviation Safety Agency (EASA) material identified in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu. You may find this material on the EASA website at ad.easa.europa.eu.

- For Safran Aerosystems material identified in this AD, contact Safran Aerosystems, Customer Support & Services, Technical Publication Department, 61 Rue Pierre Curie, CS20001, 78373 Plaisir Cedex, France; phone: + 33 (0)1 61 34 23 23; email: tech-support.sao@safrangroup.com; website: www.safran-aerosystems.com.

- You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2026-0744.

FOR FURTHER INFORMATION CONTACT:

Harjot Rana, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: 516-228-7344; email: 9-AVS-AIR-BACO-COS@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written data, views, or arguments about this final rule. Send your comments using a method listed under the **ADDRESSES** section. Include “Docket No. FAA-2026-0744; Project Identifier MCAI-2026-00001-Q” at the beginning of your comments. The most helpful comments reference a specific portion of

the final rule, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this final rule because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to *regulations.gov*, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this final rule.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this AD contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this AD, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this AD. Submissions containing CBI should be sent to Harjot Rana, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: 516-228-7344; email: 9-AVS-AIR-BACO-COS@faa.gov. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2025-0297, dated December 23, 2025 (EASA AD 2025-0297) (also referred to as the MCAI), to correct an unsafe condition for certain Aerospace & Defense Oxygen Systems SaS PBE. The MCAI states there have been occurrences of PBE not delivering oxygen once donned. Following investigation, a manufacturing issue has been identified, affecting certain PBE. The unsafe condition, if not addressed, could lead to flight or cabin crewmember incapacitation, possibly affecting crewmember capability to accomplish tasks during an emergency, or resulting in fatal injury to that crewmember.

The FAA is issuing this AD to address the unsafe condition on these products.

You may examine the MCAI in the AD docket at *regulations.gov* under Docket No. FAA-2026-0744.

Material Incorporated by Reference Under 1 CFR Part 51

The FAA reviewed EASA AD 2025-0297, which specifies procedures for replacing affected PBE and prohibiting the installation of affected PBE. EASA AD 2025-0297 also allows deferring the requirements as specified in the applicable aircraft master minimum equipment list (MMEL) under certain conditions. EASA AD 2025-0297 also mandates a life limit for the affected PBE.

The FAA also reviewed Appendix A of Safran Aerosystems Service Bulletin 1540F-35-002, Revision 01, dated January 5, 2026, which identifies the affected PBE. (The affected PBE are listed in an xlsx file, modified January 5, 2026, 8:51 p.m. UTC+01:00, which is digitally attached to the Safran service bulletin as the content of Appendix A.)

This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

FAA's Determination

These products have been approved by the civil aviation authority of another country and are approved for operation in the United States. Pursuant to the FAA's bilateral agreement with this State of Design Authority, that authority has notified the FAA of the unsafe condition described in the MCAI and material referenced above. The FAA is issuing this AD after determining that the unsafe condition described previously is likely to exist or develop on other products of the same type design.

Requirements of This AD

This AD requires accomplishing the actions specified in EASA AD 2025-0297 described previously, except for any differences identified as exceptions in the regulatory text of this AD. See "Clarification of Required Actions in the MCAI" for a discussion of the general differences included in this AD.

Clarification of Required Actions in the MCAI

Although paragraph (1) of EASA AD 2025-0297 provides compliance times (*i.e.*, 14 days or 3 months, as applicable) to replace affected PBE, paragraph (4) of EASA AD 2025-0297 mandates a life limit for the affected PBE. The affected PBE have a life limit of 10 years (120

months). The life limit in paragraph (4) of the EASA AD 2025-0297 takes precedence over the compliance times in paragraph (1) of the EASA AD 2025-0297 (*i.e.*, you do not get to use the 14 day or 3-month compliance time for replacement if the affected PBE is over the life limit). Therefore, the FAA has added paragraph (h)(3) to this AD to clarify the required actions.

Explanation of Required Compliance Information

In the FAA's ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, EASA AD 2025-0297 is incorporated by reference in this AD. This AD requires compliance with EASA AD 2025-0297 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this AD. Using common terms that are the same as the heading of a particular section in EASA AD 2025-0297 does not mean that operators need comply only with that section. For example, where the AD requirement refers to "all required actions and compliance times," compliance with this AD requirement is not limited to the section titled "Required Action(s) and Compliance Time(s)" in EASA AD 2025-0297. Material required by EASA AD 2025-0297 for compliance will be available at *regulations.gov* under Docket No. FAA-2026-0744 after this AD is published.

Justification for Immediate Adoption and Determination of the Effective Date

Section 553(b) of the Administrative Procedure Act (APA) (5 U.S.C. 551 *et seq.*) authorizes agencies to dispense with notice and comment procedures for rules when the agency, for "good cause," finds that those procedures are "impracticable, unnecessary, or contrary to the public interest." Under this section, an agency, upon finding good cause, may issue a final rule without providing notice and seeking comment prior to issuance. Further, section 553(d) of the APA authorizes agencies to make rules effective in less than thirty days, upon a finding of good cause.

An unsafe condition exists that requires the immediate adoption of this AD without providing an opportunity for public comments prior to adoption. The FAA has found that the risk to the flying public justifies forgoing notice and comment prior to adoption of this

rule because there are reports of occurrences of PBE not delivering oxygen once donned, which could lead to flight or cabin crewmember incapacitation, possibly affecting crewmember capability to accomplish tasks during an emergency, or resulting in fatal injury to that crewmember. The PBE are designed to protect the user's eyes and respiratory tract in a contaminated atmosphere, which provides the ability to locate and combat a fire, and for the ability for the flightcrew to continue to control the airplane. Additionally, the compliance time in this AD is shorter than the time

necessary for the public to comment and for publication of the final rule. Accordingly, notice and opportunity for prior public comment are impracticable and contrary to the public interest pursuant to 5 U.S.C. 553(b).

In addition, the FAA finds that good cause exists pursuant to 5 U.S.C. 553(d) for making this amendment effective in less than 30 days, for the same reasons the FAA found good cause to forgo notice and comment.

Regulatory Flexibility Act

The requirements of the Regulatory Flexibility Act (RFA) do not apply when

an agency finds good cause pursuant to 5 U.S.C. 553 to adopt a rule without prior notice and comment. Because the FAA has determined that it has good cause to adopt this rule without notice and comment, RFA analysis is not required.

Costs of Compliance

The FAA estimates that this AD affects 2,642 appliances installed on various aircraft.

The FAA estimates the following costs to comply with this AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
1 work-hour × \$85 per hour = \$85	Up to \$2,500	Up to \$2,585	Up to \$6,829,570*.

* It is unknown how many of the 2,642 appliances are still installed on U.S.-registered aircraft as some appliances have exceeded the 10-year maximum life limit.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866, and
- (2) Will not affect intrastate aviation in Alaska.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

2026–03–09 Aerospace & Defense Oxygen Systems SaS (Part of Safran Aerosystems) (Formerly Known as Air Liquide): Amendment 39–23258; Docket No. FAA–2026–0744; Project Identifier MCAI–2026–00001–Q.

(a) Effective Date

This airworthiness directive (AD) is effective March 12, 2026.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Aerospace & Defense Oxygen Systems SaS (part of Safran Aerosystems) (formerly known as Air Liquide) portable breathing equipment (PBE), part number (P/N) 15–40F–11 and P/N 15–40F–80, having a manufacturing date between March 2015 and March 2017 (inclusive), and having a serial number listed

in Appendix A (modified January 5, 2026, 8:51 p.m. UTC+01:00) of Safran Aerosystems Service Bulletin 1540F–35–002, Revision 01, dated January 5, 2026. These PBE are eligible for installation on any aircraft and may have been installed during the aircraft manufacturing process (production line), or in-service modification, either through a supplemental type certificate, or using type certificate holder (TCH) approved modification instructions, or through a non-TCH modification approval.

(d) Subject

Air Transport Association (ATA) of America Code 35, Oxygen.

(e) Unsafe Condition

This AD was prompted by reports of occurrences of PBE not delivering oxygen once donned. Following investigation, a manufacturing issue has been identified, affecting certain PBE. The FAA is issuing this AD to address affected PBE. The unsafe condition, if not addressed, could lead to flight or cabin crewmember incapacitation, possibly affecting crewmember capability to accomplish tasks during an emergency, or resulting in fatal injury to that crewmember.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, European Union Aviation Safety Agency (EASA) AD 2025–0297, dated December 23, 2025 (EASA AD 2025–0297).

(h) Exceptions to EASA AD 2025–0297

- (1) Where EASA AD 2025–0297 refers to its effective date, this AD requires using the effective date of this AD.
- (2) Where the definition of affected PBE in EASA AD 2025–0297 specifies "having

manufacturing date between November 2015 and March 2017 (inclusive), and a s/n as listed in Appendix A of the SB”, this AD requires replacing that text with “having a manufacturing date between March 2015 and March 2017 (inclusive), and a serial number listed in Appendix A (modified January 5, 2026, 8:51 p.m. UTC+01:00) of Safran Aerosystems Service Bulletin 1540F–35–002, Revision 01, dated January 5, 2026”.

(3) Where paragraph (1) of EASA AD 2025–0297 specifies “Replace the affected PBE”, this AD requires replacing that text with “Except as required by paragraph (4) of EASA AD 2025–0297, replace the affected PBE”.

(4) This AD does not adopt the “Remarks” section of EASA AD 2025–0297.

(i) Additional AD Provisions

The following provisions also apply to this AD:

Alternative Methods of Compliance (AMOCs): The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the International Validation Branch, send it to the attention of the person identified in paragraph (j) of this AD and email to: AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(j) Additional Information

For more information about this AD, contact Harjot Rana, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: 516–228–7344; email: 9-AVS-AIR-BACO-COS@faa.gov.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference of the material listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this material as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2025–0297, dated December 23, 2025.

(ii) Safran Aerosystems Service Bulletin 1540F–35–002, Revision 01, dated January 5, 2026, including the Appendix A digital attachment, modified January 5, 2026, 8:51 p.m. UTC+01:00.

(3) For EASA material identified in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu. You may find this material on the EASA website at ad.easa.europa.eu.

(4) For Safran Aerosystems material identified in this AD, contact Safran Aerosystems, Customer Support & Services, Technical Publication Department, 61 Rue Pierre Curie, CS20001, 78373 Plaisir Cedex, France; phone: + 33 (0)1 61 34 23 23; email: tech-support.sao@safrangroup.com; website: www.safran-aerosystems.com.

(5) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(6) You may view this material at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, visit www.archives.gov/federal-register/cfr/ibr-locations or email fr.inspection@nara.gov.

Issued on February 23, 2026.

Steven W. Thompson,

Acting Deputy Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2026–03799 Filed 2–23–26; 4:15 pm]

BILLING CODE 4910–13–P

DEPARTMENT OF HEALTH AND HUMAN SERVICES

Centers for Medicare & Medicaid Services

42 CFR Part 438

Managed Care

CFR Correction

This rule is being published by the Office of the Federal Register to correct an editorial or technical error that appeared in the most recent annual revision of the Code of Federal Regulations.

In Title 42 of the Code of Federal Regulations, Parts 430 to 481, revised as of October 1, 2025, in section 438.72, reinstate paragraph (a) to read as follows:

§ 438.72 Additional requirements for long-term services and supports.

(a) *Nursing facility services and services delivered in intermediate care facilities for individuals with intellectual disabilities (ICFs/IID).* The State must comply with the requirements in § 442.43 for nursing facility and ICF/IID services.

* * * * *

[FR Doc. 2026–03779 Filed 2–24–26; 8:45 am]

BILLING CODE 0099–10–P

FEDERAL COMMUNICATIONS COMMISSION

47 CFR Parts 0 and 15

[ET Docket No. 18–295 and GN Docket No. 17–183; FCC 26–1; FR ID 331544]

Unlicensed Use of the 6 GHz Band; Expanding Flexible Use in Mid-Band Spectrum Between 3.7 and 24 GHz

AGENCY: Federal Communications Commission.

ACTION: Final rule.

SUMMARY: In this document, the Federal Communications Commission (Commission or FCC) adopts rules allowing unlicensed geofenced variable power (GVP) devices to operate in the U–NII–5 and U–NII–7 portions of the 6 GHz band (5.925–7.125 GHz) at up to 11 dBm/MHz EIRP power spectral density and 24 dBm EIRP. GVP devices must use geofencing systems to prevent harmful interference to licensed microwave links and radio astronomy observatories. The geofencing systems will calculate exclusion zones where GVP devices cannot operate on specified frequencies. Each GVP access point must have a geolocation capability to determine its location and avoid operating on prohibited frequencies within the exclusion zones. Client devices must operate 6 dB below the access point’s authorized power. These rules permit the GVP devices to operate at higher power than very lower power 6 GHz band unlicensed devices.

DATES: This rule is effective April 27, 2026.

FOR FURTHER INFORMATION CONTACT: Nicholas Oros of the Office of Engineering and Technology, Policy and Rules Division, at 202–418–0636 or Nicholas.Oros@fcc.gov.

SUPPLEMENTARY INFORMATION: This is a summary of the Commission’s *Fourth Report and Order*, in ET Docket No. 18–295 and GN Docket No. 17–183, FCC 26–1, adopted on January 29, 2026, and released on January 30, 2026. The full text of this document is available for public inspection and can be downloaded at <https://docs.fcc.gov/public/attachments/FCC-26-1A1.pdf>. Alternative formats are available for people with disabilities (Braille, large print, electronic files, audio format) by sending an email to fcc504@fcc.gov or calling the Commission’s Consumer and Governmental Affairs Bureau at (202) 418–0530 (voice), (202) 418–0432 (TTY).

Regulatory Flexibility Act. The Regulatory Flexibility Act of 1980, as amended (RFA) requires that an agency