

# Proposed Rules

Federal Register

Vol. 91, No. 46

Tuesday, March 10, 2026

This section of the FEDERAL REGISTER contains notices to the public of the proposed issuance of rules and regulations. The purpose of these notices is to give interested persons an opportunity to participate in the rule making prior to the adoption of the final rules.

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2026-2286; Project Identifier MCAI-2025-01556-T]

RIN 2120-AA64

#### Airworthiness Directives; Airbus SAS Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for certain Airbus SAS Model A318 series airplanes; Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes; Model A320-211, -212, -214, -216, -231, -232, and -233 airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes. This proposed AD was prompted by reports of broken bolts in seat rail connections of certain frames. This proposed AD would require replacement of the nylon bushes with bronze bushes in the affected areas and would also prohibit the installation of affected parts in those areas. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by April 24, 2026.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to [regulations.gov](https://www.regulations.gov). Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5

p.m., Monday through Friday, except Federal holidays.

**AD Docket:** You may examine the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2026-2286; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

**Material Incorporated by Reference:**

- For European Union Aviation Safety Agency (EASA) material identified in this proposed AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu). You may find this material on the EASA website at [ad.easa.europa.eu](https://ad.easa.europa.eu). It is also available at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2026-2286.

- You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

**FOR FURTHER INFORMATION CONTACT:** Camille L Seay, Aviation Safety Engineer, FAA, 2200 South 216th St., Des Moines, WA 98198; phone 817-222-5149; email [Camille.L.Seay@faa.gov](mailto:Camille.L.Seay@faa.gov).

**SUPPLEMENTARY INFORMATION:**

**Comments Invited**

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments using a method listed under the **ADDRESSES** section. Include “Docket No. FAA-2026-2286; Project Identifier MCAI-2025-01556-T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to [regulations.gov](https://www.regulations.gov), including any personal information you provide. The agency

will also post a report summarizing each substantive verbal contact received about this NPRM.

**Confidential Business Information**

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Camille L Seay, Aviation Safety Engineer, FAA, 2200 South 216th St., Des Moines, WA 98198; phone 817-222-5149; email [Camille.L.Seay@faa.gov](mailto:Camille.L.Seay@faa.gov). Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

**Background**

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2025-0207R1, dated October 30, 2025 (EASA AD 2025-0207R1) (also referred to as the MCAI), to correct an unsafe condition for certain Airbus SAS Model A318 series airplanes; Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes; Model A320-211, -212, -214, -216, -231, -232, and -233 airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes. Model A320-215 airplanes are not certificated by the FAA and are not included on the U.S. type certificate data sheet; this proposed AD therefore does not include those airplanes in the applicability. The MCAI states reports were received of broken bolts in the seat rail connections in the area of frame (FR) 47 (for Model A320 and A321 series airplanes), FR47/51 (for Model A319 series airplanes), FR47/54 (for Model A318 series airplanes), FR35 (for Model A318, A319 and A320 series

airplanes) and FR35.8 (for A321 series airplanes), as applicable. This condition, if not corrected, could lead to seat detachment and passengers' injuries under emergency landing loads. The FAA is proposing this AD to address the unsafe condition on these products.

You may examine the MCAI in the AD docket at *regulations.gov* under Docket No. FAA-2026-2286.

**Material Incorporated by Reference Under 1 CFR Part 51**

EASA AD 2025-0207R1 specifies procedures that would require replacement of the nylon bushes with bronze bushes in the affected areas. The replacement includes doing a rotating probe inspection of the fastener holes for cracking, checking the hole diameter of the bracket assemblies, seat track, and long beam, as applicable, to determine if it is within tolerance, checking the inner diameter of the bushing to determine if it is within tolerance, and contacting the manufacturer for repair instructions and doing the repair. EASA AD 2025-0207R1 would also prohibit the installation of affected parts in those areas.

This material is reasonably available because the interested parties have access to it through their normal course

of business or by the means identified in the **ADDRESSES** section.

**FAA's Determination**

These products have been approved by the civil aviation authority of another country and are approved for operation in the United States. Pursuant to the FAA's bilateral agreement with this State of Design Authority, that authority has notified the FAA of the unsafe condition described in the MCAI referenced above. The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop in other products of the same type design.

**Proposed AD Requirements in This NPRM**

This proposed AD would require accomplishing the actions specified in EASA AD 2025-0207R1 described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD.

**Explanation of Required Compliance Information**

In the FAA's ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with

requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, the FAA proposes to incorporate EASA AD 2025-0207R1 by reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2025-0207R1 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in EASA AD 2025-0207R1 does not mean that operators need comply only with that section. For example, where the AD requirement refers to "all required actions and compliance times," compliance with this AD requirement is not limited to the section titled "Required Action(s) and Compliance Time(s)" in EASA AD 2025-0207R1. Material required by EASA AD 2025-0207R1 for compliance will be available at *regulations.gov* under Docket No. FAA-2026-2286 after the FAA final rule is published.

**Costs of Compliance**

The FAA estimates that this AD, if adopted as proposed, would affect 1,404 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

**ESTIMATED COSTS FOR REQUIRED ACTIONS**

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Up to 76 work-hours × \$85 per hour = \$6,460 .....	Up to \$13,400 .....	Up to \$19,860 .....	Up to \$27,883,440.

The FAA has received no definitive data on which to base the cost estimates for the on-condition repairs specified in this proposed AD.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an

unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**Airbus SAS:** Docket No. FAA-2026-2286; Project Identifier MCAI-2025-01556-T.

**(a) Comments Due Date**

The FAA must receive comments on this airworthiness directive (AD) by April 24, 2026.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to Airbus SAS Model A318-111, -112, -121, and -122 airplanes; Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes; Model A320-211, -212, -214, -216, -231, -232, and -233 airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes; certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2025-0207R1, dated October 30, 2025 (EASA AD 2025-0207R1).

**(d) Subject**

Air Transport Association (ATA) of America Code 53, Fuselage.

**(e) Unsafe Condition**

This AD was prompted by reports of broken bolts in the affected seat rail connections of certain frames. The FAA is issuing this AD to address broken bolts in the affected seat rail connections of certain frames. The unsafe condition, if not addressed, could result in seat detachment and passenger injuries under emergency landing loads.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Requirements**

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2025-0207R1.

**(h) Exceptions to EASA AD 2025-0207R1**

(1) Where EASA AD 2025-0207R1 refers to October 7, 2025 (the effective date of the original issue of EASA AD 2025-0207), this AD requires using the effective date of this AD.

(2) Where the service information specified in EASA AD 2025-0207 specifies to contact Airbus if any cracking is found or if any diameter is not within tolerance, this AD requires doing a repair before further flight using a method approved by the Manager, AIR-520, Continued Operational Safety Branch, FAA; or EASA; or Airbus SAS's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature."

(3) This AD does not adopt the "Remarks" section of EASA AD 2025-0207R1

**(i) Additional AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, AIR-520, Continued Operational Safety Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector

or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the Continued Operational Safety Branch, send it to the attention of the person identified in paragraph (j) of this AD and email to: [AMOC@faa.gov](mailto:AMOC@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, AIR-520, Continued Operational Safety Branch, FAA; or EASA; or Airbus SAS's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC)*: Except as required by paragraphs (h)(2) and (i)(2) of this AD, if any material contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

**(j) Additional Information**

For more information about this AD, contact Camille L Seay, Aviation Safety Engineer, FAA, 2200 South 216th St., Des Moines, WA 98198; phone 817-222-5149; email [Camille.L.Seay@faa.gov](mailto:Camille.L.Seay@faa.gov).

**(k) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference of the material listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this material as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2025-0207R1, dated October 30, 2025.

(ii) [Reserved]

(3) For EASA material identified in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu). You may find this material on the EASA website at [ad.easa.europa.eu](http://ad.easa.europa.eu).

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this material at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, visit [www.archives.gov/federal-register/cfr/ibr-locations](http://www.archives.gov/federal-register/cfr/ibr-locations) or email [fr.inspection@nara.gov](mailto:fr.inspection@nara.gov).

Issued on March 3, 2026.

**Lona C. Saccomando,**

*Acting Deputy Director, Integrated Certificate Management Division, Aircraft Certification Service.*

[FR Doc. 2026-04713 Filed 3-9-26; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2026-2293; Project Identifier MCAI-2025-00684-T]**

**RIN 2120-AA64**

**Airworthiness Directives; Dassault Aviation Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for certain Dassault Aviation Model FALCON 7X airplanes. This proposed AD was prompted by a report of a failed extension of the inboard slats during the landing phase, which the crew alerting system (CAS) did not indicate to the flightcrew. This proposed AD would require modifying the maintenance and avionics interface computer (MAIC) software and revising the existing airplane flight manual (AFM) to provide improved procedures for addressing slats failures. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by April 24, 2026.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to [regulations.gov](http://regulations.gov). Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

*AD Docket:* You may examine the AD docket at [regulations.gov](http://regulations.gov) under Docket No. FAA-2026-2293; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket