

In accordance with the Paperwork Reduction Act of 1995, (44 U.S.C. chapter 35), the Order's information collection requirements have been previously approved by OMB and assigned OMB No. 0581-0178, Vegetable and Specialty Crops. No changes in those requirements are necessary as a result of this rule. Should any changes become necessary, they would be submitted to OMB for approval.

This final rule will not impose any additional reporting or recordkeeping requirements on either small or large California date handlers. As with all Federal marketing order programs, reports and forms are periodically reviewed to reduce information requirements and duplication by industry and public sector agencies.

AMS is committed to complying with the E-Government Act, to promote the use of the internet and other information technologies to provide increased opportunities for citizen access to Government information and services, and for other purposes.

AMS has not identified any relevant Federal rules that duplicate, overlap, or conflict with this final rule.

A proposed rule concerning this action was published in the **Federal Register** on September 12, 2025 (90 FR 44151). Copies of the proposed rule were provided to all California date handlers. In addition, the proposal was made available through the internet by AMS and the Office of the Federal Register via <https://www.regulations.gov>. A 30-day comment period ending October 14, 2025, was provided to all interested persons to respond to the proposal. AMS received no comments during the comment period. Accordingly, AMS made no changes to the rule as proposed.

After consideration of all relevant material presented, including the information and recommendations submitted by the Committee and other available information, AMS has determined that this rule is consistent with and effectuates the purposes of the Act.

List of Subjects in 7 CFR Part 987

Dates, Marketing agreements, Reporting and recordkeeping requirements.

For the reasons set forth in the preamble, 7 CFR part 987 is amended as follows:

PART 987—DOMESTIC DATES PRODUCED OR PACKED IN RIVERSIDE COUNTY, CALIFORNIA

■ 1. The authority citation for 7 CFR part 987 continues to read as follows:

Authority: 7 U.S.C. 601–674.

■ 2. Revise § 987.339 to read as follows:

§ 987.339 Assessment rate.

On and after October 1, 2024, an assessment rate of \$0.05 per hundredweight is established for dates produced or packed in Riverside County, California.

Erin Morris,

Administrator, Agricultural Marketing Service.

[FR Doc. 2026-09502 Filed 5-12-26; 8:45 am]

BILLING CODE:P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2026-1324; Project Identifier AD-2025-00986-T; Amendment 39-23334; AD 2026-09-12]

RIN 2120-AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for certain The Boeing Company Model 737-100, -200, -200C, -300, -400, and -500 series airplanes. This AD was prompted by a report of cracks found in the fuselage skin underneath the aft drain mast. This AD requires repetitive inspections of the fuselage skin and structure common to the aft drain mast for any crack or corrosion and applicable on-condition actions. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective June 17, 2026.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of June 17, 2026.

ADDRESSES:

AD Docket: You may examine the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2026-1324; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, any comments

received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

Material Incorporated by Reference:

- For Boeing material identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; website myboeingfleet.com.

- You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2026-1324.

FOR FURTHER INFORMATION CONTACT:

Wayne Ha, Aviation Safety Engineer, FAA, 2200 South 216th St., Des Moines, WA 98198; phone: 562-627-5238; email: wayne.ha@faa.gov.

SUPPLEMENTARY INFORMATION:

Background

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain The Boeing Company Model 737-100, -200, -200C, -300, -400, and -500 series airplanes. The NPRM was published in the **Federal Register** on February 13, 2026 (91 FR 6798). The NPRM was prompted by a report of cracks found in the fuselage skin underneath the aft drain mast. In the NPRM, the FAA proposed to require repetitive inspections of the fuselage skin and structure common to the aft drain mast for any crack or corrosion and applicable on-condition actions. The FAA is issuing this AD to address cracking or corrosion in the fuselage skin and structure common to the aft drain mast. This condition, if not addressed, could result in the inability of the principal structural element (PSE) to sustain limit loads, which may result in rapid decompression of the fuselage and loss of structural integrity of the airplane.

Discussion of Final Airworthiness Directive

Comments

The FAA received comments from Aviation Partners Boeing and Boeing who supported the NPRM without change.

Conclusion

The FAA reviewed the relevant data and determined that air safety requires adopting this AD as proposed. Accordingly, the FAA is issuing this AD to address the unsafe condition on these products. Except for minor editorial changes, this AD is adopted as proposed in the NPRM. None of the changes will increase the economic burden on any operator.

Material Incorporated by Reference Under 1 CFR Part 51

The FAA reviewed Boeing Alert Service Bulletin 737–53A1409, Revision 1, dated October 27, 2023. This material specifies procedures for repetitive internal detailed inspections around the fastener holes, cutout, channel, and fillers of the structure common to the aft drain mast (also referred to as the “aft waste water drain mast”) for any crack or corrosion; repetitive external detailed inspections and external surface high frequency eddy current (HFEC) inspections around the fastener holes

and cutout on the fuselage skin common to the aft drain mast for any crack or corrosion; and applicable on-condition actions. On-condition actions include obtaining and following repair instructions. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

Costs of Compliance

The FAA estimates that this AD affects 123 airplanes of U.S. registry. The FAA estimates the following costs to comply with this AD:

ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Repetitive inspections	7 work-hours × \$85 per hour = \$595 per inspection cycle.	\$0	\$595 per inspection cycle	\$73,185 per inspection cycle.

The FAA has received no definitive data on which to base the cost estimates for the on-condition actions specified in this AD.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:
Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

2026–09–12 The Boeing Company:
Amendment 39–23334; Docket No. FAA–2026–1324; Project Identifier AD–2025–00986–T.

(a) Effective Date

This airworthiness directive (AD) is effective June 17, 2026.

(b) Affected ADs

None.

(c) Applicability

This AD applies to The Boeing Company Model 737–100, –200, –200C, –300, –400, and –500 series airplanes, certificated in any category, as identified in Boeing Alert Service Bulletin 737–53A1409, Revision 1, dated October 27, 2023.

(d) Subject

Air Transport Association (ATA) of America Code 53, Fuselage.

(e) Unsafe Condition

This AD was prompted by a report of cracks found in the fuselage skin underneath the aft drain mast. The FAA is issuing this AD to address cracking or corrosion in the fuselage skin and structure common to the aft drain mast. The unsafe condition, if not addressed, could result in the inability of the principal structural element (PSE) to sustain limit loads, which may result in rapid decompression of the fuselage and loss of structural integrity of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions for Group 1 Airplanes

For airplanes identified as Group 1 in Boeing Alert Service Bulletin 737–53A1409, Revision 1, dated October 27, 2023: Within 120 days after the effective date of this AD, inspect the fuselage skin and structure common to the aft drain mast for any crack or corrosion and applicable on-condition actions, using a method approved in accordance with the procedures specified in paragraph (k) of this AD.

(h) Required Actions for Group 2 Airplanes

For airplanes identified as Group 2 in Boeing Alert Service Bulletin 737–53A1409, Revision 1, dated October 27, 2023: Except as specified in paragraph (i) of this AD, at the applicable times specified in paragraph 1.E.,

“Compliance,” of Boeing Alert Service Bulletin 737–53A1409, Revision 1, dated October 27, 2023, do all applicable actions identified in, and in accordance with, paragraphs 3.B.2., “Action 1: Do Part 2,” and 3.B.3., “Action 2: Do Part 3,” of the Accomplishment Instructions of Boeing Alert Service Bulletin 737–53A1409, Revision 1, dated October 27, 2023.

(i) Exceptions to Service Bulletin Specifications

(1) Where the Compliance Time columns of the tables in the “Compliance” paragraph of Boeing Alert Service Bulletin 737–53A1409, Revision 1, dated October 27, 2023, refer to the original issue date of Service Bulletin 737–53A1409, this AD requires using the effective date of this AD.

(2) Where Boeing Alert Service Bulletin 737–53A1409, Revision 1, dated October 27, 2023, specifies contacting Boeing for repair instructions: This AD requires doing the repair using a method approved in accordance with the procedures specified in paragraph (k) of this AD.

(j) Credit for Previous Actions

This paragraph provides credit for the actions specified in paragraphs (g) and (h) of this AD, as applicable, if those actions were performed before the effective date of this AD using Boeing Alert Service Bulletin 737–53A1409, dated May 4, 2023.

(k) Alternative Methods of Compliance (AMOCs)

(1) The Manager, AIR–520, Continued Operational Safety Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the Continued Operational Safety Branch, send it to the attention of the person identified in paragraph (l) of this AD. Information may be emailed to: AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, AIR–520, Continued Operational Safety Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(l) Additional Information

(1) For more information about this AD, contact Wayne Ha, Aviation Safety Engineer, FAA, 2200 South 216th St., Des Moines, WA 98198; phone: 562–627–5238; email: wayne.ha@faa.gov.

(2) Material identified in this AD that is not incorporated by reference is available at the address specified in paragraph (m)(3) of this AD.

(m) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference of the material listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this material as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Boeing Alert Service Bulletin 737–53A1409, Revision 1, dated October 27, 2023.

(ii) [Reserved]

(3) For Boeing material identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; website myboeingfleet.com.

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(5) You may view this material at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, visit www.archives.gov/federal-register/cfr/ibr-locations or email fr.inspection@nara.gov.

Issued on April 28, 2026.

Brian Knaup,

Acting Deputy Director, Integrated Certificate Management Division, Aircraft Certification Service.

[FR Doc. 2026–09535 Filed 5–12–26; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2026–0017; Project Identifier MCAI–2023–00681–R; Amendment 39–23326; AD 2026–09–05]

RIN 2120–AA64

Airworthiness Directives; Leonardo S.p.A. Helicopters

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for all Leonardo S.p.A. Model AB139 and AW139 helicopters. This AD was prompted by reports of a damaged spare inflation system of a certain life raft kit due to the inappropriate shipment of the parts. This AD requires replacing certain life raft inflation systems and prohibits installing an affected life raft inflation system on any helicopter. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective June 17, 2026.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of June 17, 2026.

ADDRESSES:

AD Docket: You may examine the AD docket at regulations.gov under Docket No. FAA–2026–0017; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

Material Incorporated by Reference:

- For European Union Aviation Safety Agency (EASA) material identified in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; phone: +49 221 8999 000; email: ADs@easa.europa.eu; website: easa.europa.eu. You may find the EASA material on the EASA website at ad.easa.europa.eu.

- You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 10101 Hillwood Parkway, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222–5110. It is also available at regulations.gov under Docket No. FAA–2026–0017.

FOR FURTHER INFORMATION CONTACT:

David Enns, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: (316) 946–4147; email: david.enns@faa.gov.

SUPPLEMENTARY INFORMATION:

Background

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to all Leonardo S.p.A. Model AB139 and AW139 helicopters. The NPRM was published in the **Federal Register** on January 21, 2026 (91 FR 2504). The NPRM was prompted by EASA AD 2023–0101, dated May 15, 2023, issued by EASA, which is Technical Agent for the Member States of the European Union (EASA AD 2023–0101) (also referred to as the MCAI). The MCAI states that there have been reports of a damaged spare inflation system of life raft kit part number (P/N) 3G9560F00111, P/N 3G9560F00112, and P/N 4G2560F00811. The MCAI further states that subsequent investigation results revealed the damage was caused