

(g) Required Actions

Except as specified in paragraphs (h) and (i) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, European Union Aviation Safety Agency AD 2023–0101, dated May 15, 2023 (EASA AD 2023–0101).

(h) Exceptions to EASA AD 2023–0101

(1) Where EASA AD 2023–0101 refers to its effective date, this AD requires using the effective date of this AD.

(2) Where EASA AD 2023–0101 requires compliance in terms of flight hours, this AD requires using hours time-in-service.

(3) Where EASA AD 2023–0101 defines “affected part,” this AD requires replacing that definition with “Life raft inflation system part number (P/N) 202402A and P/N 202256A that:

(i) have a cylinder and valve serial number (S/N) as specified in Leonardo Helicopters Alert Service Bulletin (ASB) 139–734, original issue, dated April 13, 2023, or Revision A, dated April 28, 2023; except those that have not been modified in accordance with the instructions of Aero Sekur Service Bulletin (SB) SB–139–25–005, Revision 1, dated April 21, 2023, and Survitec SB 25–225–A, Revision 1, dated February 23, 2023 (co-published as one document) as applicable; or

(ii) have a cylinder where the S/N cannot be determined.”

(4) This AD does not adopt the “Remarks” section of EASA AD 2023–0101.

(i) No Reporting and Return of Parts Requirement

Although the material referenced in EASA AD 2023–0101 specifies to submit certain information to the manufacturer and to return the parts to the manufacturer, this AD does not require any of these actions.

(j) Special Flight Permits

Special flight permits may be issued in accordance with 14 CFR 21.197 and 21.199, provided there are no flights over water.

(k) Alternative Methods of Compliance (AMOCs)

(1) The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the International Validation Branch, send it to the attention of the person identified in paragraph (l) of this AD and email to: AMOC@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(l) Additional Information

For more information about this AD, contact David Enns, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: (316) 946–4147; email: david.enns@faa.gov.

(m) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference of the material listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this material as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2023–0101, dated May 15, 2023.

(ii) [Reserved]

(3) For EASA material identified in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; phone: +49 221 8999 000; email: ADs@easa.europa.eu; website: easa.europa.eu. You may find the EASA material on the EASA website at ad.easa.europa.eu.

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 10101 Hillwood Parkway, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222–5110.

(5) You may view this material at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, visit www.archives.gov/federal-register/cfr/ibr-locations or email fr.inspection@nara.gov.

Issued on May 6, 2026.

Steven W. Thompson,

Acting Deputy Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2026–09520 Filed 5–12–26; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA–2026–0737; Project Identifier MCAI–2025–01038–T; Amendment 39–23328; AD 2026–09–07]

RIN 2120–AA64

Airworthiness Directives; Dassault Aviation Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: The FAA is superseding Airworthiness Directive (AD) 2023–22–10, which applied to certain Dassault Aviation Model FAN JET FALCON, FAN JET FALCON SERIES C, D, E, F, and G airplanes. AD 2023–22–10 required revising the existing maintenance or inspection program, as applicable, to incorporate new or more restrictive airworthiness limitations. Since the FAA issued AD 2023–22–10, the FAA has determined that new or more restrictive airworthiness limitations are necessary. This AD continues to require certain actions in

AD 2023–22–10 and requires revising the existing maintenance or inspection program, as applicable, to incorporate new or more restrictive airworthiness limitations. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective June 17, 2026.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of June 17, 2026.

The Director of the Federal Register approved the incorporation by reference of a certain other publication listed in this AD as of December 26, 2023 (88 FR 80567, November 20, 2023).

ADDRESSES:

AD Docket: You may examine the AD docket at regulations.gov under Docket No. FAA–2026–0737; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

Material Incorporated by Reference:

- For European Union Aviation Safety Agency (EASA) material identified in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu. You may find this material on the EASA website at ad.easa.europa.eu.

- You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. It is also available at regulations.gov under Docket No. FAA–2026–0737.

FOR FURTHER INFORMATION CONTACT: Kimi Kim, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: 781–238–7693; email: 9-AVS-AIR-BACO-COS@faa.gov.

SUPPLEMENTARY INFORMATION:**Background**

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to supersede AD 2023–22–10, Amendment 39–22594 (88 FR 80567, November 20, 2023) (AD 2023–22–10). AD 2023–22–10 applied to certain Dassault Aviation Model FAN JET FALCON, FAN JET FALCON SERIES C,

D, E, F, and G airplanes. AD 2023–22–10 required revising the existing maintenance or inspection program, as applicable, to incorporate new or more restrictive airworthiness limitations. The FAA issued AD 2023–22–10 to address, among other things, fatigue cracking and damage in principal structural elements. The unsafe condition, if not addressed, could result in reduced structural integrity of the airplane.

The NPRM was published in the **Federal Register** on February 6, 2026 (91 FR 5375). The NPRM was prompted by EASA AD 2025–0124, dated May 28, 2025 (EASA AD 2025–0124) (also referred to as the MCAI), issued by EASA, which is the Technical Agent for the Member States of the European Union. The MCAI states that new or more restrictive airworthiness limitations have been developed.

In the NPRM, the FAA proposed to continue to require certain actions in AD 2023–22–10 and to require revising the existing maintenance or inspection program, as applicable, to incorporate new or more restrictive airworthiness limitations, as specified in EASA AD 2025–0124. The FAA is issuing this AD to address the unsafe condition on these products.

You may examine the MCAI in the AD docket at *regulations.gov* under Docket No. FAA–2026–0737.

Discussion of Final Airworthiness Directive

Comments

The FAA received no comments on the NPRM or on the determination of the cost to the public.

Conclusion

These products have been approved by the civil aviation authority of another country and are approved for operation in the United States. Pursuant to the FAA's bilateral agreement with this State of Design Authority, that authority has notified the FAA of the unsafe condition described in the MCAI referenced above. The FAA reviewed the relevant data, considered any comments received, and determined that air safety requires adopting this AD as proposed. Accordingly, the FAA is issuing this AD to address the unsafe condition on these products. Except for minor editorial changes, this AD is adopted as proposed in the NPRM. None of the changes will increase the economic burden on any operator.

Material Incorporated by Reference Under 1 CFR Part 51

The FAA reviewed EASA AD 2025–0124, which specifies new or more

restrictive airworthiness limitations for airplane structures and safe life limits.

This AD also requires EASA AD 2023–0059, dated March 16, 2023, which the Director of the Federal Register approved for incorporation by reference as of December 26, 2023 (88 FR 80567, November 20, 2023).

This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

Costs of Compliance

The FAA estimates that this AD affects 32 airplanes of U.S. registry. The FAA estimates the following costs to comply with this AD:

The FAA estimates the total cost per operator for the retained actions from AD 2023–22–10 to be \$7,650 (90 work-hours × \$85 per work-hour).

The FAA has determined that revising the existing maintenance or inspection program takes an average of 90 work-hours per operator, although the agency recognizes that this number may vary from operator to operator. Since operators incorporate maintenance or inspection program changes for their affected fleet(s), the FAA has determined that a per-operator estimate is more accurate than a per-airplane estimate.

The FAA estimates the total cost per operator for the new actions to be \$7,650 (90 work-hours × \$85 per work-hour).

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a

substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by:
 - a. Removing Airworthiness Directive (AD) 2023–22–10, Amendment 39–22594 (88 FR 80567, November 20, 2023); and
 - b. Adding the following new AD:

2026–09–07 Dassault Aviation: Amendment 39–23328; Docket No. FAA–2026–0737; Project Identifier MCAI–2025–01038–T.

(a) Effective Date

This airworthiness directive (AD) is effective June 17, 2026.

(b) Affected ADs

This AD replaces AD 2023–22–10, Amendment 39–22594 (88 FR 80567, November 20, 2023) (AD 2023–22–10).

(c) Applicability

This AD applies to Dassault Aviation Model FAN JET FALCON, FAN JET FALCON SERIES C, D, E, F, and G airplanes, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2025–0124, dated May 28, 2025 (EASA AD 2025–0124).

(d) Subject

Air Transport Association (ATA) of America Code 05, Time Limits/Maintenance Checks.

(e) Unsafe Condition

This AD was prompted by a determination that new or more restrictive airworthiness

limitations are necessary. The FAA is issuing this AD to address fatigue cracking, damage, and corrosion in principal structural elements. The unsafe condition, if not addressed, could result in reduced structural integrity of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Retained Revision of the Existing Maintenance or Inspection Program, With a New Terminating Action

This paragraph restates the requirements of paragraph (i) of AD 2023–22–10, with a new terminating action. Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2023–0059, dated March 16, 2023 (EASA AD 2023–0059). Accomplishing the revision of the existing maintenance or inspection program required by paragraph (j) of this AD terminates the requirements of this paragraph.

(h) Retained Exceptions to EASA AD 2023–0059, With No Changes

This paragraph restates the exceptions specified in paragraph (j) of AD 2023–22–10, with no changes.

(1) This AD does not adopt the requirements specified in paragraphs (1) and (2) of EASA AD 2023–0059.

(2) Paragraph (3) of EASA AD 2023–0059 specifies revising “the approved AMP” within 12 months after its effective date, but this AD requires revising the existing maintenance or inspection program, as applicable, within 90 days after December 26, 2023 (the effective date of AD 2023–22–10).

(3) The initial compliance time for doing the tasks specified in paragraph (3) of EASA AD 2023–0059 is at the applicable “limitations” and “associated thresholds” as incorporated by the requirements of paragraph (3) of EASA AD 2023–0059, or within 90 days after December 26, 2023 (the effective date of AD 2023–22–10), whichever occurs later.

(4) This AD does not adopt the provisions specified in paragraphs (4) and (5) of EASA AD 2023–0059.

(5) This AD does not adopt the “Remarks” section of EASA AD 2023–0059.

(i) Retained Restrictions on Alternative Actions and Intervals, With a New Exception

This paragraph restates the requirements of paragraph (k) of AD 2023–22–10, with a new exception. Except as required by paragraph (j) of this AD, after the maintenance or inspection program has been revised as required by paragraph (g) of this AD, no alternative actions (e.g., inspections) or intervals are allowed unless they are approved as specified in the provisions of the “Ref. Publications” section of EASA AD 2023–0059.

(j) New Revision of the Existing Maintenance or Inspection Program

Except as specified in paragraph (k) of this AD: Comply with all required actions and compliance times specified in, and in

accordance with, EASA AD 2025–0124. Accomplishing the revision of the existing maintenance or inspection program required by this paragraph terminates the requirements of paragraph (g) of this AD.

(k) Exceptions to EASA AD 2025–0124

(1) This AD does not adopt the requirements specified in paragraphs (1) and (2) of EASA AD 2025–0124.

(2) Paragraph (3) of EASA AD 2025–0124 specifies revising “the approved AMP,” within 12 months after its effective date, but this AD requires revising the existing maintenance or inspection program, as applicable, within 90 days after the effective date of this AD.

(3) The initial compliance time for doing the tasks specified in paragraph (3) of EASA AD 2025–0124 is at the applicable “limitations” and “associated thresholds” as incorporated by the requirements of paragraph (3) of EASA AD 2025–0124, or within 90 days after the effective date of this AD, whichever occurs later.

(4) This AD does not adopt the provisions specified in paragraphs (4) and (5) of EASA AD 2025–0124.

(5) This AD does not adopt the “Remarks” section of EASA AD 2025–0124.

(l) New Provisions for Alternative Actions and Intervals

After the existing maintenance or inspection program has been revised as required by paragraph (j) of this AD, no alternative actions (e.g., inspections) and intervals are allowed unless the actions and intervals are approved as specified in the provisions of the “Ref. Publications” section of EASA AD 2025–0124.

(m) Additional AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the International Validation Branch, send it to the attention of the person identified in paragraph (n) of this AD and email to: AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Validation Branch, FAA; or EASA; or Dassault Aviation’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(n) Additional Information

For more information about this AD, contact Kimi Kim, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410,

Westbury, NY 11590; phone: 781–238–7693; email: 9-AVS-AIR-BACO-COS@faa.gov.

(o) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the material listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this material as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(3) The following material was approved for IBR on June 17, 2026.

(i) European Union Aviation Safety Agency (EASA) AD 2025–0124, dated May 28, 2025.

(ii) [Reserved]

(4) The following material was approved for IBR on December 26, 2023 (88 FR 80567, November 20, 2023).

(i) EASA AD 2023–0059, dated March 16, 2023.

(ii) [Reserved]

(5) For EASA material identified in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu. You may find this material on the EASA website at ad.easa.europa.eu.

(6) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(7) You may view this material at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, visit www.archives.gov/federal-register/cfr/ibr-locations or email fr.inspection@nara.gov.

Issued on April 24, 2026.

Steven W. Thompson,

Acting Deputy Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2026–09536 Filed 5–12–26; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2025–2556; Project Identifier MCAI–2024–00034–R; Amendment 39–23330; AD 2026–09–09]

RIN 2120–AA64

Airworthiness Directives; Leonardo S.p.A. Helicopters

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: The FAA is superseding Airworthiness Directive (AD) 2021–23–04 which applied to certain Leonardo S.p.A. Model A109E helicopters. AD 2021–23–04 required repetitive inspections of the intersection of the