

5. No corrosive fluids or gases that may escape from any lithium battery may damage surrounding structure or any adjacent systems, equipment, or electrical wiring of the airplane in such a way as to cause a major or more severe failure condition, in accordance with § 25.1309(b) and applicable regulatory guidance.

6. Each lithium battery installation must have provisions to prevent any hazardous effect on structure or essential systems caused by the maximum amount of heat the battery can generate during a short circuit of the battery or of its individual cells.

7. Lithium battery installations must have a system to control the charging rate of the battery automatically, so as to prevent battery overheating or overcharging, and,

(a) A battery temperature sensing and over-temperature warning system with a means for automatically disconnecting the battery from its charging source in the event of an over-temperature condition, or

(b) A battery failure sensing and warning system with a means for automatically disconnecting the battery from its charging source in the event of battery failure.

8. Any lithium battery installation whose function is required for safe operation of the airplane must incorporate a monitoring and warning feature that will provide an indication to the appropriate flight crewmembers whenever the state-of-charge of the batteries has fallen below levels considered acceptable for dispatch of the airplane.

9. The Instructions for Continued Airworthiness required by § 25.1529 must contain maintenance requirements to assure that the lithium battery is sufficiently charged at appropriate intervals specified by the battery manufacturer to ensure that batteries whose function is required for safe operation of the airplane will not degrade below specified ampere-hour levels sufficient to power the electronic flight bag applications that are required for continued safe flight and landing. The Instructions for Continued Airworthiness must also contain procedures for the maintenance of lithium batteries in spares storage to prevent the replacement of batteries whose function is required for safe operation of the airplane with batteries that have experienced degraded charge retention ability or other damage due to prolonged storage at a low state of charge. Precautions should be included in the Instructions for Continued Airworthiness maintenance instructions to prevent mishandling of the lithium

battery which could result in short-circuit or other unintentional damage that could result in personal injury or property damage.

**Note 1:** The term "sufficiently charged" means a charge that is above a minimum level, expressed in ampere-hours, below which the battery will reduce its capacity to be fully charged and/or the ability to retain a complete charge. This reduction in charging and retaining a full charge capacity is below the original design capacity that may result from normal operational degradation.

**Note 2:** These special conditions are not intended to replace § 25.1353(c), Amendment 25-113 in the certification basis of the L2 Consulting Services supplemental type certificate. These special conditions apply only to lithium batteries and their installations. The requirements of § 25.1353(c), Amendment 25-113 remain in effect for batteries and battery installations on the L2 Consulting Services supplemental type certificate that do not use lithium batteries.

Compliance with the requirements of these special conditions must be shown by test or analysis, with the concurrence of the Fort Worth Special Certification Office.

Issued in Renton, Washington, on July 29, 2008.

**Ali Bahrami,**

*Manager, Transport Airplane Directorate,  
Aircraft Certification Service.*

[FR Doc. E8-18139 Filed 8-6-08; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2008-0848; Directorate Identifier 2008-NM-082-AD]

RIN 2120-AA64

#### Airworthiness Directives; Saab Model SAAB 2000 Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for the products listed above. This proposed AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as:

Subsequent to accidents involving Fuel Tank System explosions in flight \* \* \* and

on ground, \* \* \* Special Federal Aviation Regulation 88 (SFAR88) \* \* \* required \* \* \* a design review against explosion risks.

\* \* \* \* \*

The unsafe condition is the potential of ignition sources inside fuel tanks, which, in combination with flammable fuel vapors, could result in fuel tank explosions and consequent loss of the airplane. The proposed AD would require actions that are intended to address the unsafe condition described in the MCAI.

**DATES:** We must receive comments on this proposed AD by September 8, 2008.

**ADDRESSES:** You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* (202) 493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-40, 1200 New Jersey Avenue, SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Shahram Daneshmandi, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 227-1112; fax (425) 227-1149.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2008-0848; Directorate Identifier 2008-NM-082-AD" at the beginning of your comments. We specifically invite

comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

#### Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued EASA Airworthiness Directive 2008-0031, dated February 15, 2008 (referred to after this as "the MCAI"), to correct an unsafe condition for the specified products. The MCAI states:

Subsequent to accidents involving Fuel Tank System explosions in flight \* \* \* and on ground, the FAA has published Special Federal Aviation Regulation 88 (SFAR88) in June 2001. In their Letters referenced 04/00/02/07/01-L296 dated March 4th, 2002 and 04/00/02/07/03-L024, dated February 3rd, 2003, the Joint Aviation Authorities (JAA) recommended the application of a similar regulation to the National Aviation Authorities (NAA).

Under current European Union regulation, all holders of type certificates for passenger transport aircraft with either a passenger capacity of 30 or more, or a payload capacity of 7,500 pounds (3,402 kg) or more, which have received their certification after January 1st, 1958, are required to conduct a design review against explosion risks.

This Airworthiness Directive (AD), which is the result of one of these design reviews, requires a wiring modification of the FQIS (Fuel Quantity Indication System) Signal conditioner 28VDC (volts direct current) supply and replacement of the Fuel Pump harness inside the wing tanks (both LH and RH (left- and right-hand)).

The unsafe condition is the potential of ignition sources inside fuel tanks, which, in combination with flammable fuel vapors, could result in fuel tank explosions and consequent loss of the airplane. The corrective actions include functional and operational tests. You may obtain further information by examining the MCAI in the AD docket.

The FAA has examined the underlying safety issues involved in fuel tank explosions on several large transport airplanes, including the adequacy of existing regulations, the service history of airplanes subject to those regulations, and existing maintenance practices for fuel tank systems. As a result of those findings, we issued a regulation titled "Transport Airplane Fuel Tank System Design

Review, Flammability Reduction and Maintenance and Inspection Requirements" (66 FR 23086, May 7, 2001). In addition to new airworthiness standards for transport airplanes and new maintenance requirements, this rule included Special Federal Aviation Regulation No. 88 ("SFAR 88," Amendment 21-78, and subsequent Amendments 21-82 and 21-83).

Among other actions, SFAR 88 requires certain type design (i.e., type certificate (TC) and supplemental type certificate (STC)) holders to substantiate that their fuel tank systems can prevent ignition sources in the fuel tanks. This requirement applies to type design holders for large turbine-powered transport airplanes and for subsequent modifications to those airplanes. It requires them to perform design reviews and to develop design changes and maintenance procedures if their designs do not meet the new fuel tank safety standards. As explained in the preamble to the rule, we intended to adopt airworthiness directives to mandate any changes found necessary to address unsafe conditions identified as a result of these reviews.

In evaluating these design reviews, we have established four criteria intended to define the unsafe conditions associated with fuel tank systems that require corrective actions. The percentage of operating time during which fuel tanks are exposed to flammable conditions is one of these criteria. The other three criteria address the failure types under evaluation: Single failures, single failures in combination with a latent condition(s), and in-service failure experience. For all four criteria, the evaluations included consideration of previous actions taken that may mitigate the need for further action.

The Joint Aviation Authorities (JAA) has issued a regulation that is similar to SFAR 88. (The JAA is an associated body of the European Civil Aviation Conference (ECAC) representing the civil aviation regulatory authorities of a number of European States who have agreed to cooperate in developing and implementing common safety regulatory standards and procedures.) Under this regulation, the JAA stated that all members of the ECAC that hold type certificates for transport category airplanes are required to conduct a design review against explosion risks.

We have determined that the actions identified in this AD are necessary to reduce the potential of ignition sources inside fuel tanks, which, in combination with flammable fuel vapors, could result in fuel tank explosions and consequent loss of the airplane.

#### Relevant Service Information

Saab has issued Service Bulletin 2000-28-013, dated October 11, 2007; and Service Bulletin 2000-28-014, Revision 02, dated January 23, 2008. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

#### FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

#### Differences Between This AD and the MCAI or Service Information

We have reviewed the MCAI and related service information and, in general, agree with their substance. But we might have found it necessary to use different words from those in the MCAI to ensure the AD is clear for U.S. operators and is enforceable. In making these changes, we do not intend to differ substantively from the information provided in the MCAI and related service information.

We might also have proposed different actions in this AD from those in the MCAI in order to follow FAA policies. Any such differences are highlighted in a NOTE within the proposed AD.

#### Costs of Compliance

Based on the service information, we estimate that this proposed AD would affect about 6 products of U.S. registry. We also estimate that it would take about 80 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$80 per work-hour. Required parts would cost about \$14,040 per product. Where the service information lists required parts costs that are covered under warranty, we have assumed that there will be no charge for these costs. As we do not control warranty coverage for affected parties, some parties may incur costs higher than estimated here. Based on these figures, we estimate the cost of the proposed AD on U.S. operators to be \$122,640, or \$20,440 per product.

### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
3. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this proposed AD and placed it in the AD docket.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

### § 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new AD:

**Saab Aircraft AB:** Docket No. FAA-2008-0848; Directorate Identifier 2008-NM-082-AD.

### Comments Due Date

(a) We must receive comments by September 8, 2008.

### Affected ADs

(b) None.

### Applicability

(c) This AD applies to Saab Model SAAB 2000 airplanes, certificated in any category, all serial numbers.

### Subject

(d) Air Transport Association (ATA) of America Code 28: Fuel.

### Reason

(e) The mandatory continuing airworthiness information (MCAI) states: Subsequent to accidents involving Fuel Tank System explosions in flight \* \* \* and on ground, the FAA has published Special Federal Aviation Regulation 88 (SFAR88) in June 2001. In their Letters referenced 04/00/02/07/01-L296 dated March 4th, 2002 and 04/00/02/07/03-L024, dated February 3rd, 2003, the Joint Aviation Authorities (JAA) recommended the application of a similar regulation to the National Aviation Authorities (NAA).

Under current European Union regulation, all holders of type certificates for passenger transport aircraft with either a passenger capacity of 30 or more, or a payload capacity of 7,500 pounds (3,402 kg) or more, which have received their certification after January 1st, 1958, are required to conduct a design review against explosion risks.

This Airworthiness Directive (AD), which is the result of one of these design reviews, requires a wiring modification of the FQIS (Fuel Quantity Indication System) Signal conditioner 28VDC (volts direct current) supply and replacement of the Fuel Pump harness inside the wing tanks (both LH and RH (left- and right-hand)).

The unsafe condition is the potential of ignition sources inside fuel tanks, which, in combination with flammable fuel vapors, could result in fuel tank explosions and consequent loss of the airplane. The corrective actions include functional and operational tests.

### Actions and Compliance

(f) Unless already done, do the following actions.

(1) Within 72 months after the effective date of this AD, replace the fuel pump harness inside each (both left- and right-hand) inboard wing fuel tank in accordance with the Accomplishment Instructions of Saab Service Bulletin 2000-028-013, dated October 11, 2007 (Modification 6250), including a follow-up functional test and operational test.

(2) Within 72 months after the effective date of this AD, modify the wiring of the 28 VDC (volts direct current) supply to the

signal conditioner and the 132VP (feed through connector) in accordance with the Accomplishment Instructions of Saab Service Bulletin 2000-28-014, Revision 02, dated January 23, 2008 (Modification 6251), including follow-up operational test.

(3) Actions done before the effective date of this AD in accordance with Saab Service Bulletin 2000-28-014, Revision 01, dated November 6, 2007, are acceptable for compliance with the requirements of paragraph (f)(2) of this AD.

### FAA AD Differences

**Note:** This AD differs from the MCAI and/or service information as follows: No differences.

### Other FAA AD Provisions

(g) The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Shahram Daneshmandi, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 227-1112; fax (425) 227-1149. Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(3) *Reporting Requirements:* For any reporting requirement in this AD, under the provisions of the Paperwork Reduction Act, the Office of Management and Budget (OMB) has approved the information collection requirements and has assigned OMB Control Number 2120-0056.

### Related Information

(h) Refer to MCAI European Aviation Safety Agency Airworthiness Directive 2008-0031, dated February 15, 2008; Saab Service Bulletin 2000-028-013, dated October 11, 2007; and Saab Service Bulletin 2000-28-014, Revision 02, dated January 23, 2008 for related information.

Issued in Renton, Washington, on July 29, 2008.

**Ali Bahrami,**

*Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. E8-18202 Filed 8-6-08; 8:45 am]

**BILLING CODE 4910-13-P**